

NDB/DME MAJ <u>316</u> Chan 114 (116.7)	APP CRS 249°	Rwy Ldg 7913 TDZE 7 Apt Elev 7
---	------------------------	---


NDB RWY 25

AMATA KABUA INTL (MAJ)(PKMJ)

T Rwy 25 helicopter visibility reduction below $\frac{3}{4}$ SM NA.
A NA Obtain local altimeter setting on CTAF; when not received, procedure NA. Uncontrolled airspace below 5500.

MISSED APPROACH: Climb to 1000 on MAJ NDB/DME bearing 249° then climbing right turn to 1300 direct MAJ NDB/DME and hold.

MAJURO RADIO
123.6 (CTAF) **L**

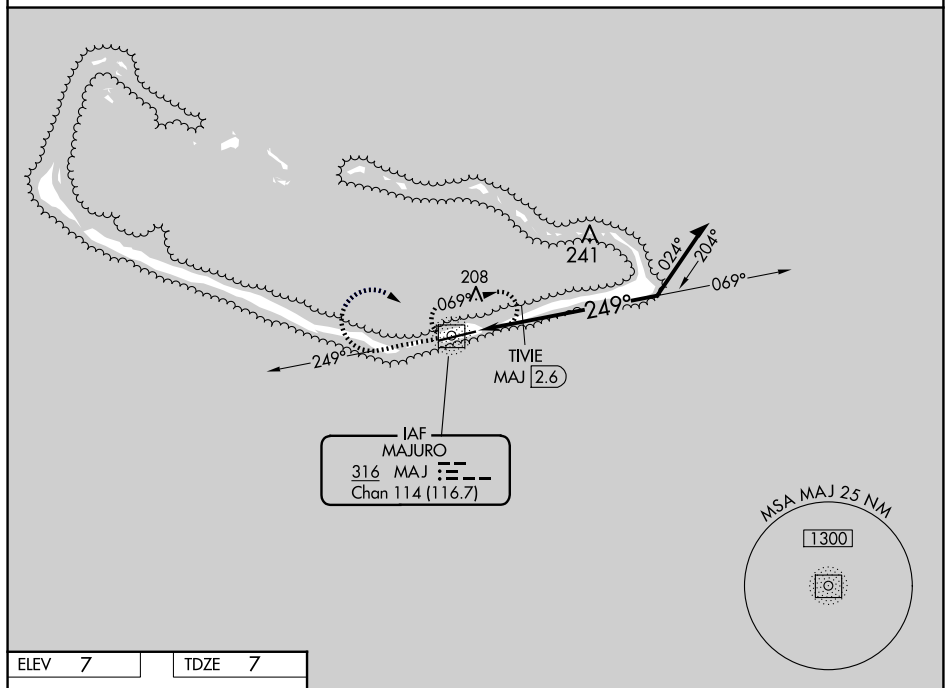

ELEV	7		TDZE	7
------	---	--	------	---

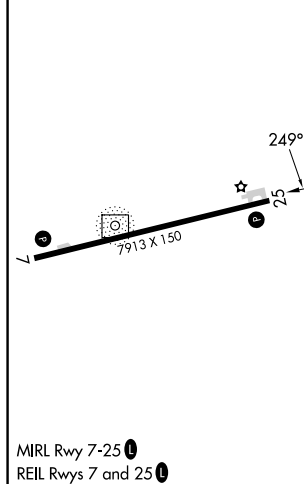


Diagram illustrating the TIE FIX MINIMUMS (DME REQUIRED) procedure. The diagram shows a 1000 ft MSL altitude with a 249° heading, a 1300 ft MSL altitude with a 249° heading, and a 1300 ft MSL altitude with a 249° heading. The diagram also shows a 2.95° TCH 46, a 2.6 NM distance, and a 249° heading. The diagram is labeled 'TIE FIX MINIMUMS (DME REQUIRED)'.