

VORTAC BFM 116.35 Chan 110(Y)	APP CRS 333°	Rwy Ldg 9618 TDZE 25 Apt Elev 26
---	------------------------	---


VOR RWY 32
MOBILE INTL (BFM)

T When local altimeter setting not received, use Mobile Rgnl altimeter setting and increase all MDAs 60 feet. For inop MALSR, increase S-32 Cats C/D visibility to 1 $\frac{1}{2}$ SM. For inop MALSR when using Mobile Rgnl altimeter setting, increase S-32 Cats C/D visibility to 1 $\frac{1}{2}$ SM.



MISSED APPROACH: Climb to 600 then climbing right turn to 2000 via heading 040° and BFM VORTAC R-031 to STETS INT and hold.

ATIS 135.575	MOBILE APP CON ★ 118.5 269.3	INTERNATIONAL TOWER★ 118.8(CTAF) 0 251.1	GND CON 121.7 239.3	UNICOM 122.95
-----------------	---------------------------------	---	------------------------	------------------

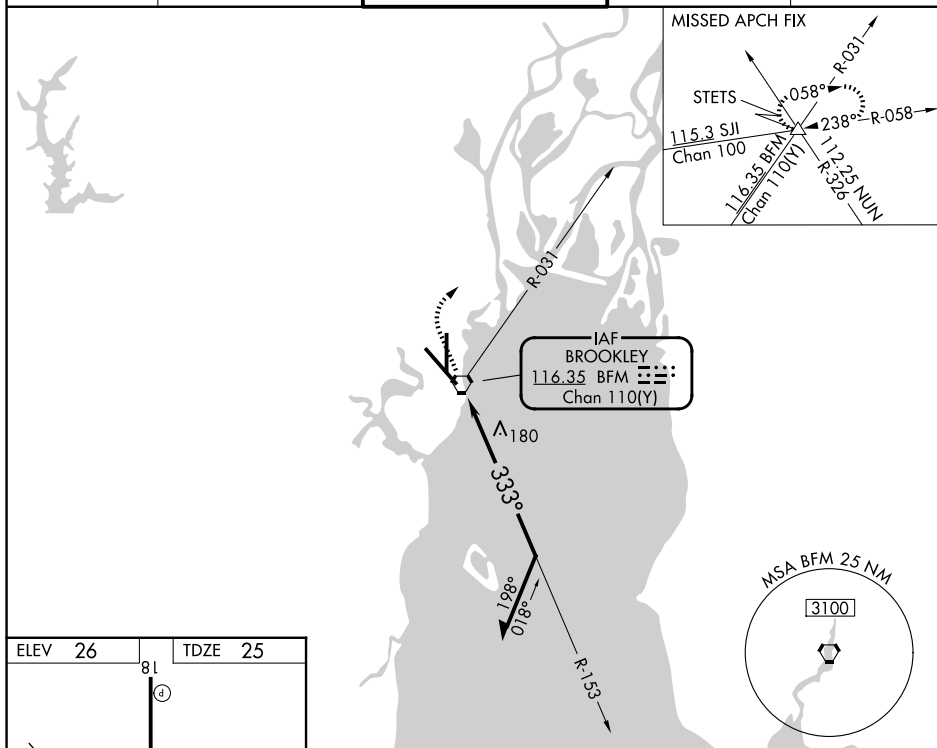

REIL Rwy 14
 MIRL Rwy 18-36
 HIRL Rwy 14-32
 TDZL/RCLS Rwy 32

600 ↑	2000 hdg 040°	BFM R-031 △				
CATEGORY	A	B	C	D		
S-32	540/24 515 (600-½)		540/55 515 (600-1)			
CIRCLING	680-1 654 (700-1)		680-1¾ 654 (700-1¾) 1100-3 1074 (1000-3)			