


LOC/DME I-MRZ 109.9 Chan 36	APP CRS 100°	Rwy Ldg TDZE 421 Apt Elev 421	9013
---	------------------------	---	-------------

ILS or LOC RWY 10
SYRACUSE HANCOCK INTL (SYR)

DME or RADAR required.	MALSR 	MISSED APPROACH: Climb to 900 then climbing left turn to 3000 on heading 081° and on SYR VORTAC R-111 to STODA INT/ SYR VORTAC 15.5 DME/RADAR and hold.
 TANUE fix minimums, for inoperative ALS, increase S-LOC 10 Cats C and D visibility to RVR 5500. **RVR 1800 authorized with use of FD or AP or HUD to DA.		

ATIS 124.225	SYRACUSE APP CON 126.125 269.125	SYRACUSE TOWER 120.3 239.0	GND CON 121.7 348.6
------------------------	--	--------------------------------------	-------------------------------

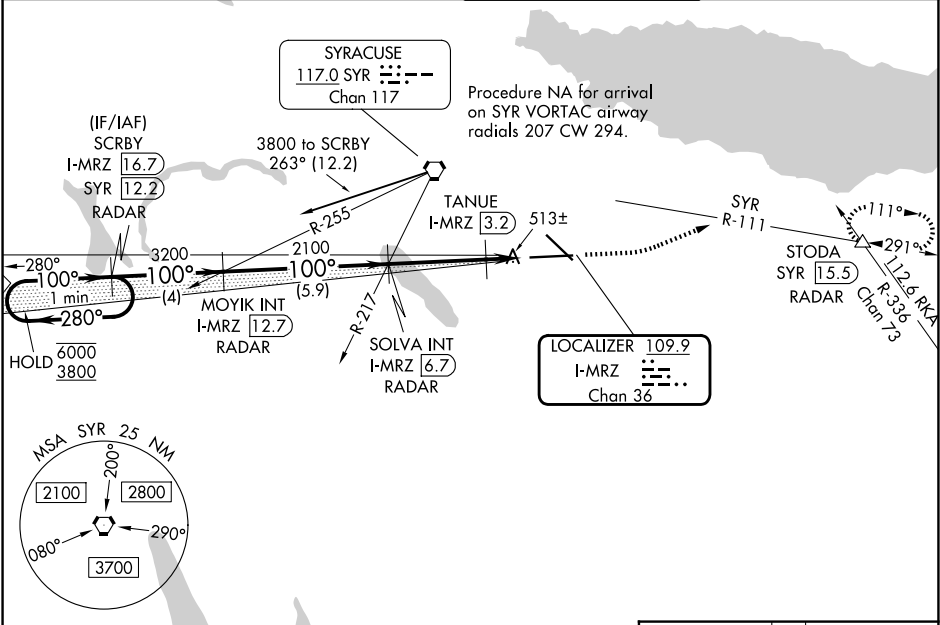

One Minute Holding Pattern	SCRBY I-MRZ 16.7 SYR 12.2 RADAR	MOYIK INT I-MRZ 12.7 RADAR	SOLVA INT I-MRZ 6.7 RADAR	TANUE I-MRZ 3.2 I-MRZ 2.6	STODA
6000 3800	3200	2100	2100	900 3000	ELEV 421 TDZE 421
GS 3.00° TCH 55	4 NM	5.9 NM	3.5 NM	0.6 1 NM	
CATEGORY	A	B	C	D	
S-ILS 10**	621/24	200 (200-1/2)			
S-LOC 10	980/24	559 (600-1/2)	980/60	559 (600-1 1/4)	
CIRCLING	980-1	559 (600-1)	1020-1 5/8 599 (600-1 1/2)	1180-2 1/2 759 (800-2 1/2)	
TANUE FIX MINIMUMS (DME REQUIRED)					
S-LOC 10	780/24	359 (400-1/2)	780/30	359 (400-3/4)	
CIRCLING	900-1 479 (500-1)	920-1 499 (500-1)	1020-1 1/2 599 (600-1 1/2)	1180-2 1/2 759 (800-2 1/2)	
TDZ/CL Rwy 28 HIRL Rwy 10-28 and 15-33					
FAF to MAP 5.1 NM					
Knots 60 90 120 150 180 Min:Sec 5:06 3:24 2:33 2:02 1:42					