

LOC/DME I-TGN 109.9 Chan 36	APP CRS 074°	Rwy Ldg 10600 TDZE 128 Apt Elev 151
---	------------------------	--

ILS or LOC RWY 7L

TED STEVENS ANCHORAGE INTL (ANC)(PANC)


DME required.

MALSI

MISSED APPROACH: Climb to 600 then climbing right turn to 3000 on heading 230° and TED VOR/DME R-210 to JUKEP/TED 15 DME and hold. (TACAN aircraft climb to 600 then climbing right turn to 3000 on heading 230° on EDF TACAN R-210 to JUKEP/EDF 22.6 DME and hold).

D-ATIS 135.5	ANCHORAGE APP CON 118.6 290.5	ANCHORAGE TOWER 118.3 257.8	GND CON 121.9 338.25	CLNC DEL 119.4 323.1
------------------------	---	---------------------------------------	--------------------------------	--------------------------------

ALTERNATE MISSED
APCH FIX 28

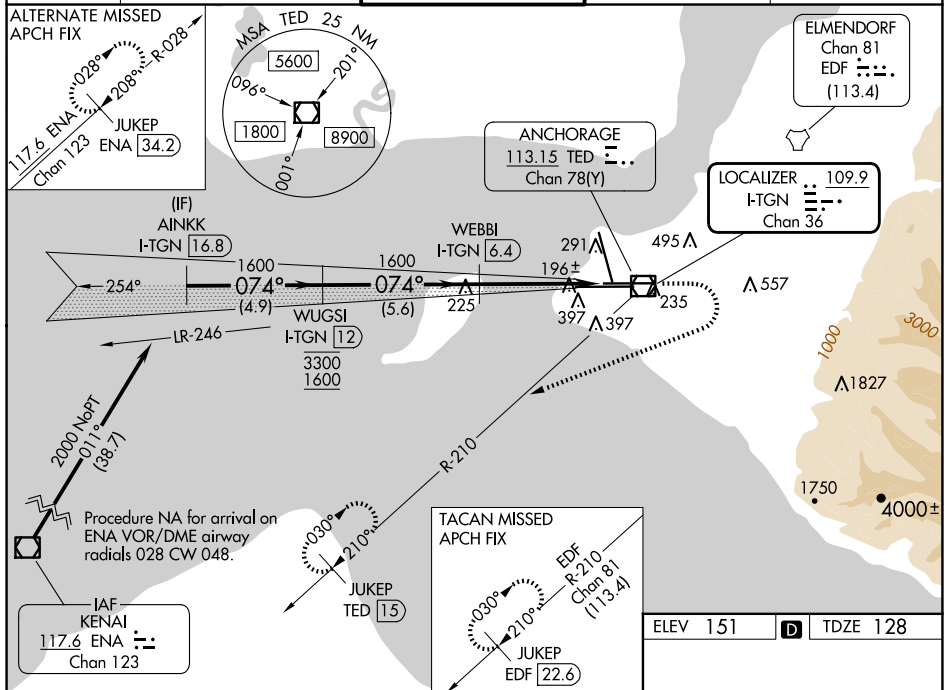

VGS and ILS glidepath not coincident.
(VGS Angle 3.00/TCH 63).

600 ↑	3000 hdg 230°	TED R-210	JUKEP TED 15
----------	---------------------	--------------	-----------------

AINKK I-TGN 16.8

WUGSI I-TGN 12

2000

0.74°

3300
1600

1600

WEBBI I-TGN 6.4

1600

2.9

1.9

GS 3.00°
TCH 54

4.9 NM

5.6 NM

3.5 NM

1 NM

CATEGORY	A	B	C	D	E
S-ILS 7L	328/18 200 (200-½)				
S-LOC 7L	500/24 372 (400-½)		500/30 372 (400-¾)		
 CIRCLING	700-1 549 (600-1)		800-1¾ 649 (700-1¾)	920-2½ 769 (800-2½)	920-2¾ 769 (800-2¾)

REIL Rwy 33
TDZ/CL Rwy 7L and 7R
HIRL all Rwy's

ILS or LOC RWY 7L