


LOC/DME I-EQY <b>109.75</b> Chan <b>34(Y)</b>	APP CRS <b>053°</b>	Rwy Ldg TDZE Apt Elev	<b>7001</b> <b>683</b> <b>683</b>
---	------------------------	-----------------------------	---

**ILS or LOC RWY 5**  
CHARLOTTE/MONROE EXEC (EQY)



DME required. RADAR required for procedure entry.		MALSR 	MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.
Rwy 5 helicopter visibility reduction below 3/4 SM NA. Inop table does not apply to S-ILS 5 all Cats. For inop ALS, increase S-LOC 5 all Cats visibility to 1 SM.			

ASOS <b>135.775</b>	CHARLOTTE APP CON <b>120.05 307.8</b>	CLNC DEL <b>132.55</b>	UNICOM <b>122.7 (CTAF)</b>
------------------------	--	---------------------------	-------------------------------

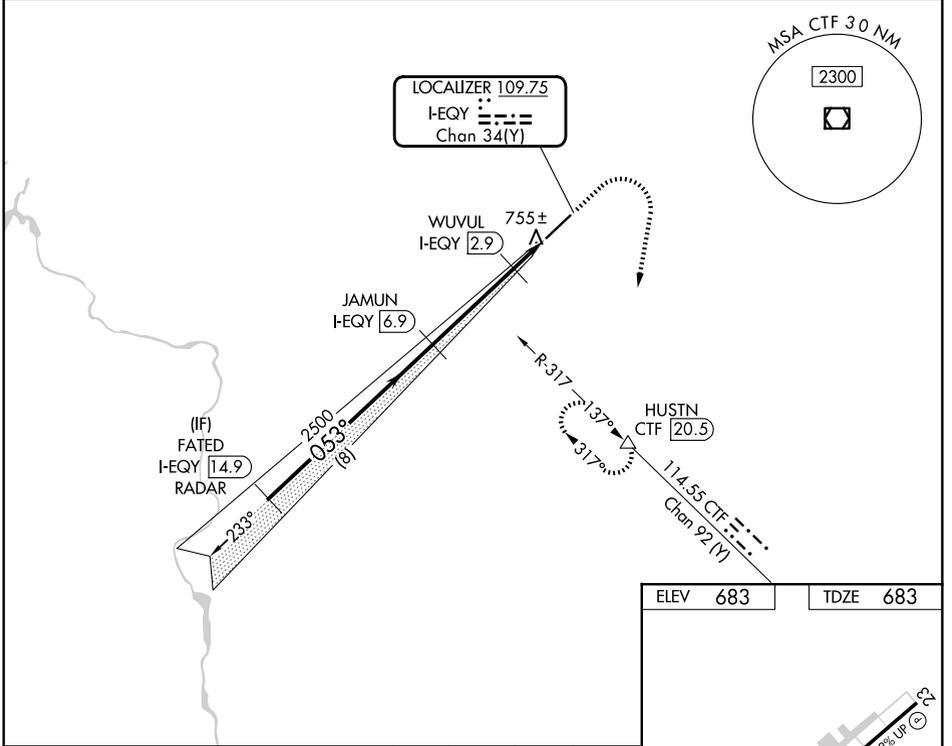

SE-2, 19 FEB 2026 to 19 MAR 2026

SE-2, 19 FEB 2026 to 19 MAR 2026

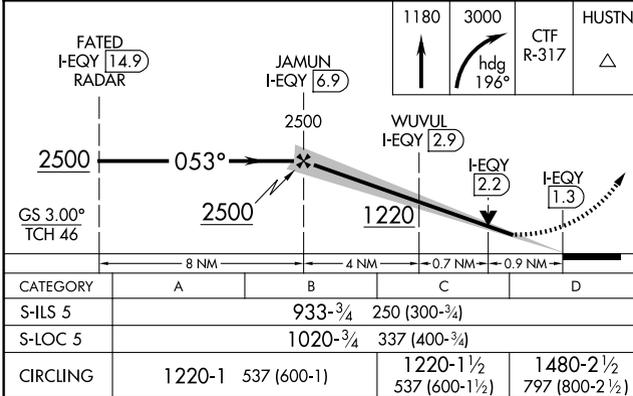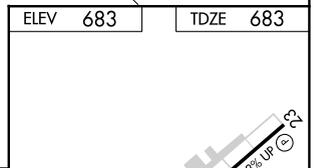

HIRL Rwy 5-23	REIL Rwy 23				
FAF to MAP 5.6 NM					
Knots	60	90	120	150	180
Min:Sec	5:35	3:44	2:48	2:14	1:52