

LOC/DME I-BXP 110.15 Chan 38 (Y)	APP CRS 173°	Rwy Ldg TDZE Apt Elev 12000 5339 5434
---	------------------------	---

ILS or LOC RWY 17L




DENVER INTL (DEN)

▼ For inoperative MALSR, increase S-LOC Cats C/D visibility to RVR 4500. S-LOC 17L DME or RADAR required. Simultaneous approaches authorized with Rwy 17R and 16L/16R.
#RVR 1800 authorized with the use of FD or AP or HUD to DA.


MALSR

MISSED APPROACH: Climb to 5900 then climbing left turn to 10000 on heading 120° and FQF VORTAC R-078 to LIMEX INT/FQF 31.9 DME and hold.


D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 132.35 239.275	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	---------------------------------------	---

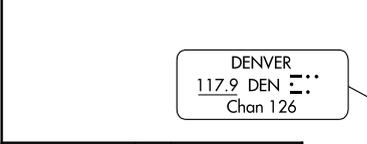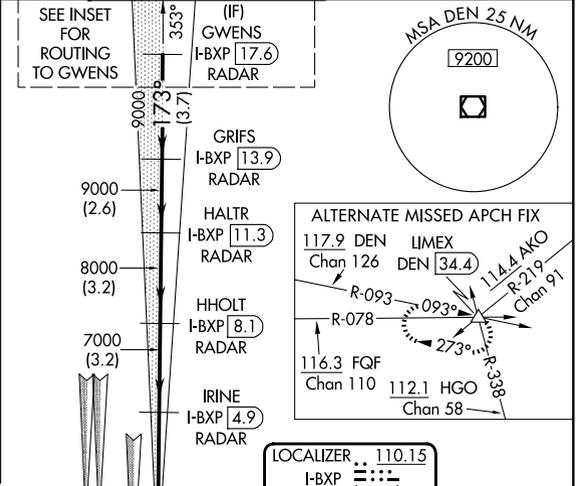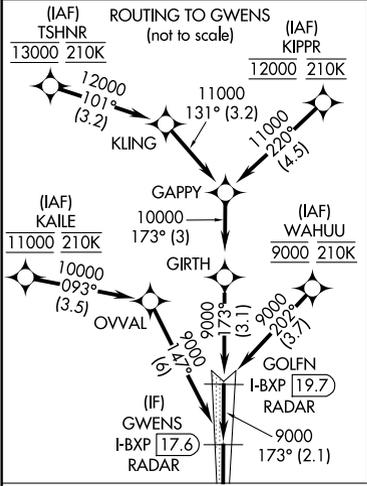

ELEV 5434	D	TDZE 5339
-----------	---	-----------

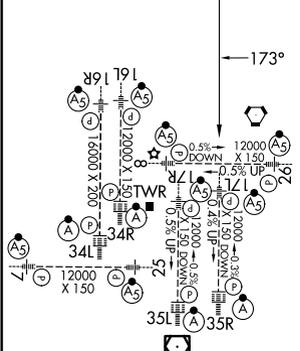

RADAR or GPS REQUIRED

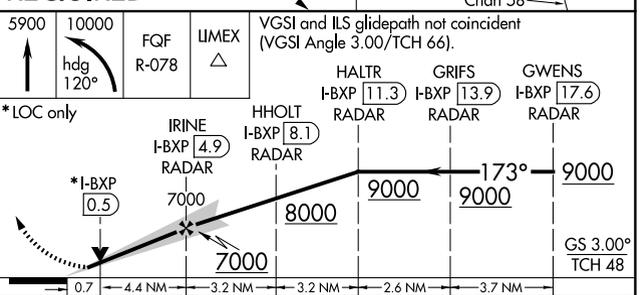

CATEGORY	A	B	C	D
S-ILS 17L	# 5539/24 200 (200-½)			
S-LOC 17L	5620/24 281 (200-½)			

SW-1, 19 FEB 2026 to 19 MAR 2026

SW-1, 19 FEB 2026 to 19 MAR 2026