




WAAS CH 40406 W19B	APP CRS 187°	Rwy Ldg 11002 TDZE 21 Apt Elev 26
--	------------------------	--

RNAV (GPS) RWY 19R

TAMPA INTL (TPA)

RNP APCH - GPS.		MALSRL	MISSED APPROACH: Climb to 800 then climbing right turn to 2000 direct JACKT and hold.
<p>▼ LNAV procedure NA during simultaneous operations. Simultaneous approach authorized. ▲ Use of FD or AP required during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 4°C or above 54°C. For inop ALS, increase LPV visibility Cat E to RVR 4000, LNAV/VNAV visibility all Cats to RVR 6000, and LNAV visibility Cat C/D/E to RVR 6000. * RVR 1800 authorized with use of FD or AP or HUD to DA.</p>			

D-ATIS 126.45	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4
-------------------------	---------------------------------------	-----------------------------------	-------------------------------

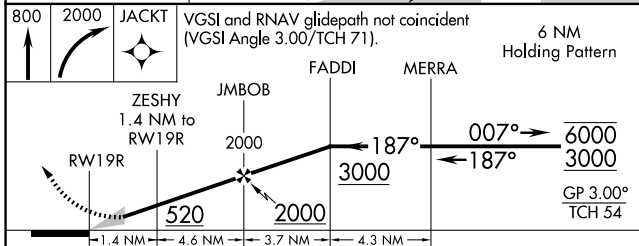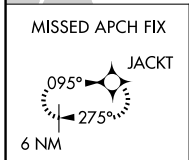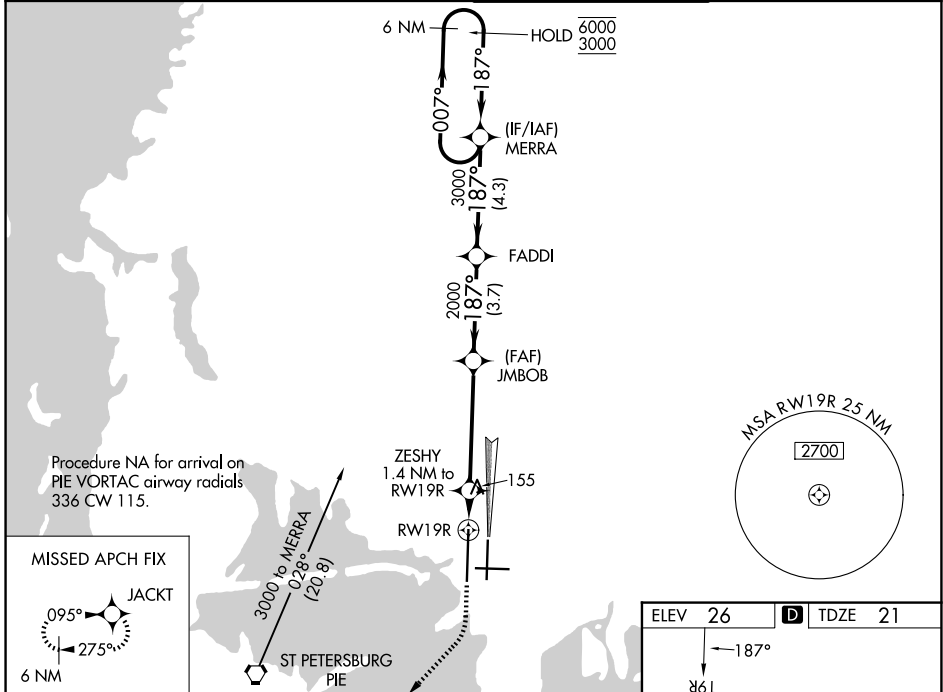

CATEGORY	A	B	C	D	E
LPV DA*	221/24		200 (200-½)		
LNAV/VNAV DA	440/40		419 (500-¾)		
LNAV MDA	440/24	419 (500-½)	440/40	419 (500-¾)	
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3	954 (1000-3)

