


LOC/DME I-DMP 111.7 Chan 54	APP CRS 234°	Rwy Ldg TDZE 10000 409 Apt Elev 435
---	------------------------	--

ILS RWY 23R (CAT II & III)


RALEIGH-DURHAM INTL (RDU)

RNAV 1-DME/DME/IRU or GPS or RADAR required for procedure entry.	ALSF-2 	MISSED APPROACH: Climb to 1000 then climbing right turn to 2200 on RDU VORTAC. R-356 to DUHAM INT/RDU 11 DME and hold.
Simultaneous approach authorized.		

D-ATIS 123.8	RALEIGH APP CON 127.675 307.9	RALEIGH TOWER 127.45 257.8	GND CON 121.9 348.6	CLNC DEL 120.1	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

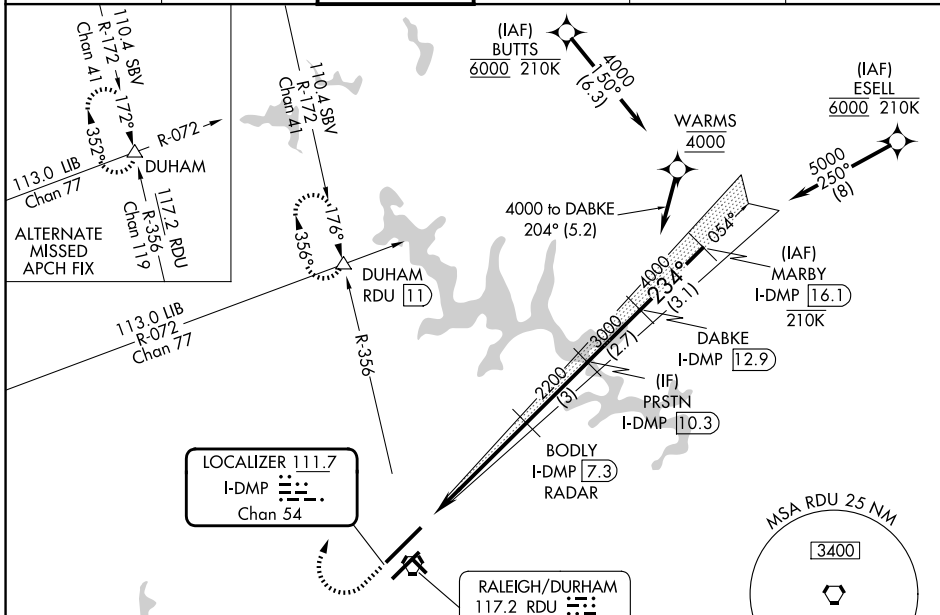

ELEV 435	D	TDZE 409
----------	----------	----------

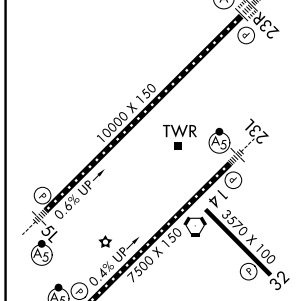

1000	2200	DUHAM	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 69).	MARBY I-DMP 16.1
RDU R-356				
BODYLY I-DMP 7.3	PRSTN I-DMP 10.3	DABKE I-DMP 12.9		
2200	3000	4000	5000	
1161'	5.5 NM	3 NM	2.7 NM	3.1 NM

CATEGORY	A	B	C	D
S-ILS 23R	CAT II RA 105/12 100 DA 509			
S-ILS 23R	CAT III RVR 06			

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

REIL Rwy 32
MIRL Rwy 14-32
HIRL Rwys 5R-23L and 5L-23R
TDZ/CL Rwys 23R, 23L and 5L

SE-2, 16 APR 2026 to 14 MAY 2026

SE-2, 16 APR 2026 to 14 MAY 2026