


LOC/DME I-LAL <b>110.1</b> Chan 38	APP CRS <b>096°</b>	Rwy Ldg TDZE <b>132</b> Apt Elev <b>142</b>	<b>8500</b>
--	------------------------	---	-------------



# ILS RWY 10 (CAT II & III)

LAKELAND LINDER INTL (LAL)

DME required.		ALSF-2	MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 on heading 292° and on LAL VORTAC R-330 to PLUMY INT/PIE 33.4 DME and hold.
ATIS <b>118.025</b>	TAMPA APP CON <b>120.65 290.3</b>	LAKELAND TOWER <b>124.5 236.775</b>	GND CON <b>121.4</b>

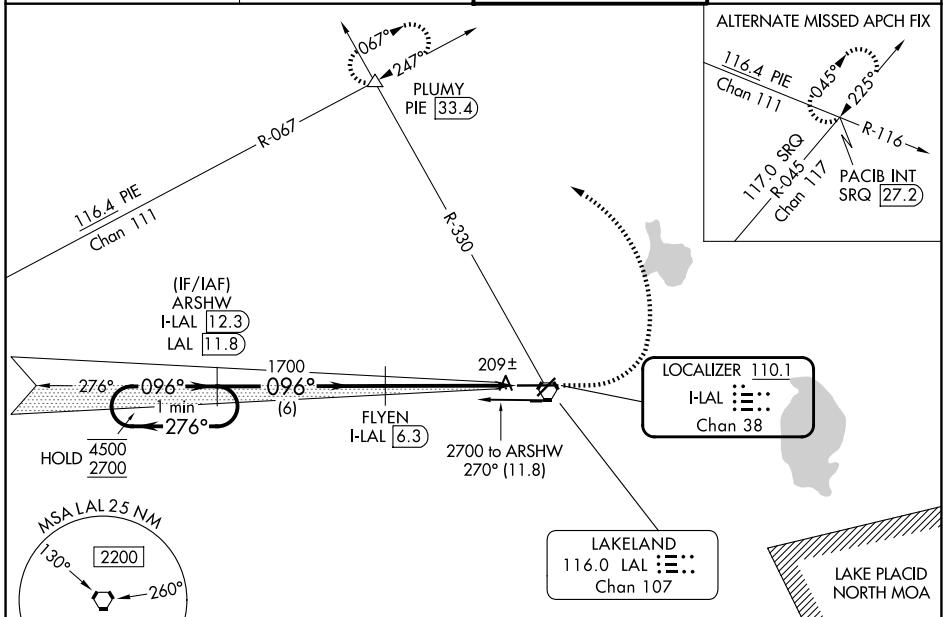

ELEV 142	TDZE 132
----------	----------

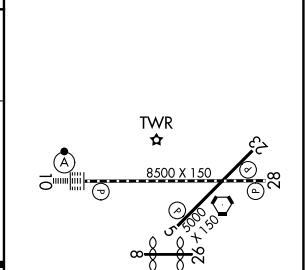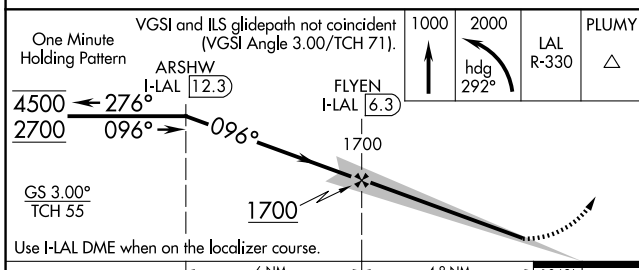

CATEGORY	A	B	C	D
S-ILS 10	CAT II	RA 101/12	100 DA 232	
S-ILS 10	CAT III	RVR 600		

## CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 10  
HIRL Rwys 5-23 and 10-28

SE-3, 16 APR 2026 to 14 MAY 2026

SE-3, 16 APR 2026 to 14 MAY 2026