

KING SALMON, ALASKA

HI-VOR Z or TACAN Z RWY 30

VORTAC AKN 112.8 Chan 75	APCH CRS 296°	Rwy Idg 8501 TDZE 73 Arpt Elev 73
--	-------------------------	--


[USAF]

KING SALMON (AKN) (PAKN)

DME required.


MISSED APPROACH: Climbing left turn to 3000 on heading 240° and on AKN VORTAC R-210 to OLLER/15 DME and hold.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	TOWER ★ 118.3 279.5	GND CON 121.9	CTAF 121.9 0 352.05	UNICOM 122.95
---------------	---------------------------------	------------------------	------------------	------------------------	------------------

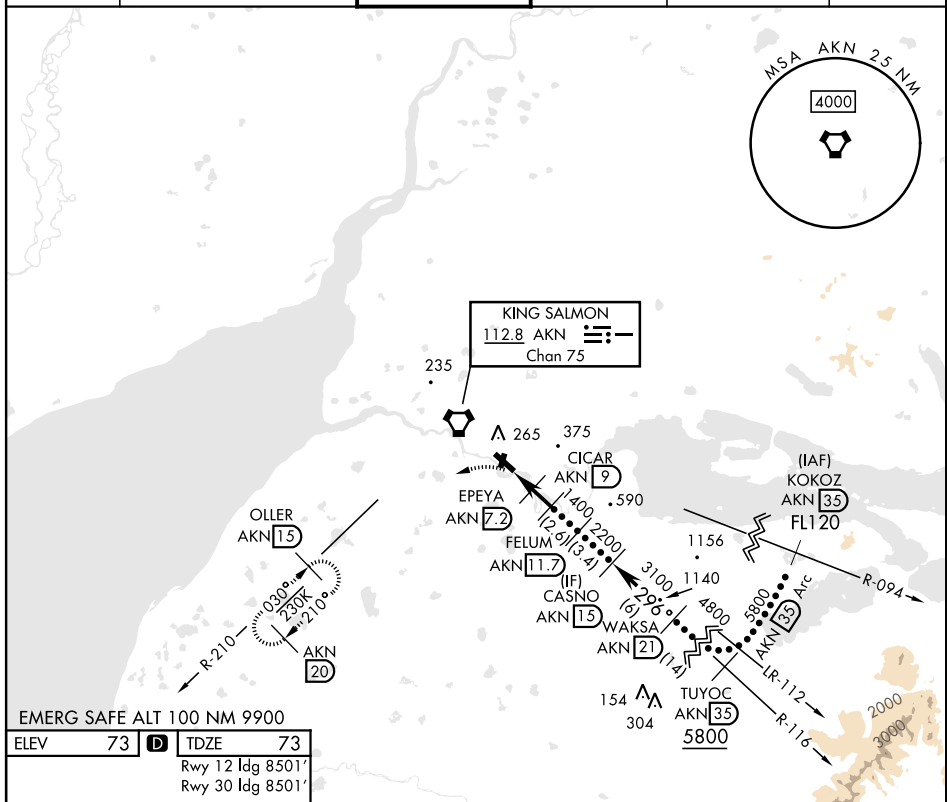

EMERG SAFE ALT 100 NM 9900

ELEV	73	D	TDZE	73
			Rwy 12 ldg 8501'	
			Rwy 30 ldg 8501'	

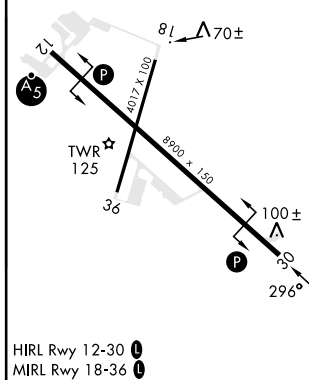

3000 hdg 240°		AKN R-210		OLLER AKN 15	
		AKN 5.1		AKN 6.3	
		EPEYA AKN 7.2		CICAR AKN 9	
		FELUM AKN 11.7		CASNO AKN 15	
		296°		3100	
		2200		1400	
		800		3.10°	
		TCH 45			
		2.1 NM		1.8 NM	
CATEGORY		C		D	
S-30		480-1½		407	
		(500-1½)			
CIRCLING		580-1½		900-2¾	
		507 (600-1½)		827 (900-2¾)	
		960-3		887 (900-3)	

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (AKN) (PAKN)

Amdt 6 03NOV22

HI-VOR Z or TACAN Z RWY 30

AK, 19 MAR 2026 to 14 MAY 2026

AK, 19 MAR 2026 to 14 MAY 2026