

YIGO, GUAM I, GUAM

TACAN Y RWY 06L

VORTAC UNZ 115.8 Chan T05	APCH CRS 053°	Rwy ldg TDZE Arpt Elev	10,527 539 617
---------------------------------	------------------	------------------------------	----------------------

(USAF)

ANDERSEN AFB (PGUA)



RADAR or DME required	SALS (A2)	MISSED APPROACH: Climb to 3000, intercept UNZ R-053 to HAAMR and hold.
-----------------------	--------------	--

* When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE vis to 1 1/2 miles.
** Circling not authorized NW of Rwy 06L-24R.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Anderson cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

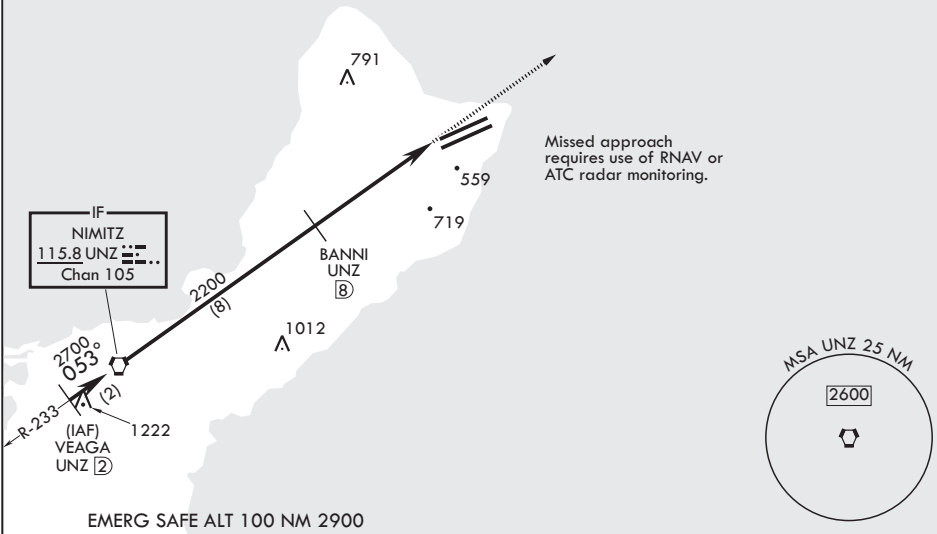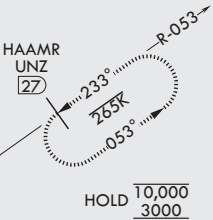

VEAGA 2	VORTAC	3000 UNZ R-053	HAAMR UNZ 27	ELEV 617	TDZE 539
2700	2700	2200	11.6	FAYZR 12.8	
2.99° TCH 59		4.8 NM	.2		
CATEGORY	A	B	C	D	E
S-6L*	1060/40 521 (500-¾)		1060-1¼ 521 (500-1¼)		
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)
HIRL all rwys					

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 06L