



LOC/DME I-AQI 111.75 Chan 54 (Y)	APP CRS 101°	Rwy Ldg 10114 TDZE 809 Apt Elev 815
---	------------------------	--

ILS or LOC RWY 10R



JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.
Simultaneous approach authorized.		

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

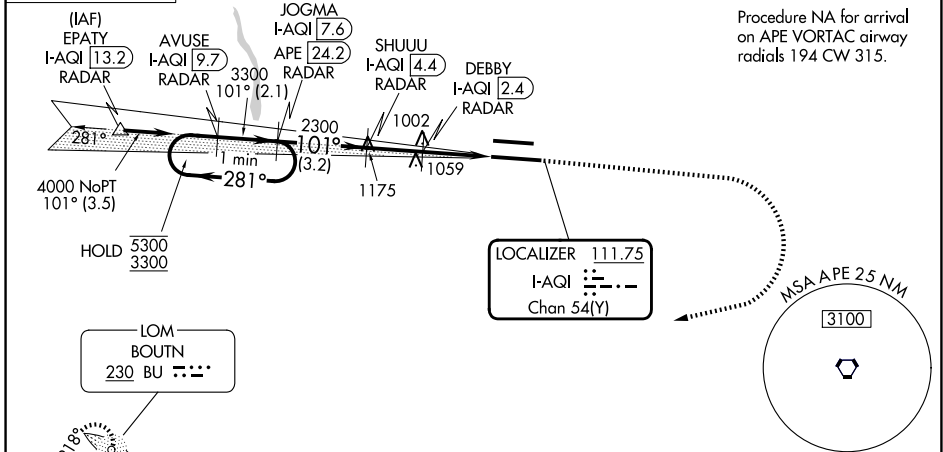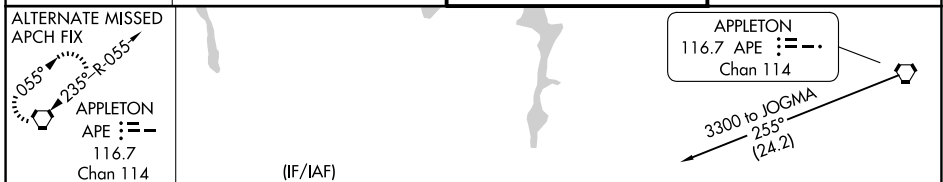

ELEV 815	D TDZE 809
----------	-------------------

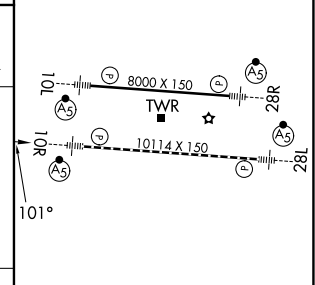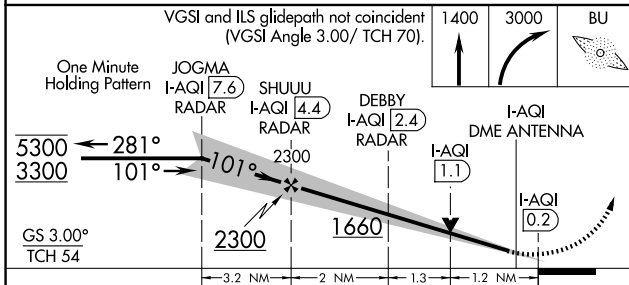

CATEGORY	A	B	C	D
S-ILS 10R	1009/18		200 (200-½)	
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2 ¼)

TDZL/RCLS Rwy 10R-28L					
HIRL Rwys 10R-28L and 10L-28R					
FAF to MAP 4.5 NM					
Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

EC-2, 14 MAY 2026 to 11 JUN 2026

EC-2, 14 MAY 2026 to 11 JUN 2026