


LOC I-VYK 108.3	APP CRS 292°	Rwy Ldg TDZE Apt Elev	8506 227 236
---------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 29


COLUMBIA METRO (CAE)

RADAR required for procedure entry.		MALSRL 	MISSED APPROACH: Climb to 1000 then climbing left turn to 2300 direct CAE VORTAC and hold, continue climb-in-hold to 2300. (TACAN aircraft continue on CAE VORTAC R-140 to ADCOM INT/10 DME and hold NW, right turn, 140° inbound).
For inop ALS, increase S-ILS 29 Cat E visibility to RVR 4000, and S-LOC 29 Cats C/D/E to 1 3/8 SM. *RVR 1800 authorized with use of FD or AP or HUD to DA.			


ATIS 120.15	COLUMBIA APP CON 124.15 338.2 (110°-289°) 133.4 285.6 (290°-109°)	COLUMBIA TOWER 119.5 257.8	GND CON 121.9 348.6
-----------------------	---	--------------------------------------	-------------------------------

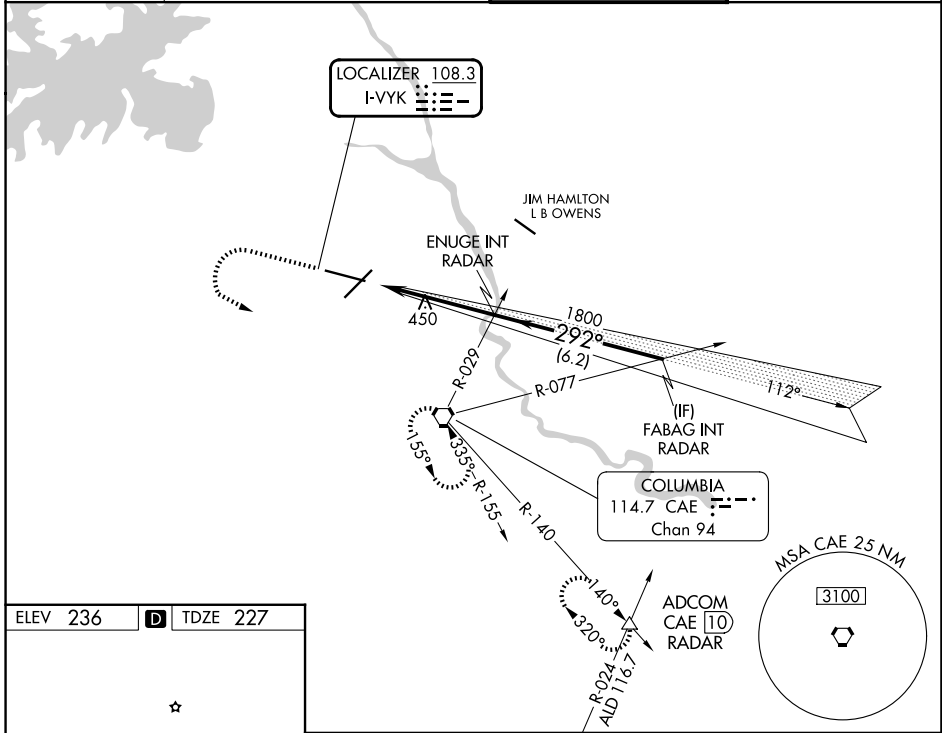

ELEV 236	D	TDZE 227
----------	----------	----------

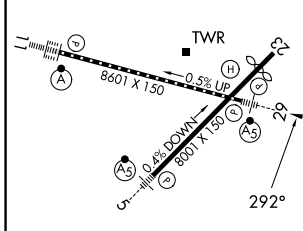

REIL Rwy 23	TDZ/CL Rwy 11	HIRL Rwys 5-23 and 11-29			
FAF to MAP 4.8 NM					
Knots	60	90	120	150	180
Min:Sec	4:48	3:12	2:24	1:55	1:36

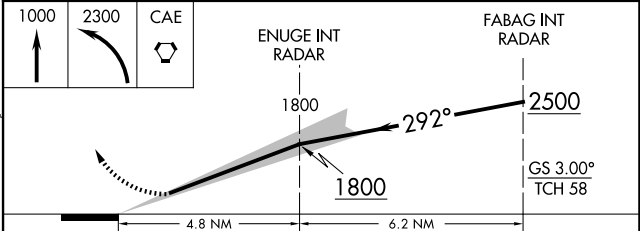

CATEGORY	A	B	C	D	E
S-ILS 29*	427/24 200 (200-1/2)				
S-LOC 29	700/24	473 (500-1/2)	700/50 473 (500-1)		
CIRCLING	740-1 504 (600-1)	860-1 624 (700-1)	1040-2 1/4 804 (900-2 1/4)	1040-2 1/2 804 (900-2 1/2)	1040-2 3/4 804 (900-2 3/4)