


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg TDZE 815 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required. Simultaneous approach authorized. For inop ALS, increase S-LOC 28L Cat C/D visibility to 1½ SM.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
--	-----------	--

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

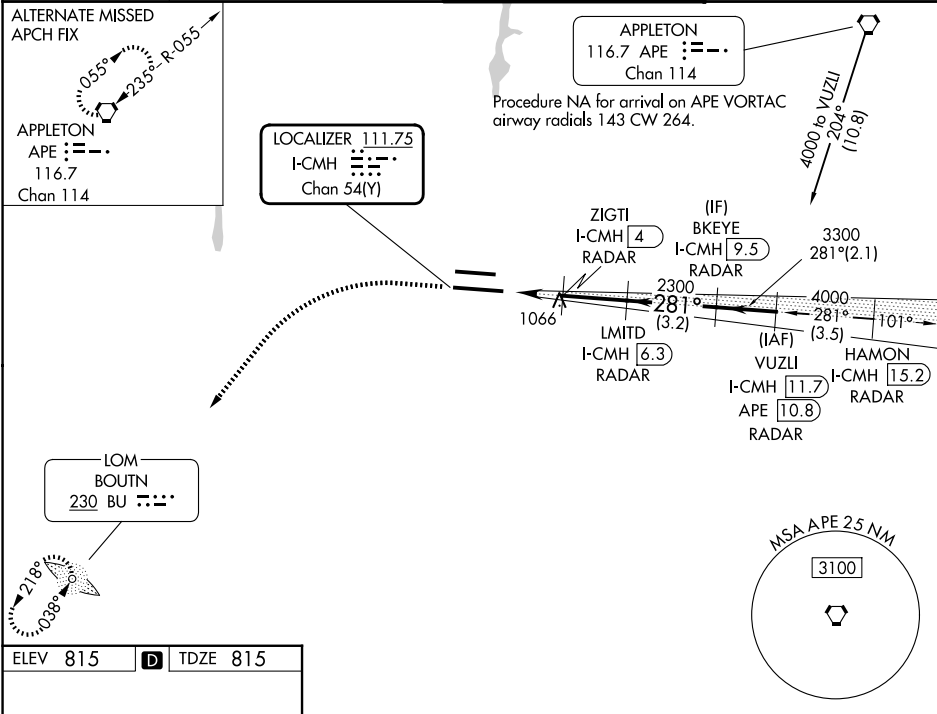

ELEV 815	D	TDZE 815
TDZL/RCLS Rwy 10R-28L HIRL Rwys 10R-28L and 10L-28R		
FAF to MAP 4.5 NM		
Knots	60	90 120 150 180
Min:Sec	4:30 3:00	2:15 1:48 1:30

1400 3000 BU				
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).				
1.3 NM 0.9 NM 2.3 NM 3.2 NM 2.1 NM				
CATEGORY	A	B	C	D
S-ILS 28L	1015/18 200 (200-½)			
S-LOC 28L	1300/24	485 (500-½)	1300/50	485 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2¼ 705 (800-2¼)

EC-2, 09 JUL 2026 to 06 AUG 2026

EC-2, 09 JUL 2026 to 06 AUG 2026