

LOC/DME I-PWM 109.9 Chan 36	APP CRS 110°	Rwy Ldg 7200 TDZE 76 Apt Elev 76
---	------------------------	---



ILS RWY 11 (CAT II & III)
PORTLAND INTL JETPORT (PWM)

Procedure NA when control tower closed.

ALSF-2

MISSED APPROACH: Climb to 600 then climbing right turn to 3000 direct ENE VOR/DME and hold.

ATIS 119.05	PORTLAND APP CON★ 119.75 269.35	PORTLAND TOWER★ 120.9 0 (CTAF) 257.8	GND CON 121.9	UNICOM 122.95
-----------------------	---	--	-------------------------	-------------------------

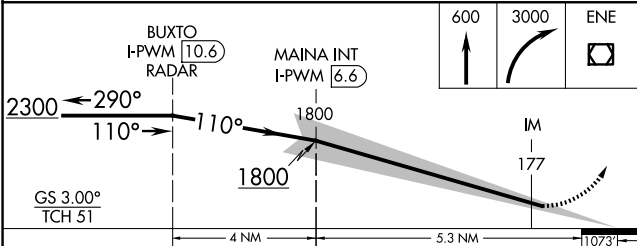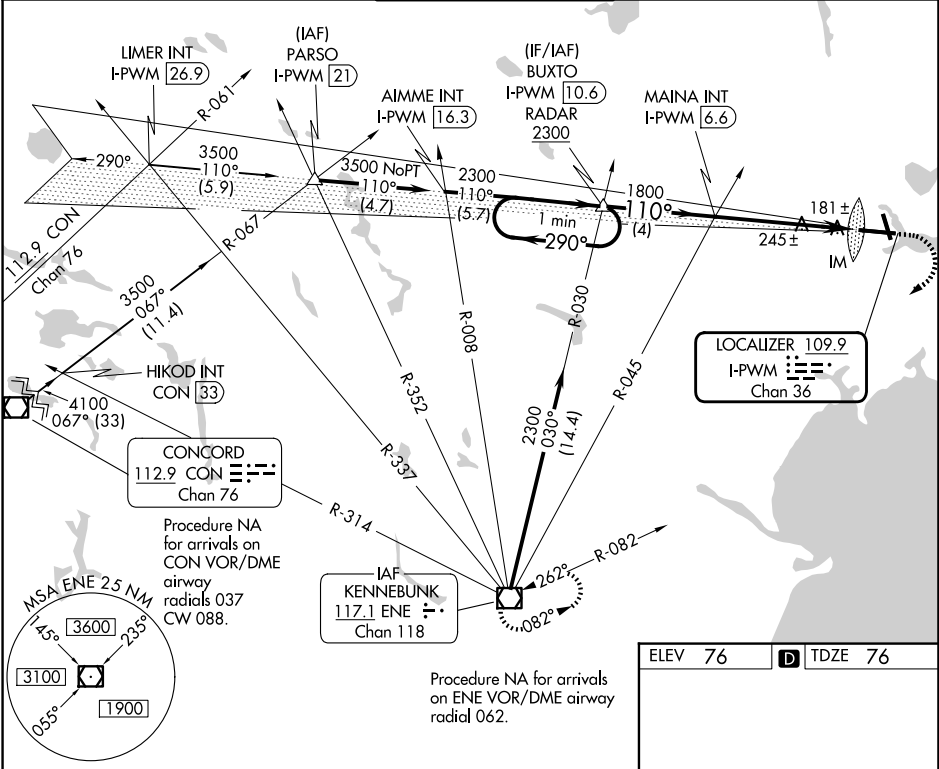

CATEGORY	A	B	C	D
S-ILS 11	CAT II RA 108/12 100 DA 176			
S-ILS 11	CAT III RVR 06			

CATEGORY II & III ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 76 D TDZE 76

TWR
0.5% UP
7200 X 150

TDZL/RCLS Rwy 11 0
MIRL Rwy 18-36 0
HIRL Rwy 11-29 0
REIL Rwy 18 and 36 0