

LOC I-HNZ
109.75

APP CRS
060°

Rwy Ldg
5501
TDZE
526
Apt Elev
526

LOC RWY 6
HENDERSON/OXFORD (HNZ)



ADF or RADAR required. ADF or RADAR required for procedure entry.

▼

Rwy 6 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Roxboro altimeter setting and increase all MDA 80 feet; increase S-6 Cat C/D visibility ½ SM and Circling Cat C and D visibility ¼ SM.

MISSED APPROACH: Climb to 1200 then climbing right turn to 2600 direct HXO NDB/RADAR and hold.

AWOS-3 118.625	RALEIGH APP CON 132.35 256.9	UNICOM 122.8(CTAF) 0
-------------------	---------------------------------	-------------------------

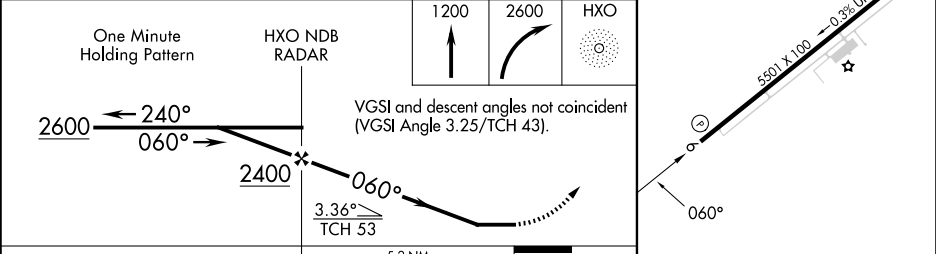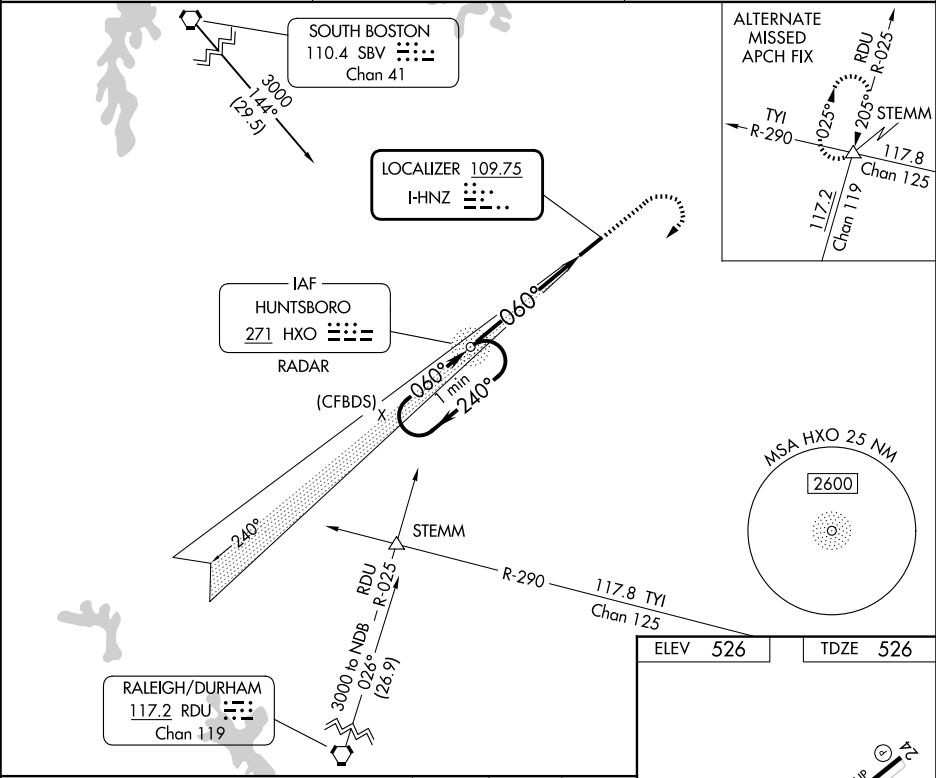

CATEGORY	A	B	C	D
S-6	980-1	454 (500-1)	980-1 $\frac{3}{8}$	454 (500-1 $\frac{3}{8}$)
CIRCLING	980-1	454 (500-1)	1100-1 $\frac{1}{2}$ 574 (600-1 $\frac{1}{2}$)	1280-2 $\frac{1}{2}$ 754 (800-2 $\frac{1}{2}$)

REIL Rwy 6 0					
MIRL Rwy 6-24 0					
FAF to MAP 5.2 NM					
Knots	60	90	120	150	180
Min:Sec	5:12	3:28	2:36	2:05	1:44