

ILS or LOC RWY 25
DENVER INTL (DEN)

MALSR

MISSED APPROACH: Climb to 10000 on heading 263° and on FQF VORTAC R-306 to HYGEN INT/FQF 37.9 DME and hold.

MISSED APCH FIX

HYGEN
FQF 37.9

114.2 GL
R-221
Chan 89

126°

306°

116.3 FQF
Chan 110

R-306

ALTERNATE MISSED APCH FIX

HYGEN
DEN 31.5


114.2 GL
R-221
Chan 89

122°


302°

117.9 DEN
Chan 126

R-302

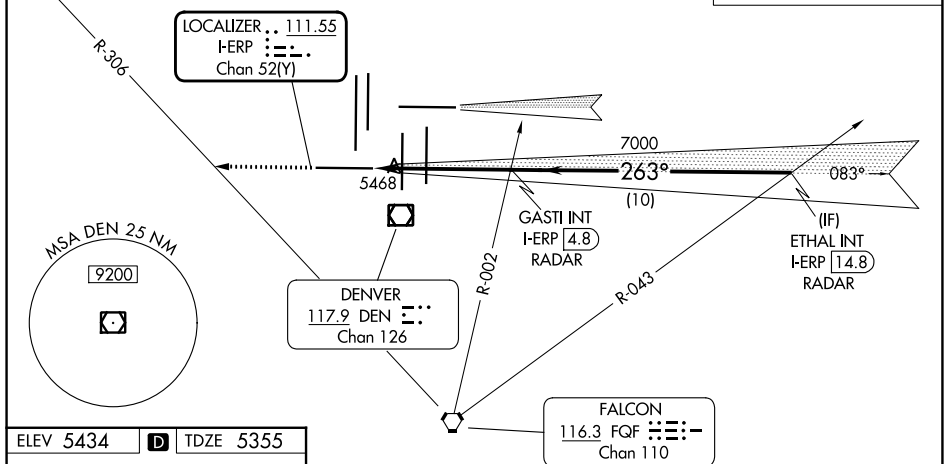

ELEV 5434	D	TDZE 5355
-----------	----------	-----------

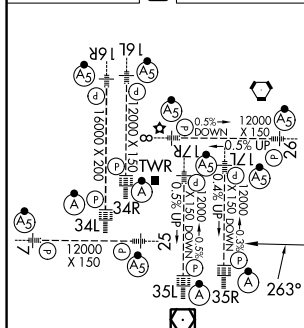


HIRL all Rwys
TDZL/RCLS Rwys 7, 16L, 16R, 17R, 26
34L, 34R, 35L, 35R

FAF to MAP 5 NM					
Knots	60	90	120	150	180
Min:Sec	5:00	3:20	2:30	2:00	1:40

Amdt 3A 11DEC14

39°52'N-104°40'W

RADAR REQUIRED

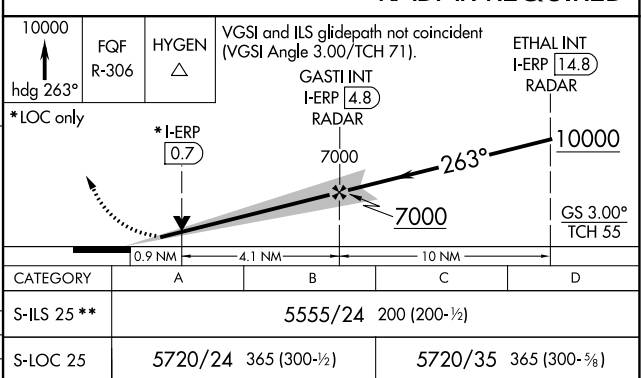

DENVER INTL (DEN)

ILS or LOC RWY 25

SW-1, 09 JUL 2026 to 06 AUG 2026