
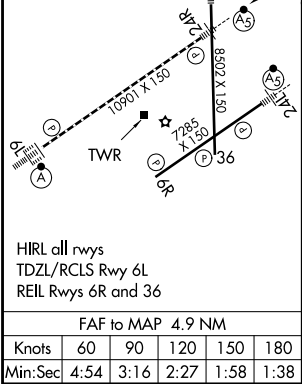



LOC/DME I-VUQ 111.9 Chan 56	APP CRS 241°	Rwy Ldg 10900 TDZE 997 Apt Elev 1009
---	------------------------	---

ILS or LOC RWY 24R
JAMES M COX DAYTON INTL (DAY)

ADF required for alternate missed approach.	MALSR 	MISSED APPROACH: Climb to 3000 then right turn direct DQN VOR/DME and hold.
Simultaneous approach authorized. For inop ALS, increase S-LOC 24R Cat A/B visibility to 1 SM; increase Cat C/D visibility to 1½ SM.		

ATIS 125.8	COLUMBUS APP CON 118.85 305.2 (091°-180°) 134.45 323.15 (181°-090°)	DAYTON TOWER 119.9 257.7	GND CON 121.9
----------------------	---	------------------------------------	-------------------------

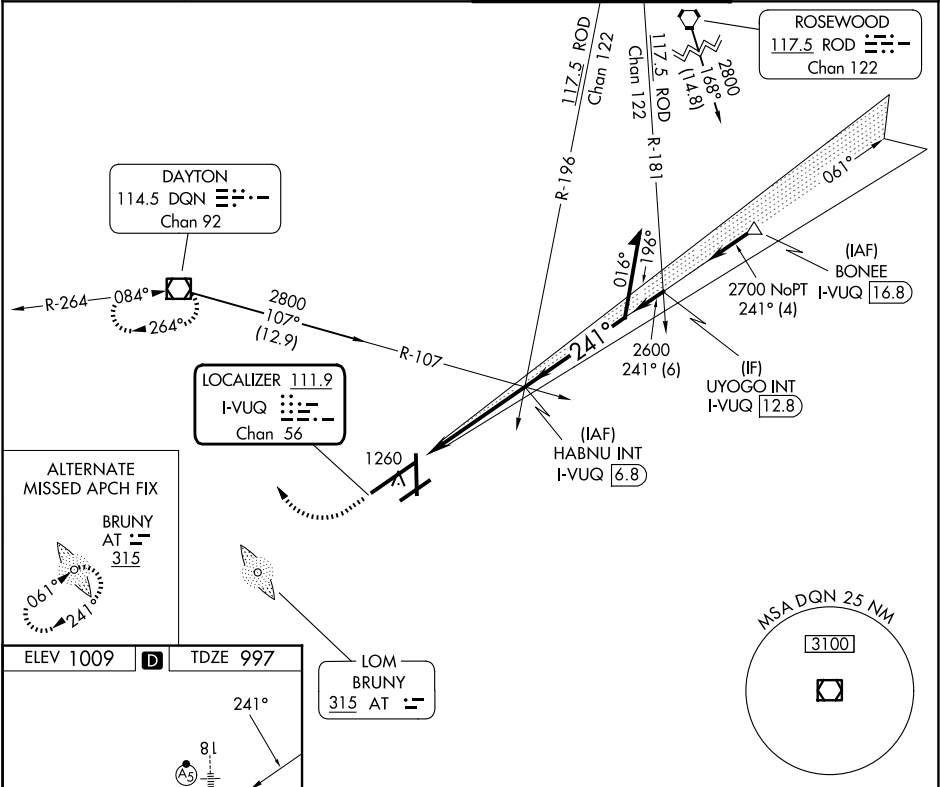

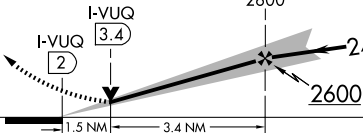3000 ↑		DQN 	HABNU INT I-VUQ <u>6.8</u>		Remain within 10 NM
		2600		061°	
		2600		241°	
		2800		GS 3.00° TCH 55	
CATEGORY	A	B	C	D	
S-ILS 24R	1203/24		206 (200-½)		
S-LOC 24R	1520/24	523 (600-½)	1520/55	523 (600-1)	
CIRCLING	1580-1	571 (600-1)	1580-1½ 571 (600-½)	1640-2 631 (700-2)	