

TAMPA, FLORIDA

AL-416 (FAA)

26078

LOC/DME I-TPA 110.3 Chan 40	APP CRS 187°	Rwy Ldg 8300 TDZE 26 Apt Elev 26
---	------------------------	---

ILS RWY 19L (SA CAT I)
TAMPA INTL (TPA)


RADAR required for procedure entry.

T Simultaneous approach authorized.
A Requires specific OPSPEC, MSPEC, or LOA approval.


ALSF-2

MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 160° and on PIE VORTAC R-138 to GIBBS INT and hold.

D-ATIS 126.45	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4
-------------------------	---------------------------------------	------------------------------------	-------------------------------

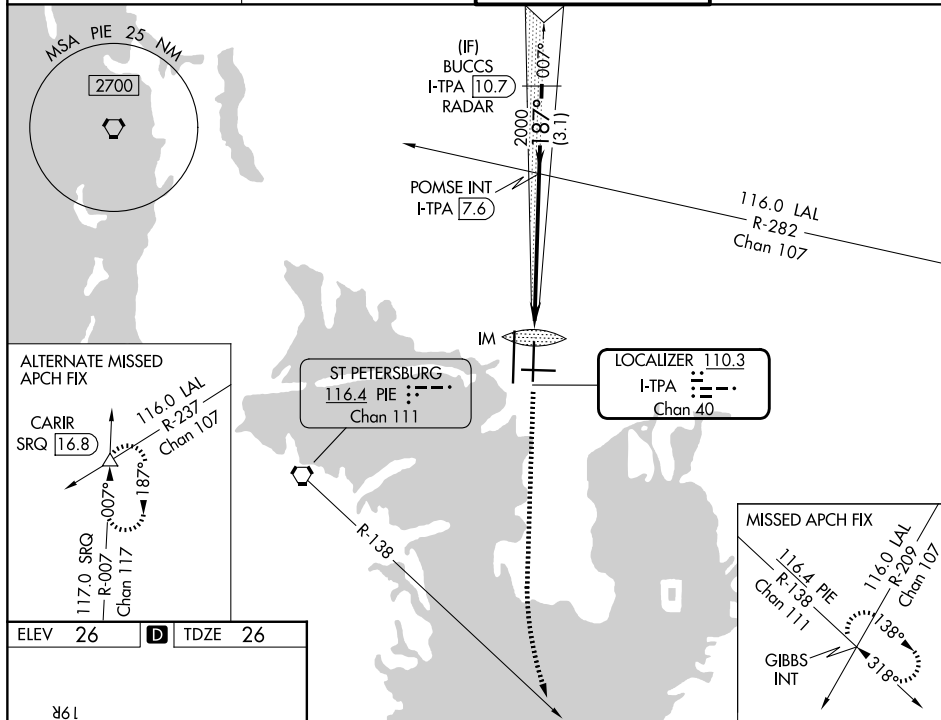

ELEV	26	D	TDZE	26
------	----	----------	------	----

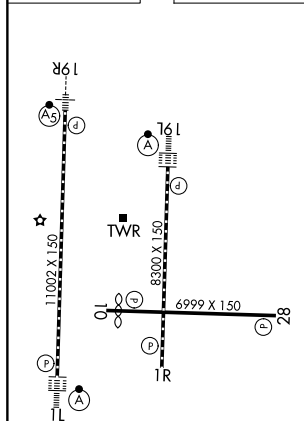

600
↑
4000
hdg 160°
PIE R-138
GIBBS INT

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 74).

POMSE INT
I-TPA 7.6
2000
187°
3000
BUCCS
I-TPA 10.7
RADAR
GS 3.00°
TCH 51

IM
1048'

6 NM
3.1 NM

CATEGORY	A	B	C	D
S-ILS 19L	RA 150/14 150 DA 176			