

TAMPA, FLORIDA

AL-416 (FAA)

26078

WAAS CH 50406 W01A	APP CRS 007°	Rwy Ldg 10800 TDZE 11 Apt Elev 26
--	------------------------	--

RNAV (GPS) Y RWY 1L
TAMPA INTL (TPA)

RNP APCH - GPS.


▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 4°C or above 54°C.
▲ For inop ALSF, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV all Cats visibility to RVR 6000, and LNAV Cat E visibility to 1¼ SM. Simultaneous approach authorized with Rwy 1R. LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations.

ALSF-2



MISSED APPROACH:
Climb to 2000 direct
MERRA and hold.

D-ATIS 126.45	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4
-------------------------	---------------------------------------	-----------------------------------	-------------------------------

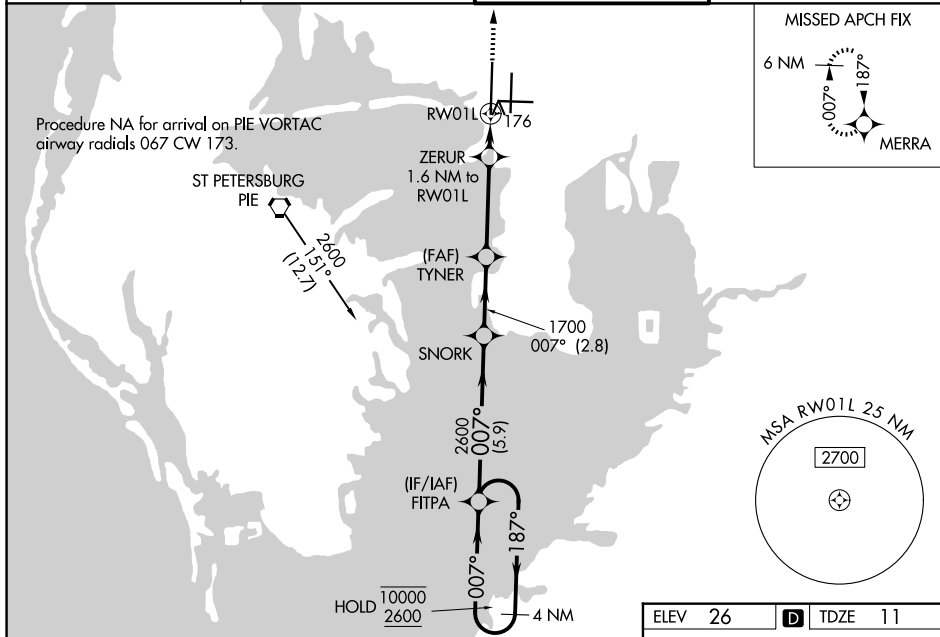

VGSI and VOR glidepath not coincident
(VGSI Angle 3.00°/TCH 71).

4 NM Holding Pattern

10000 ← 187°

2600 → 007°

007°

2600

GP 3.00° TCH 54

FITPA

SNORK

TYNER

1700

1700

560

ZERUR 1.6 NM to RW01L

RW01L

5.9 NM

2.8 NM


3.6 NM

1.6 NM

2000

MERRA

CATEGORY	A	B	C	D	E
LPV DA		211/18	200 (200-½)		
LNAV/VNAV DA		431/40	420 (500-¾)		
LNAV MDA	440/24	429 (500-½)	440/40	429 (500-¾)	
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3	954 (1000-3)

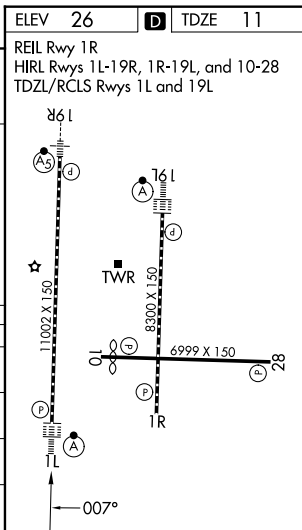

TAMPA, FLORIDA
Amdt 3 17APR25

27°59'N-82°32'W

TAMPA INTL (TPA)

RNAV (GPS) Y RWY 1L

SE-3, 06 AUG 2026 to 03 SEP 2026