
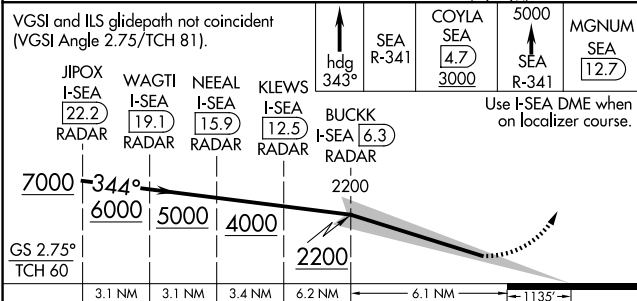
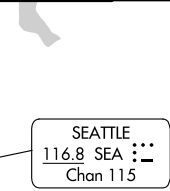
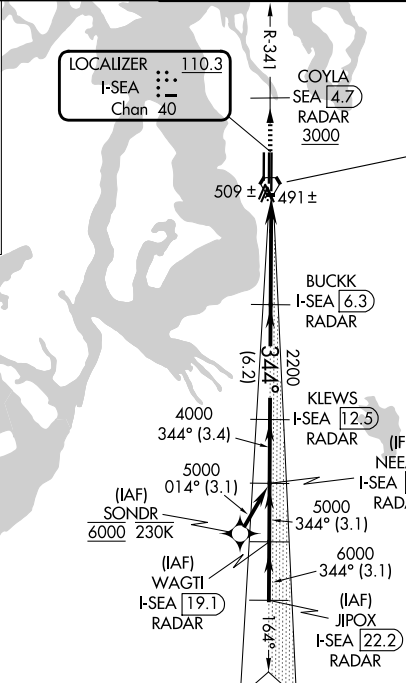
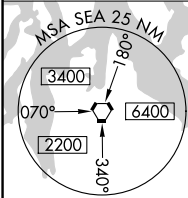
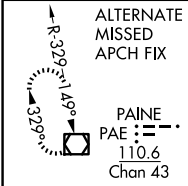


LOC/DME I-SEA 110.3 Chan 40	APP CRS 344°	Rwy Ldg TDZE Apt Elev 432	11901 372 432
---	------------------------	--	--


ILS RWY 34R (SA CAT I & II)
SEATTLE-TACOMA INTL (SEA)

From SONDR: RNAV 1-GPS required. DME or RADAR required.	MALSR 	MISSED APPROACH: Climb on heading 343° and outbound on SEA VORTAC R-341 to cross COYLA/SEA 4.7 DME/RADAR at or above 3000 then climb to 5000 on SEA VORTAC R-341 to MGNUM/SEA 12.7 DME/RADAR and hold, continue climb-in-hold to 5000.
 Simultaneous approach authorized with Rwy 34L. SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting: Requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.		

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (16L, 16C, 34C, 34R) 120.95 239.3 (16R, 34L)	GND CON 121.7
------------------------	---	--	-------------------------

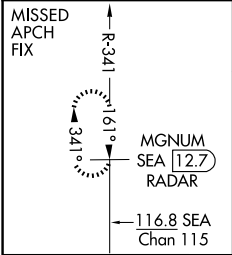

ELEV 432	D	TDZE 372
----------	----------	----------

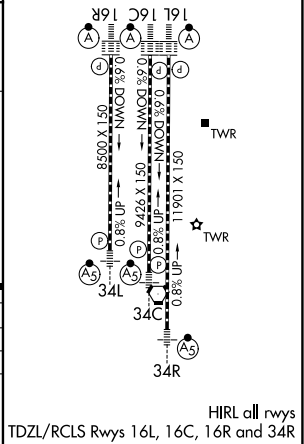

CATEGORY	A	B	C	D
S-ILS 34R		SA CAT I RA 250/14 150 DA 522		
S-ILS 34R		SA CAT II RA 200/12 100 DA 472		
SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED				