

LOC/DME I-LAL 110.1 Chan 38	APP CRS 096°	Rwy Ldg 8500 TDZE 132 Apt Elev 142
---	------------------------	---

ILS RWY 10 (CAT II & III)
LAKELAND LINDER INTL (LAL)

DME required.




ALSF-2





MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 on heading 292° and on LAL VORTAC R-330 to PLUMY INT/PIE 33.4 DME and hold.

ATIS 118.025	TAMPA APP CON 120.65 290.3	LAKELAND TOWER 124.5 236.775	GND CON 121.4
-----------------	-------------------------------	---------------------------------	------------------

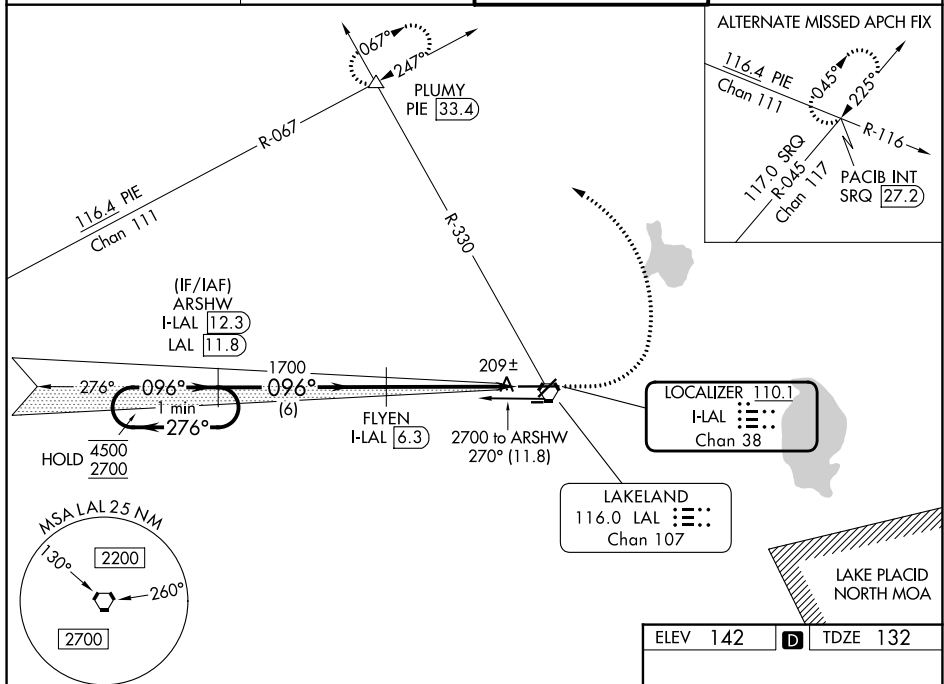

ELEV 142	D	TDZE 132
----------	----------	----------

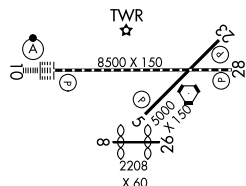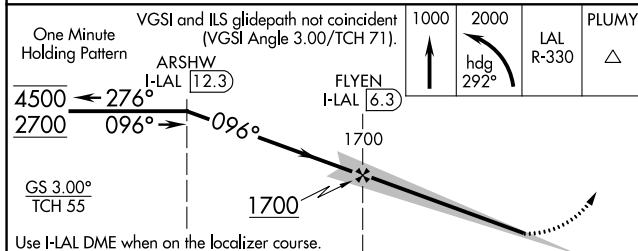

	6 NM		4.8 NM		1063'
CATEGORY	A	B	C	D	
S-ILS 10	CAT II RA 101/12 100 DA 232				
S-ILS 10	CAT III RVR 600				

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

TDZL/RCLS Rwy 10
HIRL Rwy 5-23 and 10-28