

YIGO, GUAM I, GUAM

TACAN Z RWY 24R


TACAN UAM Chan 54	APCH CRS 231°	Rwy Idg TDZE Arprt Elev	10,527 617 617
----------------------	------------------	-------------------------------	----------------------

(USAF)

ANDERSEN AFB (PGUA)

RADAR or DME required	ALSF-1	MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile. ** Circling not authorized NW of Rwy 06L-24R.		

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

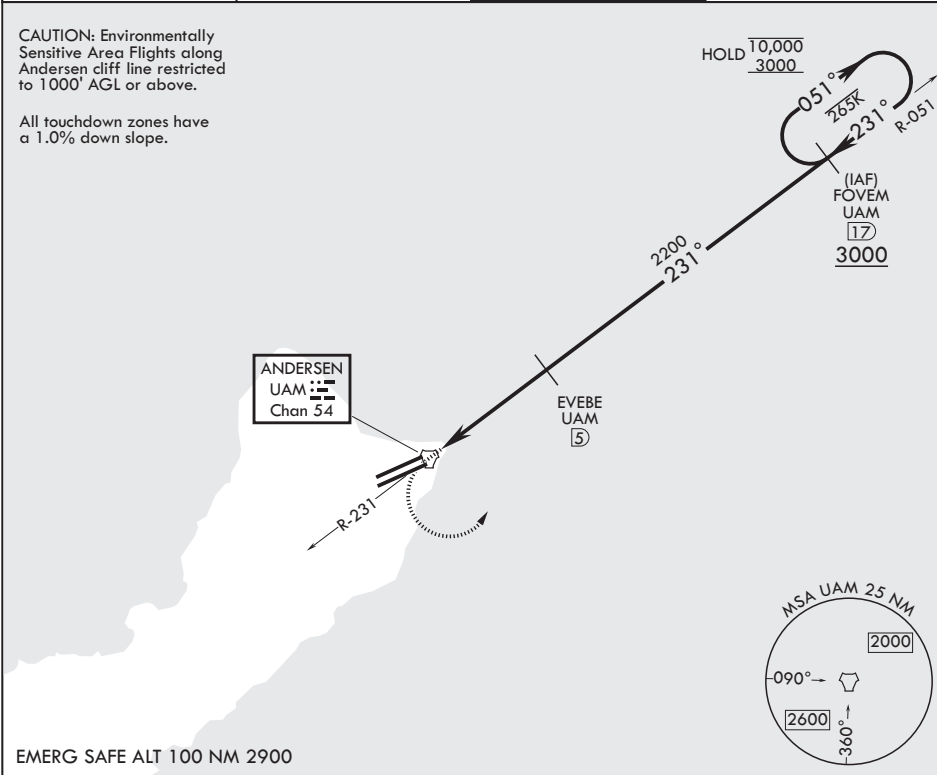

1100 UAM R-051	FOVEM UAM (17)	VGSI and ILS glidepath not coincident (VGSI angle 3.00/TCH 59).	FOVEM (17)	ELEV 617	TDZE 617
CATEGORY	A	B	C	D	E
S-24R*	940/24	323 (400-½)	940/40	323	(400-¾)
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)
HIRL all rwys					

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Z RWY 24R