


WAAS CH 40142 W29A	APP CRS 295°	Rwy Ldg TDZE Apt Elev	7500 92 92
--	------------------------	-----------------------------	---------------------------------------

RNAV (GPS) RWY 29

KETCHIKAN INTL (KTN)(PAKT)

RNP APCH.	MALSR	MISSED APPROACH: Climb to 5000 direct CLOYD and on track 296° to DOOZI and hold. *Missed approach requires minimum climb of 425 feet per NM to 2160; If unable to meet climb gradient, see RNAV (GPS)-B.
NA For inop ALS, increase all Cats visibility to 1¾ SM.		

AFIS 134.45	ANCHORAGE CENTER 118.5 284.6	KETCHIKAN RADIO 123.6 (CTAF) 0
-----------------------	--	--

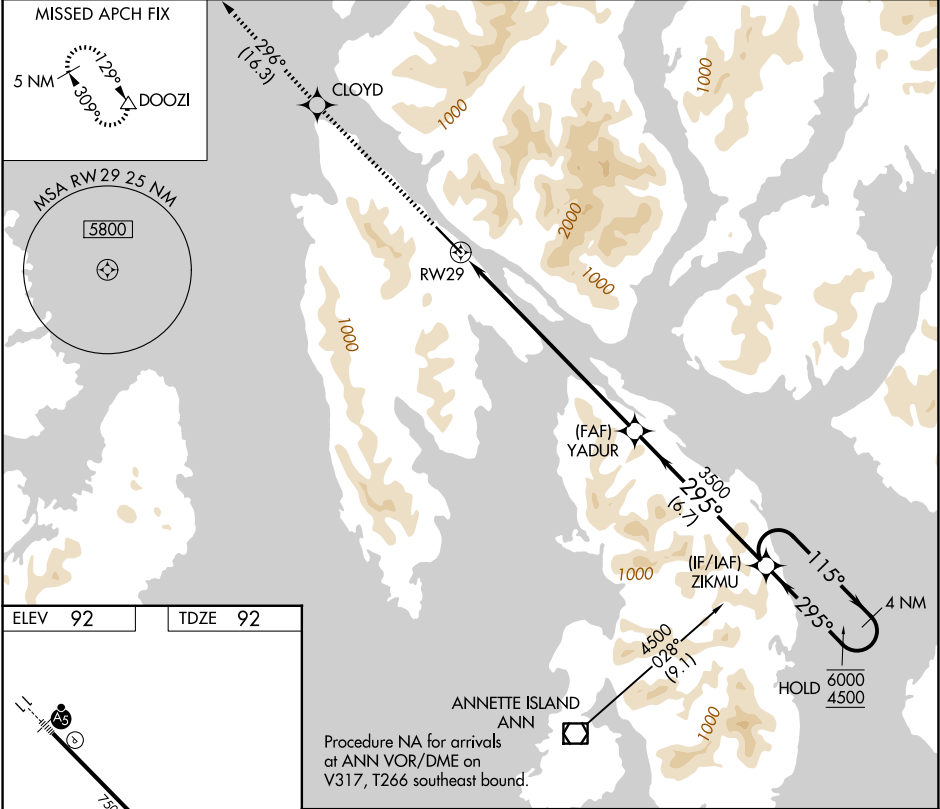

ELEV 92	TDZE 92	5000	CLOYD	tr 296°	DOOZI	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 49).	4 NM Holding Pattern
		YADUR 3500 295° 3500					115° 6000 295° 4500
WATER RWY: WNW-ESE 9500 X 1500		8.9 NM					6.7 NM
HIRL Rwy 11-29 0		CATEGORY		A	B	C	D
LPV DA*		722-1⅓		630 (700-1⅓)		NA	