

TAMPA, FLORIDA

AL-9241 (FAA)

25219

LOC/DME I-VDF 111.35 Chgn 50 (Y)	APP CRS 226°	Rwy Ldg 4200 TDZE 21 Apt Elev 21
--	------------------------	---

ILS or LOC RWY 23
TAMPA EXEC (VDF)

V When local altimeter setting not received, use Tampa Intl altimeter setting and increase S-ILS 23 DA to 323; increase all MDA 40 feet and S-LOC and Circling Cat C visibilities $\frac{1}{4}$ SM. For inop MALSR when using Tampa Intl altimeter setting, increase S-LOC 23 Cat C visibility to 1 $\frac{1}{2}$. Inop table does not apply to S-ILS 23 and S-LOC 23 Cats A/B. Rwy 23 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Circling Rwy 18. 36 NA at night.


MALSR



MISSED APPROACH: Climb to 800 then climbing left turn to 2000 direct LAL VORTAC and hold.

AWOS-3
121.125

TAMPA APP CON
119.9 290.3

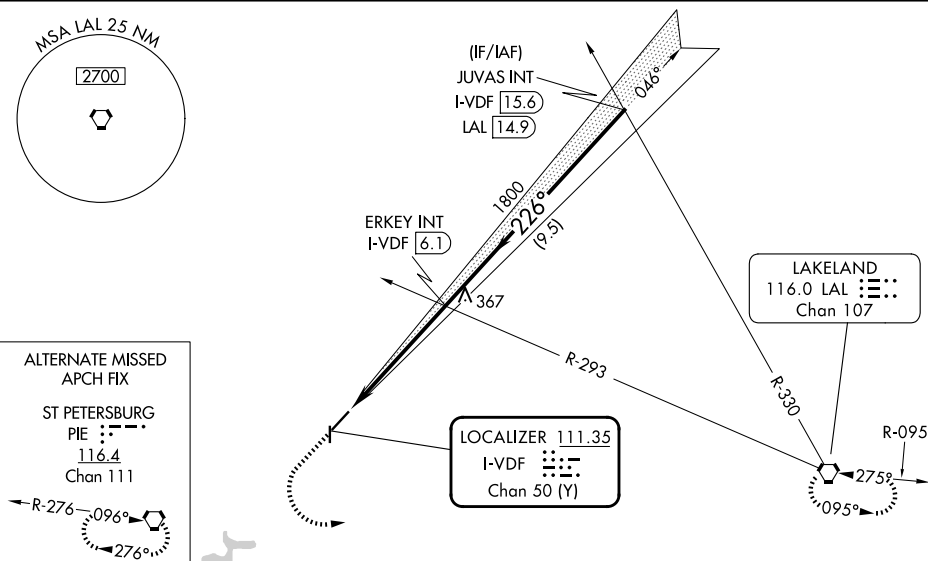UNICOM
122.7 (CTAF) **L**

ALTERNATE MISSED
APCH FIX


ST PETERSBURG

PIE :: — ·

116.4

Chan 111


ELEV	21		TDZE	21
------	----	--	------	----

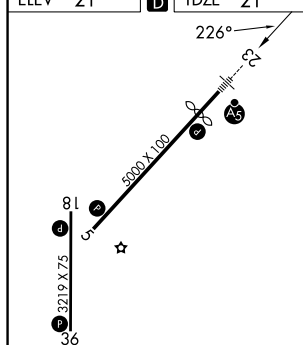

REIL Rlys 5, 18, and 36
MIRL Rlys 5-23 and 18-36 

FAF to MAP 5.3 NM

Knots	60	90	120	150	180
Min:Sec	5:18	3:32	2:39	2:07	1:46

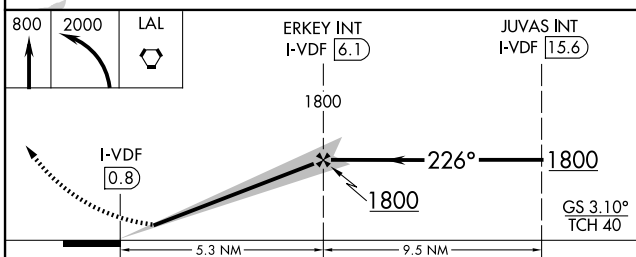

CATEGORY	A	B	C	D
S-ILS 23	298-1	277 (300-1)		NA
S-LOC 23	560-1	539 (600-1)		NA
CIRCLING	560-1 539 (600-1)	760-1 739 (800-1)	800-2¼ 779 (800-2¼)	NA

TAMPA, FLORIDA
Amdt 1E 07OCT21

28°01'N-82°21'W

TAMPA EXEC (VDF)

ILS or LOC RWY 23

SE-3, 06 AUG 2026 to 03 SEP 2026