


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg TDZE 815 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 28L

JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required. Simultaneous approach authorized. For inop ALS, increase S-LOC 28L Cat C/D visibility to 1½ SM.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
--	-----------	--

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

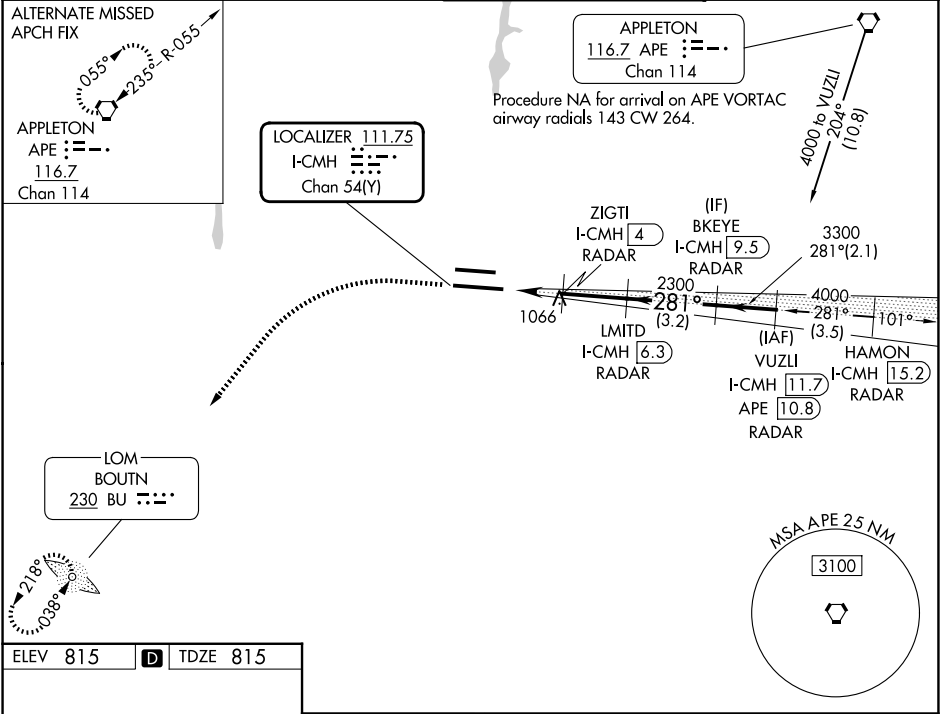

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

		1400 3000 BU VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).	
TDZL/RCLS Rwy 10R-28L HIRL Rwys 10R-28L and 10L-28R			
FAF to MAP 4.5 NM		CATEGORY A B C D	
S-ILS 28L		1015/18 200 (200-½)	
S-LOC 28L		1300/24 485 (500-½)	1300/50 485 (500-1)
CIRCLING		1340-1 525 (600-1)	1520-2 705 (800-2) 1520-2¼ 705 (800-2¼)

EC-2, 03 SEP 2026 to 01 OCT 2026

EC-2, 03 SEP 2026 to 01 OCT 2026