

VORTAC RIC 114.1 Chan 88	APP CRS 323°	Rwy Ldg 9003 TDZE 161 Apt Elev 167
--	------------------------	---

VOR RWY 34
RICHMOND INTL (RIC)


DME or RADAR required. RADAR required for procedure entry.

T For inop ALS, increase S-34 Cat C/D visibility to RVR 5500.


ALSF-2

MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

ATIS		POTOMAC APP CON	RICHMOND TOWER	GND CON
119.15	263.025	126.4 282.375 (001°-185°)	121.1 257.8	121.9 348.6
		126.75 307.2 (186°-360°)		

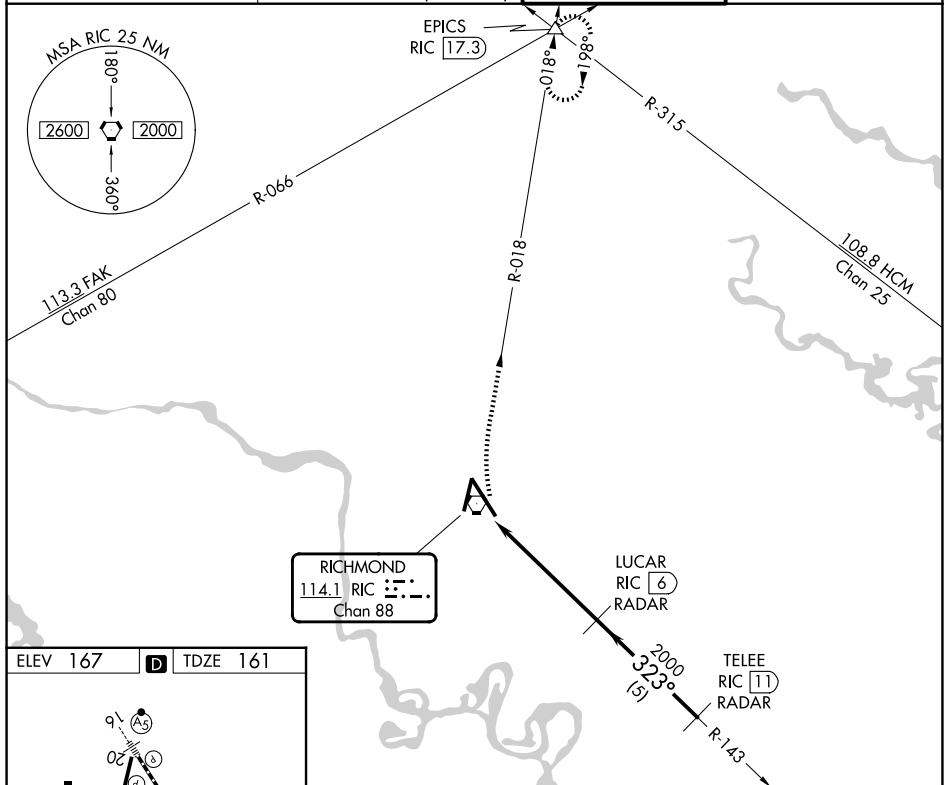

TDZ/CL Rwy 34
HIRL Rwys 2-20 and 16-34
REIL Rwy 20

2000  RIC R-018	EPICS  △	VGS1 and descent angles not coincident (VGS1 Angle 3/00/TCH 79).				LUCAR RIC <u>6</u> RADAR	TELEE RIC <u>11</u> RADAR
							
CATEGORY	A		B	C	D		
S-34	540/24 379 (400-½)			540/40 379 (400-¾)	540/50 379 (400-1)		
CIRCLING	660-1 493 (500-1)			700-1½ 533 (600-1½)	720-2 553 (600-2)		