
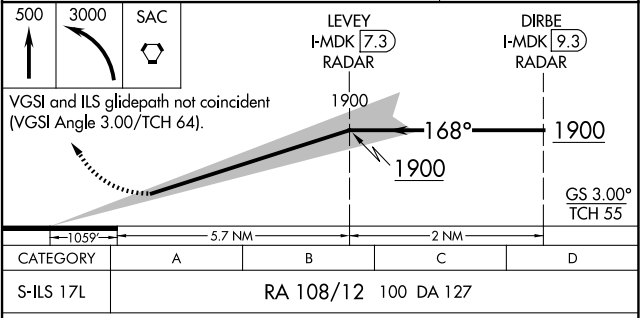
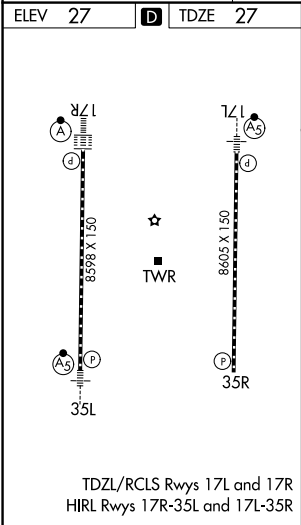


LOC/DME I-MDK 111.75 Chan 54 (Y)	APP CRS 168°	Rwy Ldg 8605 TDZE 27 Apt Elev 27
--	------------------------	---

ILS RWY 17L (SA CAT II)
SACRAMENTO INTL(SMF)

Aircraft not GPS equipped - RADAR required for procedure entry. DME or RADAR required. RNP APCH-GPS. From TENCO.	MALSR 	MISSED APPROACH: Climb to 500 then climbing left turn to 3000 direct SAC VORTAC and hold.
Simultaneous approach authorized. Requires specific OPSPEC, MSPEC or LOA approval.		

D-ATIS 126.75	NORCAL APP CON 125.4 259.1 (W-NE) 125.25 257.9 (SW) 127.4 317.5 (E-SE)	CAPITOL TOWER 125.7 256.7	GND CON 121.7 256.7
-------------------------	---	-------------------------------------	-------------------------------

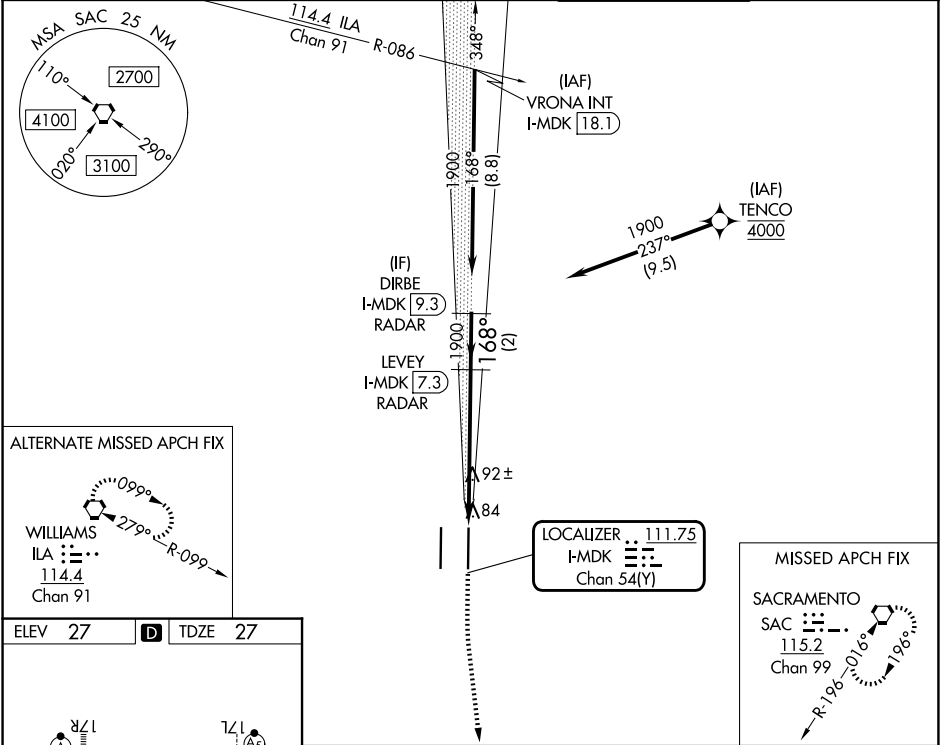

SA CATEGORY II ILS-SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

SW-2, 03 SEP 2026 to 01 OCT 2026

SW-2, 03 SEP 2026 to 01 OCT 2026