

RALEIGH

TRIPLE W (5W5) 11 SW UTC-5(-4DT) N35°37.22' W78°42.02'

CHARLOTTE
L-35B, 36F

244 B NOTAM FILE RDU

RWY 16-34: H3004X40 (ASPH) LIRL(NSTD) 0.3% up N

RWY 16: Trees.

RWY 34: Trees.

SERVICE: LGT Dusk—0500Z†. ACTIVATE LIRL—CTAF. Rwy 16-34 NSTD LIRL. Rwy 16-34 lgts 15' from edge of rwy, Rwy 16 thld lgts 150' from thld, Rwy 34 thld lgts 460' from thld. Twy not lgtd.

AIRPORT REMARKS: Attended irregularly. Deer on and in/ov arpt. Numerous unlighted obstructions in/ov arpt. Night landings not recommended. Rwy 16-34 PAEW parallel twy. All acft over 6500 lbs. prohibited. Twr (500 AGL/826' MSL) approximately 1.75 NM NW of arpt. Be alert for rising terrain all quadrants. Rwy 16-34 has 4' dropoff 20' from pavement edge all sides. 4 ft dropoff twy edge both sides—south end. Be alert 1000' of twy North end Rwy 16 unusbl due to erosion under pavement. CAUTION: vehicles on or in/ov Rwy 16-34. Rwy 16-34 heavy vegetation in cracks, markings badly faded.

AIRPORT MANAGER: (919) 971-3718

COMMUNICATIONS: CTAF/UNICOM 122.7

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

RALEIGH/DURHAM (H) VORTACW 117.2 RDU Chan 119 N35°52.35' W78°47.00' 174° 15.6 NM to fld. 429/9W.

RALEIGH EAST (See KNIGHTDALE on page 307)

RALEIGH EXEC JETPORT AT SANFORD—LEE CO (See SANFORD on page 332)

RALEIGH RGNL AT PERSON CO (See ROXBORO on page 330)

RALEIGH—DURHAM INTL (See RALEIGH/DURHAM on page 326)

RALEIGH/DURHAM

RALEIGH—DURHAM INTL (RDU)(KRDU) P (ARNG) 9 NW UTC-5(-4DT) N35°52.66'

CHARLOTTE
H-9C, 12H, L-36F
IAP, AD

W78°47.25'

435 B LRA Class I, ARFF Index D NOTAM FILE RDU

RWY 05L-23R: H10000X150 (CONC-WC) S-75, D-190, 2S-175, 2D-335, 2D/2D2-750 PCN 33 R/B/X/T HIRL CL

RWY 05L: MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 72'. RVR-TMR 0.6% up.

RWY 23R: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 69'. RVR-TMR Rgt tfc.

RWY 05R-23L: H7500X150 (ASPH-GRVD) S-75, D-176, 2S-175, 2D-335, 2D/2D2-750 PCN 89 F/A/X/T HIRL CL 0.4% up NE

RWY 05R: MALSR. PAPI(P4L)—GA 3.0° TCH 62'. RVR-TR Rgt tfc.

RWY 23L: MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 56'. RVR-TR

RWY 14-32: H3570X100 (ASPH) S-12 PCN 16 F/A/X/T MIRL

RWY 32: REIL. PAPI(P4L)—GA 3.5° TCH 47'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05L:TORA-10000 TODA-10000 ASDA-10000 LDA-10000


RWY 05R:TORA-7500 TODA-7500 ASDA-7500 LDA-7500

RWY 23L:TORA-7500 TODA-7500 ASDA-7500 LDA-7500

RWY 23R:TORA-10000 TODA-10000 ASDA-10000 LDA-10000

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 LGT Visibility of bcn shielded to the North. **MILITARY—FUEL A, A+** (C919-840-2200.) (NC-100LL)

AIRPORT REMARKS: Attended continuously. Arpt CLOSED to airships. Rwy 05L-23R SW 3000' ungrvd and NE 3000' ungrvd. Twy F1 is cisd until further notice. Crane 75' AGL 0.76 NM from AER 05R. PPR for all mil acft, fixed wing-rotary wing and unscheduled charter flts with 30 or more pax. 24 hrs PN rqr for mil practice apchs. Ctc arpt ops 919-840-7510 or RDU app C919-380-3125. 24 hr PPR for all fixed wing and rotary wing mil acft going to ARNG ramp. POC DSN 582-9000, extn 16200, C919-804-5300, extn 16200. OSACOM flight det DSN 582-9000, extn 16202, C919-804-5300, extn 16202. No jet engine maint runs btn 0500-1100Z†. National Guard 24 hr PPR for jet acft and trans mil acft 919-840-7510. No apvl rqr'd for pushback at terminal gates unless acft rqr's use of twy. Ctc ATC prior to pushing onto twy. Twy E behind South Cargo 4 and Twy J behind corporate hangars not visible from twr. All tdg V acft taxiing on Twy A are rstd to taxi speed of 15 mph. Flight Notification Service (ADCUS) avbl.

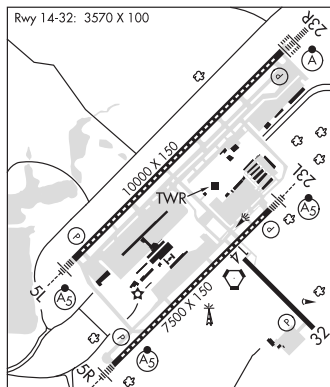

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: (919) 840-7701

WEATHER DATA SOURCES: ASOS (919) 840-0816 LLWAS. TDWR.

COMMUNICATIONS: D-ATIS 123.8 (919) 840-0486 UNICOM 122.95

RCO 122.2 (RALEIGH RADIO)

Ⓡ APP CON 124.95 (055°-229°) 127.675 (230°-054°)

TOWER 119.3 (West) (Rwy 05L-23R) 127.45 (East) (Rwy 05R-23L and Rwy 14-32)

GND CON 121.7 (West) (Rwy 05L-23R) 121.9 (East) (Rwy 05R-23L and Rwy 14-32) CLNC DEL 120.1

Ⓡ DEP CON 125.3 (055°-229°) 132.35 (230°-054°)

CPDLC (LOGON KUSA)

AIRSPACE: CLASS C svc ctc APP CON.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

RALEIGH/DURHAM (H) VORTACW 117.2 RDU Chan 119 N35°52.35' W78°47.00' at fld. 429/9W.

LEEVEY NDB (HW/LOM) 350 LE N35°55.63' W78°43.31' 234° 4.4 NM to fld. 442/7W.

ILS/DME 109.1 I-GKK Chan 28 Rwy 05L. Class IA.

ILS/DME 109.5 I-RDU Chan 32 Rwy 05R. Class IIE.

ILS/DME 108.5 I-LEI Chan 22 Rwy 23L. Class IA. LOM LEEVEY NDB. LOC unusable 1.0 NM to thld. LOC unusable for coupled approaches from 2.0 NM to thld.

ILS/DME 111.7 I-DMP Chan 54 Rwy 23R. Class OF IIIE. LOC unusable byd 20° r of course.

RALEIGH/DURHAM N35°52.35' W78°47.00' NOTAM FILE RDU.

WASHINGTON

(H) VORTACW 117.2 RDU Chan 119 at Raleigh-Durham Intl. 429/9W.

L-35C, 36G

REENO N36°04.26' W80°10.01' NOTAM FILE INT.

CINCINNATI

NDB (LOMW) 317 IN 332° 4.6 NM to Smith Reynolds. 862/7W.

L-25D, 36F

REIDSVILLE

ROCKINGHAM CO NC SHILOH (SIF)(KSIF) 8 NW UTC-5(-4DT) N36°26.23' W79°51.06'

CINCINNATI

694 B NOTAM FILE SIF

H-9B, 12H, L-26J, 36F

RWY 13-31: H5200X100 (ASPH) S-12.5, D-24 HIRL 0.5% up NW

RWY 13: PAPI(P2L)—GA 4.0° TCH 33'. Thld displcd 200'. Trees.

RWY 31: REIL. PAPI(P2L)—GA 4.0° TCH 40'. Trees.

SERVICE: S4 FUEL 100LL, JET A1+ LGTACTIVATE HIRL Rwy 13-31; PAPI Rwy 13 and Rwy 31 and REIL Rwy 31—CTAF. Rwy 31 REIL out of svc indefinitely.

AIRPORT REMARKS: Attended 1300-2200Z. Fuel 24 hr credit card svc avbl. Deer on and invof arpt.

AIRPORT MANAGER: 336-573-3115

WEATHER DATA SOURCES: AWOS-3 119.775 (336) 573-3677.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ GREENSBORO APP/DEP CON 124.35

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

RADIO AIDS TO NAVIGATION: NOTAM FILE GSO.

GREENSBORO (H) VORTAC 116.2 GSO Chan 109 N36°02.74'

W79°58.58' 018° 24.2 NM to fld. 909/3W.


TACAN AZIMUTH unusable:

255°-290° byd 10 NM blo 6,000'

SLAMMER NDB (MHW) 423 SIF N36°22.90'

W79°45.77' 315° 5.4 NM to fld. 861/7W. NOTAM FILE SIF.

SDF 108.3 I-OQA Rwy 31. SDF OTS indef.

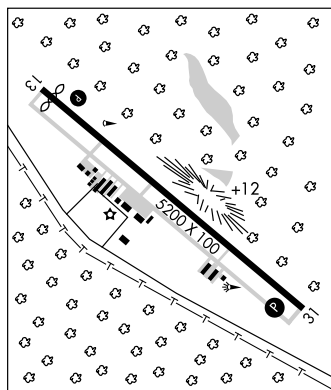

WARF (6A5) 3 SW UTC-5(-4DT) N36°19.44' W79°42.56'

CINCINNATI

820 NOTAM FILE RDU

RWY 17-35: H2550X150 (CONC-TURF) S-8 1.3% up N

RWY 17: Tree.

RWY 35: Trees.

AIRPORT REMARKS: Unattended. Deer on and invof arpt. Rwy yellow cones not placed in accordance with reported rwy length or width. Rwy 17-35 has 60'-85' trees 100' from rwy centerline both sides. Rwy 17-35 concrete portion 900' x 18' at north end. Rwy 35 has uphill grade. Rwy 35 has more than 50' dropoff/downslope 35' from thld both sides.

AIRPORT MANAGER: (336) 349-2195

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Greensboro Apch at 336-333-5119.

RICHMOND CO (See ROCKINGHAM on page 328)