


**REDDING**

**BENTON FLD** (O85) 1 W UTC-8(-7DT) N40°34.42' W122°24.44'  
 723 B NOTAM FILE RIU  
**RWY 15-33:** H2420X75 (ASPH) S-12.5 MIRL  
**RWY 15:** PAPI(P2L)—GA 3.5° TCH 24'. Rgt tfc.  
**RWY 33:** PAPI(P2L)—GA 3.5° TCH 24'.  
**SERVICE:** S2 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 15-33, PAPI Rwy 15 and Rwy 33—CTAF. Twy lighting rwy entrances only.  
**AIRPORT REMARKS:** Attended 1400Z±—dusk. High & lo pressure & ox replacement bottles avbl at Redding Muni (RDD). Large birds frequently on and in/ov arpt Oct-Apr. For noise abatement climb to 1500' AGL before turning. Calm wind preferred direction is Rwy 33.  
**AIRPORT MANAGER:** 530-224-4321  
**WEATHER DATA SOURCES:** AWOS-2 118.675 (530) 225-4183.  
**COMMUNICATIONS:** CTAF/UNICOM 122.8  
**CLEARANCE DELIVERY PHONE:** For CD ctc Oakland ARTCC at 510-745-3380.

KLAMATH FALLS

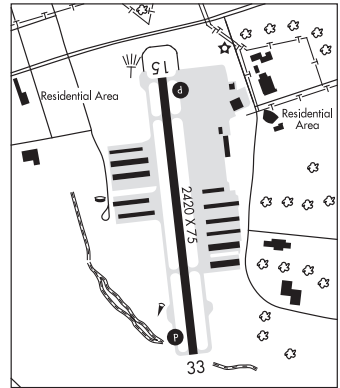

**REDDING MUNI** (RDD)(KRDD) 6 SE UTC-8(-7DT) N40°30.54' W122°17.60'


KLAMATH FALLS

505 B Class I, ARFF Index B NOTAM FILE RDD MON Airport  
**RWY 16-34:** H7003X150 (ASPH-GRVD) S-98, D-128, 2S-135, 2D-195 PCN 60 F/C/X/T HIRL  
**RWY 16:** RLLS. REIL. PAPI(P4L)—GA 3.43° TCH 40'. Tree.  
**RWY 34:** MALSR. PAPI(P4L)—GA 3.0° TCH 55'.  
**RWY 12-30:** H5067X150 (ASPH) S-60, D-72, 2S-91, 2D-110 PCN 60 F/C/X/T MIRL  
**RWY 12:** Trees.  
**RWY 30:** PAPI(P2L)—GA 3.0° TCH 32'. Tree.

H-3B, L-2H IAP, AD

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 12:** TORA-5067 TODA-5067 ASDA-5067 LDA-5067  
**RWY 16:** TORA-7003 TODA-7003 ASDA-7003 LDA-7003  
**RWY 30:** TORA-5067 TODA-5067 ASDA-5067 LDA-5067  
**RWY 34:** TORA-7003 TODA-7003 ASDA-7003 LDA-7003

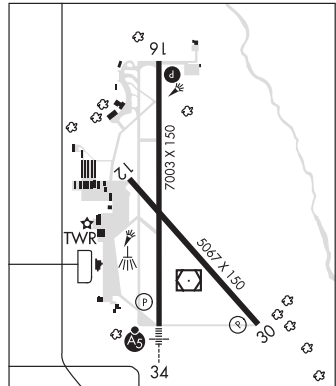

**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT ACTIVATE MALSR Rwy 34; REIL Rwy 16; PAPI Rwy 16; HIRL Rwy 16-34; MIRL Rwy 12-30; twy lgts—CTAF.

**AIRPORT REMARKS:** Attended dawn—dusk. PPR for unscheduled air carrier ops with more than 30 passenger seats. 0530-1430Z± call arpt manager 530-224-4321. For noise abatement avoid overflights of residential housing when possible. US Forest Service on fld, expect heavy air tanker activity during fire season.

**AIRPORT MANAGER:** 530-224-4321

**WEATHER DATA SOURCES:** ASOS (530) 221-7144

**COMMUNICATIONS:** CTAF 119.8 ATIS 124.1 UNICOM 122.95

RCO 122.1R 108.4T (RANCHO MURIETA RADIO)

Ⓡ OAKLAND CENTER APP/DEP CON 132.2

TOWER 119.8 (1430-0530Z±) GND CON 121.7

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Oakland ARTCC at 510-745-3380.

**AIRSPACE:** CLASS D svc 1430-0530Z±; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDD.

(T) VOR/DME 108.4 RDD Chan 21 N40°30.27' W122°17.50' at fld. 496/18E.

ILS/DME 108.7 I-RDD Chan 24 Rwy 34. Class IE. Unmonitored when ATCT clsd. Localizer backcourse unusable w/ 2 DME abv 2,000'.

**COMM/NAV/WEATHER REMARKS:** Emerg frequency 121.5 not avbl at twr.