

TED STEVENS ANCHORAGE INTL (ANC)(PANC) P (ANG) 4 SW UTC-9(-8DT) N61°10.45' W149°59.89' **ANCHORAGE**
H-1B, 2K, L-1A, 3D, 4G
IAP, AD

151 B LRA Class I, ARFF Index E NOTAM FILE ANC

RWY 07R-25L: H12400X200 (ASPH-CONC-GRVD) S-75, D-175, 2S-175, 2D-400, 2D/2D2-1300 PCN 81 F/A/W/T HIRL CL

RWY 07R: ALSF2. TDZL. PAPI(P4R)—GA 3.0° TCH 72'. RVR-TMR Rgt tfc.

RWY 25L: PAPI(P4L)—GA 3.0° TCH 75'. RVR-TMR 0.4% up.

RWY 15-33: H10865X200 (ASPH-GRVD) S-75, D-175, 2S-175, 2D-400, 2D/2D2-900 PCN 81 F/A/W/T HIRL CL

RWY 15: MALSF. PAPI(P4R)—GA 3.2° TCH 85'. RVR-TMR Rgt tfc. 0.5% down.

RWY 33: REIL. PAPI(P4R)—GA 3.0° TCH 60'. RVR-TMR Thld dsplcd 465'.

RWY 07L-25R: H10600X150 (ASPH-GRVD) S-75, D-175, 2S-175, 2D-400, 2D/2D2-900 PCN 81 F/A/W/T HIRL CL

RWY 07L: MALSR. TDZL. PAPI(P4R)—GA 3.0° TCH 63'. RVR-T Rgt tfc. 0.5% down.

RWY 25R: PAPI(P4L)—GA 3.0° TCH 60'. RVR-R

RUNWAY DECLARED DISTANCE INFORMATION

RWY 07L:TORA-10600 TODA-10600 ASDA-10600 LDA-10600

RWY 07R:TORA-10900 TODA-10900 ASDA-10900 LDA-12400

RWY 15: TORA-10865 TODA-10865 ASDA-10000 LDA-10000

RWY 25L:TORA-12400 TODA-12400 ASDA-12000 LDA-12000

RWY 25R:TORA-10600 TODA-10600 ASDA-10600 LDA-10600

RWY 33: TORA-10865 TODA-11965 ASDA-10865 LDA-10400

SERVICE: S4 FUEL 100, 100LL, JET A, A1 OX 1, 2, 3, 4

NOISE: Noise sensitive area in effect; ctc arpt ops 907-266-2600 for further info.

AIRPORT REMARKS: Special Air Traffic Rules-Part 93, see Regulatory Notices. Attended continuously. Migratory birds invof arpt Spring through Fall. ASSC in use. Operate transponders with altitude reporting mode and ADS-B (if equipped) enabled on all airport surfaces. One hr PPR for non-transponder acft ops. PPR for non-radio acft ops. Pilots must provide an ETA and remain within plus or minus 15 minutes of ETA. To coord non-transponder or non-radio ops ctc Anchorage twr at 907-271-2700 during administration hrs (1630-0100Z weekdays). During non-administration hrs and holidays ctc FAA at 907-271-5936. No nighttime non-radio acft ops permitted. Transient military acft PPR. NOTE: Twy K is north of and parallel to Rwy 07R/L-25R/L. Use caution to avoid ldg on twy. When Rwy 07R-25L or Rwy 15-33 are CLOSED, Rwy 07L-25R open to all acft. FAA ramp PPR ctc ANC FIFO freq 135.85 907-271-2414 or AVN 405-954-9780 Mon-Fri 1500-2330Z. All turbojet/turbofan acft departing Rwsy 07R/07L dur a Rwy 15-33 closure will employ the FAA close-in NADP or ICAO procedure B NADP when safety permits. Right turn out of ramp parking area R-2 thru R-4 prohibited. General aviation ops be alert, jet blast all twys and parking ramp. Rwy 07R: back-taxing fm Twy J for dep prohibited. No compass calibration pad. Unlighted 489' twr 2 1/2 miles NE. Portions of Twy K between Twy H and Twy J not vis from twr. Twy J stop bar non-standard. Lead on lights remain on when activated. Twy V, security gate east of Twy E key 121.75 5 times to ACTIVATE. Twy H-2, lakeshore twy gates, PCL key 121.75 3 times to ACTIVATE. If PCL twy gates inoperative, allow 30 seconds to reset and try again. If unsuccessful, notify LHD Ops, 907-266-2600. Twy V restricted to acft weighing 12,500 lbs or less. Subject to jet blast west of Twy E. Rwy end 25L has 200 ft blast pad.

AIRPORT MANAGER: 907-266-2600

WEATHER DATA SOURCES: ASOS (907) 271-5278 (WX CAM)

COMMUNICATIONS: UNICOM 122.95 D-ATIS 135.5 907-243-2847

RCO 255.4 122.2 (KENAI FSS)

RCO 122.55 122.3 (KENAI FSS)

APP/DEP CON 119.1 363.2 (250°-330° TED 1500' and blo) (331°-045° TED 2500' and blo)

118.6 290.5 (250°-330° TED abv 1500') (331°-045° TED abv 2500')


126.4 270.25 (046°-205° TED) 123.8 270.25 (206°-249° TED)

TOWER 257.8 118.3 GND CON 338.25 121.9 CLNC DEL 323.1 119.4

INTERNATIONAL A/G FREQS 13273 11330 10048 8951 6655 5628 2932 (San Francisco ARINC)

PDC

AIRSPACE: CLASS C svc ctc APP CON.

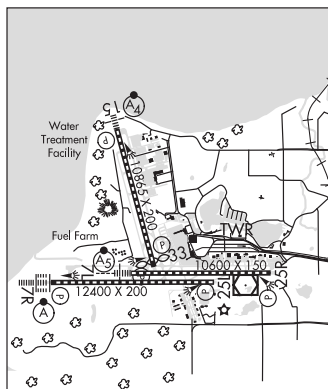

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOR TEST FACILITY (VOT) 108.4

RADIO AIDS TO NAVIGATION: NOTAM FILE ANC.

ANCHORAGE (H) VORW/DME 113.15 TED Chan 78(Y) N61°10.07' W149°57.61' 271° 1.2 NM to fld. 93/18E.

VOR unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

DME unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

196°-206° byd 25 NM blo 3,500'

206°-211° byd 25 NM blo 4,000'

211°-221° byd 25 NM blo 3,500'

ILS/DME 109.9 I-TGN Chan 36 Rwy 07L. Class ID.**ILS/DME** 111.3 I-ANC Chan 50 Rwy 07R. Class IIIE. LOC unusable byd 25° left of course. DME unusable byd 25° right of course.**ILS/DME** 111.75 I-BSC Chan 54(Y) Rwy 15. Class IE.**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737. SELCAL facility on HF avbl, opr by San Francisco ARINC. For WSO dial 907-266-5105. SSB (upper channel) capability. Avbl for all HF air/gnd freqs. Use freq 122.55 for filing, activating and canceling flt plans in the Anchorage Bowl Area. VOT unusable east of Twy K, south of Twy M and Twy R.**ANCHORAGE** N61°10.07' W149°57.61' NOTAM FILE ANC.**(H) VORW/DME** 113.15 TED Chan 78(Y) 334° 1.1 NM to Lake Hood. 93/18E.**ANCHORAGE****H-1B, 2K, L-1A, 3D, 4G**

VOR unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

DME unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

196°-206° byd 25 NM blo 3,500'

206°-211° byd 25 NM blo 4,000'

211°-221° byd 25 NM blo 3,500'

RCO 122.3 122.55 (KENAI RADIO)**RCO** 122.2 (KENAI RADIO)**ANDERSON LAKE** (See WASILLA on page 261)