

FAIRMONT MUNI (FRM)(KFRM) 2 SE UTC-6(-5DT) N43°38.64' W94°24.94'

OMAHA

1162 B NOTAM FILE FRM

H-5C, L-121

RWY 13-31: H5503X100 (ASPH-PFC) S-35, D-40 HIRL

IAP

RWY 13: REIL. PAPI(P4L)—GA 3.0° TCH 43'. Road.**RWY 31:** MALSR. PAPI(P4L)—GA 3.0° TCH 40'.**RWY 02-20:** H3300X75 (ASPH) S-12 MIRL**RWY 02:** REIL. PAPI(P4L)—GA 3.0° TCH 25'.**RWY 20:** REIL. PAPI(P4L)—GA 3.0° TCH 40'.

SERVICE: FUEL 100LL, JET A LGT HIRL Rwy 13-31 and MIRL Rwy 02-20 preset to low ints, to incr ints and ACTIVATE MALSR Rwy 31, REIL Rwy 13, Rwy 02 and Rwy 20, PAPI Rwy 13, Rwy 31, Rwy 02 and Rwy 20—CTAF. For twy lgts key 122.8, 3 times for 30% and 7 times for 100%.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z. JET A and 100LL avbl 24hrs with credit card. Migratory bird hazard spring and fall, gulls on and invof arpt. For transient storage contact arpt manager.

AIRPORT MANAGER: 507-235-6160**WEATHER DATA SOURCES:** AWOS-3PT 120.025 (507) 238-1562.**COMMUNICATIONS:** CTAF/UNICOM 122.8

RCO 122.3 (PRINCETON RADIO)

MINNEAPOLIS CENTER APP/DEP CON 127.75

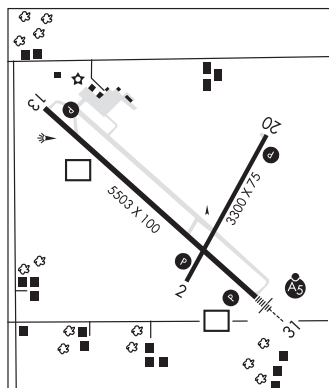
AIRSPACE: CLASS E svc 1130-0130Z Mon-Fri, 1130-1900Z Sat, 1600-2300Z Sun; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE FRM.

(L) DME 110.2 FRM Chan 39 N43°38.76' W94°25.35' at fld. 1164/OE.

MONTZ NDB (LOMWW) 420 FQ N43°34.42' W94°19.08' 311° 6.0 NM to fld. 1144/4E.

ILS 111.1 I-FQJ Rwy 31. Class IT. LOM MONTZ NDB. Unmonitored.

**FALLS INTL/EINARSON FLD** (See INTERNATIONAL FALLS on page 173)**FAIRBAULT MUNI-LIZ WALL STROHFUS FLD** (FBL)(KFBL) 3 NW UTC-6(-5DT) N44°19.74'

OMAHA

W93°18.78'

L-121

1060 B NOTAM FILE FBL

IAP

RWY 12-30: H4257X75 (ASPH) S-16, D-22 MIRL 0.3% up NW**RWY 12:** REIL. PAPI(P4L)—GA 3.0° TCH 40'. Tree.**RWY 30:** REIL. PAPI(P4L)—GA 3.0° TCH 40'. Thld dsplcd 230'. Road.**RWY 01-19:** 2300X175 (TURF)**RWY 01:** Crops.**RWY 19:** Tree.

SERVICE: S4 FUEL 100LL, JET A OX4 LGT MIRL Rwy 12-30 preset to low, to incr ints and ACTIVATE REIL Rwy 12 and Rwy 30—CTAF. Rwy 12 PAPI ops continuously. Rwy 30 PAPI opr continuously.

AIRPORT REMARKS: Attended May-Sep 1400-0000Z, Oct-Apr Mon-Fri 1400-0000Z, Oct-Apr Sat 1600-2100Z, Oct-Apr Sun unattended. For svc after hrs call 507-838-7152. Self svc fuel with credit card. Rwy 01-19 not plowed winter months. Open for skiplanes. When landing on Rwy 12, be alert for turbulence and possible windshear when winds are out of the south. Ultralights and gliders use twy and extended twy parallel to Rwy 12-30. Ultralights and gliders using twy fly pattern on NE side of Rwy 12-30. Rwy 01-19 marked with yellow cones.

AIRPORT MANAGER: 507-332-0140**WEATHER DATA SOURCES:** AWOS-3 120.2 (507) 332-2505.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® MINNEAPOLIS APP/DEP CON 134.7

GCO 121.725 (MINNEAPOLIS CLNC and FLIGHT SERVICES)

CLEARANCE DELIVERY PHONE: For CD etc Minneapolis Apch at 612-726-9086.**RADIO AIDS TO NAVIGATION:** NOTAM FILE PNM.

HALFWAY (T) (T) VORW/DME 111.2 FOW Chan 49 N44°12.27' W93°22.23' 016° 7.9 NM to fld. 1100/2E.

VOR/DME unmonitored.

VOR portion unusable:

230°-250°

