

**DOWAGIAC MUNI** (C91) 1 NW UTC-5(-4DT) N41°59.58' W86°07.70'

**CHICAGO**

747 B TPA—1547(800) NOTAM FILE LAN

L-281

**RWY 09-27:** H4700X100 (ASPH) S-30, D-60 MIRL

IAP

**RWY 09:** REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees.

**RWY 27:** REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees. Rgt ftc.

**RWY 04-22:** 2176X100 (TURF)

**RWY 04:** Trees.

**RWY 22:** Thld dsplcd 388'. Tree. Rgt ftc.

**SERVICE:** FUEL 100LL LGT ACTIVATE MIRL Rwy 09-27; PAPI Rwy 09 and Rwy 27; REIL Rwys 09 and 27—CTAF.

**AIRPORT REMARKS:** Unattended. Self svc fuel avbl 24 hrs. Deer and birds on and invof arpt. Model RC acct ops E side of Rwy 04-22. Admin bldg access, depress V, then III-II simultaneous, then I. Rwy 04-22 and dspld thld marked with 3' yellow cones.

**AIRPORT MANAGER:** 269-591-0054

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**KELLER RCO 122.1R 116.6T (LANSING RADIO)**

Ⓡ **SOUTH BEND APP/DEP CON** 118.55 (1030-0500Z‡ Sun-Fri, 1030-0445Z‡ Sat), other times ctc

Ⓡ **CHICAGO CENTER APP/DEP CON** 127.55


**CLEARANCE DELIVERY PHONE:** For CD ctc south bend Apch at 574-251-2609. when south bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LAN.

**KEELER (L) VORW/DME** 116.6 ELX Chan 113 N42°08.66' W86°07.36' 182° 9.1 NM to fld. 794/OE.

DME unusable:

155°-010° byd 30 NM blo 3,500'

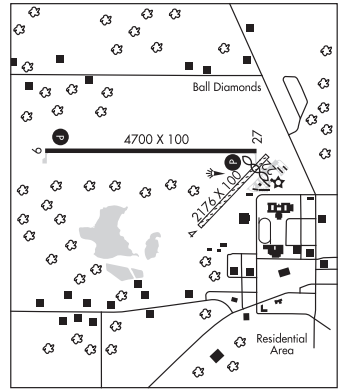

## DRUMMOND ISLAND

**DRUMMOND ISLAND** (DRM)(KDRM) 1 SW UTC-5(-4DT) N46°00.56' W83°44.64'

**LAKE HURON**

668 B TPA—1668(1000) LRA NOTAM FILE DRM

L-31C

**RWY 08-26:** H4000X75 (ASPH) MIRL

IAP

**RWY 08:** PAPI(P2L)—GA 3.0° TCH 35'. Thld dsplcd 650'. Trees.

**RWY 26:** PAPI(P2L)—GA 3.0° TCH 25'. Thld dsplcd 170'. Road.

**RWY 01-19:** 2500X150 (TURF)

**RWY 01:** Trees.

**RWY 19:** Trees.

**SERVICE:** S4 FUEL 100LL, MOGAS OX1, 3 LGT ACTIVATE MIRL Rwy 08-26 and PAPI Rwy 08 and 26—CTAF.

**AIRPORT REMARKS:** Attended Mon-Sat 1300-2200Z‡. Birds and deer invof arpt. Occasional golf carts and pedestrians crossing Rwy 08-26 due to golf course on both sides. Drummond Island, Yacht Haven SPB located 1.5 mile north, customs avbl 906-632-8822, 906-632-7221. Rwy 01-19 marked with 3' yellow cones. Rwy 01-19 center 20' portion of rwy from intersection Rwy 08-26 north to the hangar line is asph; remainder of rwy turf. Flight Notification Service (ADCUS) available.

**AIRPORT MANAGER:** 906-493-5411

**WEATHER DATA SOURCES:** AWOS-3 118.325 (906) 493-6410.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **TORONTO CENTER APP/DEP CON** 132.65

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE CIU.

**SAULT STE MARIE (H) (H) VOR/DME** 112.2 SSM Chan 59 N46°24.73' W84°18.89' 139° 33.9 NM to fld. 687/4W.

VOR unusable:

085°-105° byd 10 NM blo 5,000'

085°-105° byd 20 NM blo 8,000'

