

DENVER

CENTENNIAL (APA)(KAPA) 15 SE UTC-7(-6DT) N39°34.21' W104°50.96'

5885 B AOE LRA NOTAM FILE APA

RWY 17L-35R: H10001X100 (ASPH-GRVD) S-56, D-75, 2S-95

PCN 26 F/C/X/T MIRL

RWY 17L: PAPI(P4L)—GA 3.0° TCH 47'. 1.0% up.

RWY 35R: MALSR. PAPI(P4L)—GA 3.0° TCH 49'. P-line. Rgt tfc. 0.8% down.

RWY 17R-35L: H7001X75 (ASPH-GRVD) S-30 PCN 23 F/C/X/T MIRL 0.9% up S

RWY 17R: REIL. PAPI(P4L)—GA 3.0° TCH 42'. Rgt tfc.

RWY 35L: REIL. PAPI(P4R)—GA 3.0° TCH 37'. Fence.

RWY 10-28: H4800X75 (ASPH-GRVD) S-12.5 PCN 17 F/A/Y/T MIRL 0.6% up W

RWY 10: PAPI(P2L)—GA 3.0° TCH 44'. Thld dsplcd 400'.

RWY 28: REIL. PAPI(P2L)—GA 3.0° TCH 41'. Pole.

SERVICE: S4 FUEL 100LL, JET A OX 1, 2

NOISE: Noise abatement proc in efct; noise office—303-790-0598. Rwy 35R crosswind/base leg N of Lincoln Ave; Rwy 17L crosswind/base leg S of Arapahoe Road; Rwy 17R-35L clsd tfc remain S of Arapahoe Road and E of Interstate 25; Rwy 10-28 avoid noise sensitive area 1 mi S and E of rwy.

AIRPORT REMARKS: Attended continuously. 100LL: Self serve fuel avbl.

Waterfowl on and in vicinity of arpt. Mult lrg pwr lines appxly 3 NM S of Rwy 35R and Rwy 35L. Numerous cranes invof arpt. Nmrs flood lgts 1/2 SM N of thr; SS-0700Zt. Adzy density alt dspl lctd C-1, A-1, and A-18. +109' twr located 1800' east/northeast of Rwy 17L thld. All acft blo cert 70,000 lb max gross tkof wt and Stage III acft up to cert 75,000 lb max gross tkof wt may opr; one-time exception auzd by Exec Dir. Twy S2 clsd indef. Heli ops ctc FBO for Indg zone lctn; heli ops on front ramp not advised. User fee arpt: H24 U.S. Customs—303-768-0309. CTN: Ensure proper rwy alnmt; close spaced parl rwys. Arpt safety video—https://www.faa.gov/airports/runway_safety/videos/apa/. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 303-790-0598

WEATHER DATA SOURCES: ASOS (720) 873-2799

COMMUNICATIONS: ATIS 120.3 303-799-6722 UNICOM 122.95

DENVER RCO 122.2 (DENVER RADIO)

DENVER APP/DEP CON 132.75


TOWER 118.9 GND CON 121.8 CLNC DEL 128.6

AIRSPACE: CLASS D svc continuous.

DENVER

H-3F, 5A, L-10F, A

IAP, AD

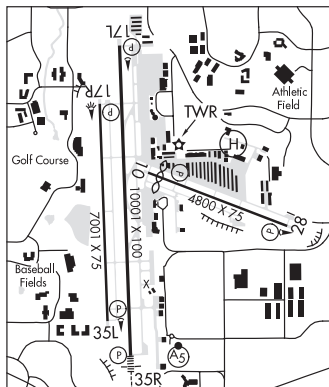

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOR TEST FACILITY (VOT) 108.2

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

FALCON (VH) (H) VORTACW 116.3 FQF Chan 110 N39°41.41' W104°37.26' 225° 12.8 NM to fld. 5780/11E.

TACAN AZIMUTH unusable:

068°-088° byd 10 NM blo 11,500'

DME unusable:

068°-088° byd 10 NM blo 11,500'

VOR unusable:

132°-157° byd 40 NM

158°-168° byd 40 NM blo 18,000'

169°-191° byd 40 NM

192°-203° byd 40 NM blo 12,000'

192°-203° byd 76 NM blo 18,000'

192°-230° byd 49 NM blo 16,200'

204°-212° byd 40 NM

215°-231° byd 40 NM blo 13,800'

215°-231° byd 47 NM blo 15,000'

215°-231° byd 58 NM blo 16,400'

215°-231° byd 81 NM blo 18,000'

232°-236° byd 40 NM

247°-259° byd 40 NM blo 16,500'

247°-259° byd 73 NM blo 18,000'

281°-285° byd 40 NM

301°-311° byd 40 NM blo 13,500'

301°-311° byd 60 NM blo 16,000'

301°-311° byd 74 NM

ILS/DME 111.3 I-APA Chan 50 Rwy 35R. Class IT. LOC unusable byd 13 NM blo 9,000'.

COMM/NAV/WEATHER REMARKS: Emerg frequency 121.5 not avbl at twr. Advise GND CON when ready for dep. GND CON will

advise when to monitor the twr frequency.

HELIPAD H1: H50X50 (CONC) PERIMETER LGTS

HELIPORT REMARKS: Helipad H1: TLOF 50X50 ft; FATO 50X50 ft; ingress/egress 270. Helipad H1: H24 heli svc—303-799-0079.

COLORADO AIR AND SPACE PORT (CFO)(KCFO) 19 E UTC-7(-6DT) N39°47.05' W104°32.26'

DENVER H-5A, L-10F, A IAP, AD

5515 B TPA—6503(988) NOTAM FILE CFO MON Airport

RWY 08-26: H8002X100 (ASPH) S-28, D-40 HIRL

RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 50'. Rgt tfc. 0.5% up.

RWY 26: MALSR. PAPI(P2L)—GA 3.0° TCH 50'. 0.4% down.

RWY 17-35: H8000X100 (ASPH) S-34, D-75 MIRL

RWY 17: REIL. PAPI(P4L)—GA 3.0° TCH 55'. 0.5% up.

RWY 35: MALSR. PAPI(P4L)—GA 3.0° TCH 56'. P-line. Rgt tfc. 0.5% down.

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 LGT ACTVT MALSR Rwy 26 and Rwy 35; REIL Rwy 08 and Rwy 17; PAPI Rwy 08, 26, 17 and 35; HIRL Rwy 08-26; MIRL Rwy 17-35—CTAF.

NOISE: Noise sensitive areas SE, S and SW of arpt. Avoid flts blw 1,000 ft ovr populated areas.

AIRPORT REMARKS: Attended 1400-0400Z†. After hrs svc—AMGR. 100LL self svc avbl H24 with credit card. CAUTION: USAF trng act in/of Colorado Springs and Pueblo Arpt. Blue and white reflectors alg Twy A, B, C and E edge. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 303-261-9100

WEATHER DATA SOURCES: AWOS-3 119.025 (303) 261-9104.

COMMUNICATIONS: CTAF 120.2 ATIS 119.025 UNICOM 122.95

DENVER APP/DEP CON 128.25

SPACE PORT TOWER 120.2 (1400-0400Z†) GND CON 124.7

CLNC DEL 124.7 (1400-0400Z†) DENVER CLNC DEL 121.75 (0400-1400Z†)

AIRSPACE: CLASS D svc 1400-0400Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

ILS/DME 110.9 I-FZR Chan 46 Rwy 17. Class IT. Unmonitored when twr clsd.

ILS/DME 109.3 I-FTG Chan 30 Rwy 26. Class IT. Rwy 26 autopilot cpd apch na below 6,250' MSL.

ILS/DME 110.9 I-VWT Chan 46 Rwy 35. Class IT. Unmonitored when twr clsd.

