

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE DVL.

(L) DME 114.75 DVL Chan 94(Y) N48°06.91' W98°54.75' at fld. 1448.

ILS 108.7 I-VKE Rwy 31. Unmonitored.

DICKINSON/THEODORE ROOSEVELT RGNL (DIK)(KDIK) 5 S UTC-7(-6DT) N46°48.03'

BILLINGS

W102°48.27'

H-2H, L-14F

2592 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE DIK

IAP, AD

RWY 14-32: H7301X150 (CONC-GRVD) S-60, D-90, 2D-90

PCN 25 R/B/W/T HIRL

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 50'. Pole.

RWY 32: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. Road.

RWY 07-25: H4700X75 (ASPH-GRVD) S-16, D-20 PCN 5 F/D/W/T

MIRL 0.4% up E

RWY 07: REIL. PAPI(P2L)—GA 3.0° TCH 28'.

RWY 25: REIL. PAPI(P2L)—GA 3.0° TCH 28'. Road.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 07: TORA-4700 TODA-4700 ASDA-4700 LDA-4700

RWY 14: TORA-7301 TODA-7301 ASDA-7301 LDA-7301

RWY 25: TORA-4700 TODA-4700 ASDA-4700 LDA-4700

RWY 32: TORA-7301 TODA-7301 ASDA-7301 LDA-7301

SERVICE: S4 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 32; REIL

Rwy 14, 07 and 25; PAPI Rwy 07, 25, 14 and 32; HIRL Rwy

14-32—CTAF. MIRL Rwy 07-25 preset on low instst dusk-0500Z†;

to incr instst aft 0500Z†—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z†. Haying operations adjacent

to all surfaces Jun-Sep. Airfield sfc conds unmon btn 0600 and

1130Z†. For svc after hrs call 701-264-9966. Rwy 07-25 not avbl for skedd acr oprns with more than 9 psgr seats or

unskedd acr at least 31 psgr seats. Crop dusting operations invof arpt. PAEW on movement areas during winter (Oct-Apr).

TPA—single engine 3602 (1010); multiengine 4102 (1510). Conc apron for heavy acft parking.

AIRPORT MANAGER: 701-483-1062

WEATHER DATA SOURCES: ASOS 118.375 (701) 227-0280.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.2 (GRAND FORKS RADIO)

® MINNEAPOLIS CENTER APP/DEP CON 124.25

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Minneapolis ARTCC at 651-463-5588.

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE DIK.

(VH) (H) VORTACW 112.9 DIK Chan 76 N46°51.60' W102°46.41' 186° 3.8 NM to fld. 2527/14E.


VOR unusable:

010°-020° byd 40 NM blo 18,000'

180°-230° byd 40 NM

260°-270°

ILS/DME 108.3 I-DIK Chan 20 Rwy 32. Class IE. Unmonitored.

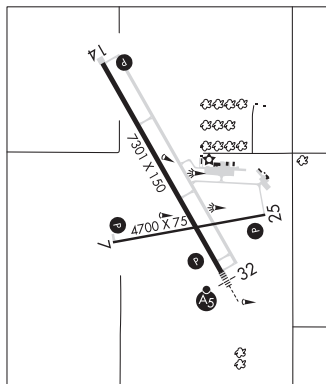

DRAYTON MUNI (D29) 3 N UTC-6(-5DT) N48°37.11' W97°10.55'

TWIN CITIES

798 B NOTAM FILE GFK

RWY 17-35: H2596X60 (ASPH) S-4 LIRL

RWY 35: Thld dsplcd 505'.

SERVICE: LGT LIRL Rwy 17-35 opr dusk-0600Z†, after 0600Z†, ACTIVATE LIRL Rwy 17-35 —CTAF.

AIRPORT REMARKS: Unattended. For svc call 701-454-6588. Confirm winter conditions and snow removal before use, call

701-454-3590 or 701-454-6588. Rwy 35 dsplcd thld ngt ops only. Rwy 17 cultivated fld 20 ft fm thr. Rwy 17 mkgs

heavily worn & faded. Rwy 35 mkgs heavily worn & faded.

AIRPORT MANAGER: 701-520-1219

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

DUNN CO WEYDAHL FLD (See KILLDEER on page 341)