

ESPAÑOLA

OHKAY OWINGEH (E14) 3 NE UTC-7(-6DT) N36°01.57' W106°02.72'

DENVER

5790 B NOTAM FILE ABQ

H-4L, 6F, L-8I

RWY 16-34: H5007X75 (ASPH) S-18 PCN 7 F/D/Y/T MIRL

RWY 16: Thld dsplcd 324'.

SERVICE: FUEL 100LL, JET A1+ LGT ACTVT MIRL Rwy 16-34—CTAF.

AIRPORT REMARKS: Unattended. 100LL fuel H24 with credit card. Wildlife on and invof arpt. Main gate locked—aces 4751.

Rwy 16 dthr not mkd. Rwy 16-34 1.5 in deep 2-4 in wid cracks acrs rwy ev 50-100 ft. 7083 ft MSL twr 3.3 NM 010 degs N of arpt.

AIRPORT MANAGER: 575-779-9544

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE SAF.

SANTA FE (L) (L) VORTACW 110.6 SAF Chan 43 N35°32.43' W106°03.90' 349° 29.1 NM to fld. 6268/13E.

VORTAC unusable:

015°-030° byd 30 NM blo 14,600'

ESTANCIA MUNI (E92) 1 E UTC-7(-6DT) N34°45.80' W106°02.48'

ALBUQUERQUE

6100 NOTAM FILE ABQ

RWY 08-26: 4000X50 (GRVL)

RWY 08: Pole.

RWY 26: Brush.

SERVICE: LGT Rwy 08 markings NSTD, thld and edge marked with reflective material. Several reflectors missing and reflective material in poor cond. Rwy 26 markings NSTD, thld and edge marked with reflective material. Several reflectors missing and reflective material in poor cond.

AIRPORT REMARKS: Unattended. Cattle and birds on and invof rwy. Rwy 08-26 soft when wet. Rwy 08 +12' tree 134' from thld, 78' rgt of cntrln. Rwy 26 +3-5' brush 0-200' from thld, 125' left and rgt of cntrln. Rwy 08-26 scattered brush in primary surface, +2-3 ft high, 30-40 ft fm cntrln both sides.

AIRPORT MANAGER: 505-401-3701

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

FARMINGTON

FOUR CORNERS RGNL (FMN)(KFMN) 1 NW UTC-7(-6DT) N36°44.48' W108°13.80'

DENVER

5507 B Class III, ARFF Index A NOTAM FILE FMN

H-4K, L-8H

RWY 07-25: H6704X100 (ASPH-PFC) S-50, D-90, 2S-114

IAP, AD

PCN 29 F/C/X/T MIRL 0.4% up E

RWY 07: VASI(V4L)—GA 3.0° TCH 50'. Thld dsplcd 239'.

RWY 25: REIL. VASI(V4L)—GA 3.0° TCH 55'. Thld dsplcd 217'.

RWY 05-23: H6501X150 (ASPH-GRVD) S-47, D-66, 2S-84

PCN 29 F/C/X/T MIRL 0.5% up NE

RWY 05: PAPI(P4L)—GA 3.0° TCH 42'.

RWY 23: REIL. PAPI(P4R)—GA 3.0° TCH 42'. Thld dsplcd 511'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-6501 TODA-6501 ASDA-5590 LDA-5590

RWY 07: TORA-6704 TODA-6704 ASDA-6487 LDA-6248

RWY 23: TORA-6501 TODA-6501 ASDA-6101 LDA-5590

RWY 25: TORA-6704 TODA-6704 ASDA-6465 LDA-6248

SERVICE: S4 FUEL 100LL, JET A, A1+ OX2, 4 LGT When ATCT clsd ACTVT REIL Rwy 23 and 25; PAPI Rwy 05 and 23; VASI Rwy 07 and 25; MIRL Rwy 05-23 and 07-25—CTAF. REIL Rwy 25 and MIRL Rwy 07-25 preset low intst.

AIRPORT REMARKS: Attended 1300-0500Z†. Arpt surface conditions are not monitored outside of attended hours.

AIRPORT MANAGER: 505-599-1394

WEATHER DATA SOURCES: ASOS 127.15 (505) 325-9268. LAWRS SAWRS.


COMMUNICATIONS: CTAF 118.9 ATIS 127.15 UNICOM 122.95

FARMINGTON RCO 122.4 (ALBUQUERQUE RADIO)

® DENVER CENTER APP/DEP CON 118.575

FARMINGTON TOWER 118.9 (1300-0500Z†) GND CON 121.7

CLEARANCE DELIVERY PHONE: For CD ctc farmington ATCT ground control 121.7, when ATCT clsd ctc Denver ARTCC at 303-651-4257

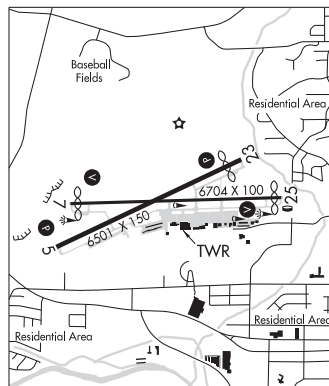

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1300-0500Z†; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE FMN.

RATTLESNAKE (VH) (H) VORTACW 115.3 RSK Chan 100 N36°44.90' W108°05.93' 252° 6.3 NM to fld.
5821/14E.

VOR unusable:

007°-017° byd 40 NM blo 18,000'
018°-041° byd 40 NM
042°-062° byd 40 NM blo 15,000'
042°-062° byd 63 NM blo 20,000'
063°-066° byd 40 NM
067°-077° byd 40 NM blo 14,000'
067°-077° byd 75 NM
078°-094° byd 40 NM
095°-105° byd 40 NM blo 18,000'
106°-119° byd 40 NM blo 11,500'
106°-119° byd 62 NM blo 12,500'
106°-119° byd 76 NM
120°-125° byd 40 NM
235°-255° byd 40 NM blo 12,000'
235°-255° byd 84 NM blo 28,000'
256°-274° byd 40 NM
275°-285° byd 40 NM blo 30,000'
286°-327° byd 40 NM
328°-338° byd 40 NM blo 15,000'
344°-356° byd 40 NM blo 16,300'
344°-356° byd 66 NM
357°-006° byd 40 NM

ILS/DME 111.9 I-FMN Chan 56 Rwy 25. Class IE. Unmonitored when ATCT clsd.

FORT SUMNER MUNI (FSU)(KFSU) 2 NE UTC-7(-6DT) N34°29.33' W104°12.99'

ALBUQUERQUE

4165 B NOTAM FILE ABQ

H-6F, L-6G

RWY 03-21: H5800X75 (ASPH) S-25 PCN 3 F/C/Y/T MIRL 0.7% up NE

RWY 03: Tree.

RWY 21: PVASI(PSIL). Brush.

RWY 08-26: H5250X60 (ASPH) S-17 PCN 3 F/D/Y/T MIRL

RWY 08: Road.

RWY 26: PVASI(PSIL). Brush.

SERVICE: LGT ACTIVATE MIRL Rwy 08-26—CTAF. MIRL Rwy 03-21 preset low ints till 0500Z†. After 0500Z†
ACTIVATE—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. For attendant after hrs call (575) 355-2405. Gate code is 2019.

AIRPORT MANAGER: 575-799-7654

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE TCC.

TUCUMCARI (VH) (H) VORTACW 113.6 TCC Chan 83 N35°10.93' W103°35.91' 204° 51.5 NM to fld. 4035/12E.

VOR unusable:

125°-182° byd 40 NM
183°-193° byd 40 NM blo 20,000'
194°-227° byd 40 NM
228°-238° byd 40 NM blo 11,000'
228°-238° byd 46 NM
239°-249° byd 40 NM
250°-261° byd 40 NM blo 7,700'
250°-261° byd 46 NM blo 18,000'
262°-273° byd 40 NM
274°-284° byd 40 NM blo 18,000'
285°-355° byd 40 NM