

**BARRE/MONTEPELIER****EDWARD F KNAPP STATE** (MPV)(KMPV) 3 W UTC-5(-4DT) N44°12.21' W72°33.73'**MONTRÉAL**

1166 B NOTAM FILE MPV MON Airport

H-11D, 12K, L-32G

**RWY 17-35:** H5000X100 (ASPH) S-31, D-70, 2S-88 MIRL

IAP

1.5% up S

**RWY 17:** MALSR. PAPI(P4L)—GA 3.0° TCH 46'. Trees.**RWY 35:** REIL. Thld dspcd 502'. Trees.**RWY 05-23:** H3001X75 (ASPH) S-30, D-46 MIRL 1.0% up SW**RWY 05:** Trees.**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** ACTIVATE MIRL Rwy 17-35 and MALSR Rwy 17—CTAF.**AIRPORT REMARKS:** Attended 1300-2200Z±. Fld condition report may not be avbl and/or current at ngt. Rwy conditions may not be monitored or reported when the arpt is unattended. 70' tree, 393' right of centerline and 1545' from Rwy 35 end. 50' tree, 332' left of centerline and 393' from Rwy 17 end. Cold temperature airport. Altitude correction required at or below -20C.**AIRPORT MANAGER:** 802-585-5586**WEATHER DATA SOURCES:** ASOS 132.675 (802) 229-2037.**COMMUNICATIONS:** CTAF/UNICOM 122.8**MONTEPELIER RCO** 122.2 (BURLINGTON RADIO)**MONTEPELIER RCO** 122.6 (BURLINGTON RADIO)Ⓡ **BOSTON CENTER APP/DEP CON** 135.7**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Boston ARTCC at 603-879-6859.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MPV.**MONTEPELIER (VL) (DH) VORW/DME** 116.9 MPV Chan 116 N44°05.13' W72°26.96' 342° 8.6 NM to fld. 2086/16W.

VOR unusable:

010°-020° byd 25 NM blo 7,500'

015°-031° byd 40 NM

032°-042° byd 40 NM blo 5,000'

032°-042° byd 65 NM

043°-060° byd 40 NM

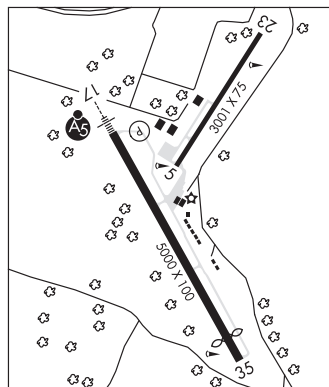
045°-060° byd 24 NM blo 8,500'

170°-182° byd 40 NM

210°-275° byd 40 NM

DME unusable:

045°-060° byd 24 NM blo 8,500'

**ILS/DME** 108.7 I-MPV Chan 24 Rwy 17. Class IA. DME unmonitored. Localizer unusable byd 28° right of course.**COMM/NAV/WEATHER REMARKS:** UNICOM base station not manned continuously.**BASIN HARBOR** (See VERGENNES on page 337)