

DARLINGTON CO (UDG)(KUDG) 9 N UTC-5(-4DT) N34°26.85' W79°53.19'

CHARLOTTE

192 B NOTAM FILE UDG

H-9C, 12G, L-24J, 25E, 36E

RWY 05-23: H5500X100 (CONC) S-17, D-27 PCN 6 F/C/Y/T MIRL

IAP

RWY 05: ODALS. REIL. PAPI(P2L)—GA 3.0° TCH 52'.

RWY 23: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

SERVICE: FUEL 100LL, JET A LGT ODALS Rwy 05; MIRL Rwy 05-23; and twy lgts preset low instst dusk-0400Z†; to incr instst—CTAF. Aft 0400Z†, ACTVT ODALS Rwy 05; REIL Rwy 05 and 23; PAPI Rwy 05 and 23; MIRL Rwy 05-23; and twy lgts—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1300-2200Z†. After hrs svc call 843-393-9928.

AIRPORT MANAGER: 843-393-9928

WEATHER DATA SOURCES: AWOS-3PT 119.925 (843) 393-8220.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ FLORENCE APP/DEP CON 118.6 (1130-0300Z†)

Ⓡ JAX CENTER APP/DEP CON 133.45 (0300-1130Z†)

CLNC DEL 118.55

CLEARANCE DELIVERY PHONE: For CD ctc Florence Apch at 843-665-0632, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE FLO.

FLORENCE (H) (H) VORTACW 115.2 FLO Chan 99 N34°13.98'

W79°39.43' 322° 17.2 NM to fld. 104/3W.

TACAN AZIMUTH unusable:

200°-025° byd 30 NM blo 4,000'

VOR unusable:

089°-125° byd 30 NM blo 3,000'

126°-194° byd 10 NM

195°-223° byd 10 NM blo 4,000'


219°-229° byd 25 NM blo 13,000'

345°-360° byd 10 NM

DME unusable:

200°-025° byd 30 NM blo 4,000'

NDB (MHW) 245 UDG N34°26.59' W79°53.24' at fld. 184/6W. NOTAM FILE UDG. NDB unmonitored.

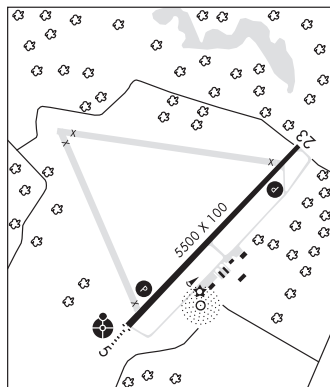

DILLON CO (DLC)(KDLC) 3 N UTC-5(-4DT) N34°26.94' W79°22.12'

CHARLOTTE

133 B NOTAM FILE AND

L-24J, 35A, 36E

RWY 07-25: H3000X60 (ASPH-AFSC) S-10 MIRL 0.5% up W

IAP

RWY 07: Pole.

RWY 25: Tree.

AIRPORT REMARKS: Unattended.

AIRPORT MANAGER: 843-845-8529

COMMUNICATIONS: CTAF 122.9

FLORENCE APP/DEP CON 118.6 (1130-0300Z†)

JAX CENTER APP/DEP CON 133.45 (0300-1130Z†)

CLEARANCE DELIVERY PHONE: For CD ctc Florence Apch at 843-665-0632, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE FLO.

FLORENCE (H) (H) VORTACW 115.2 FLO Chan 99 N34°13.98'

W79°39.43' 051° 19.3 NM to fld. 104/3W.

TACAN AZIMUTH unusable:

200°-025° byd 30 NM blo 4,000'

VOR unusable:

089°-125° byd 30 NM blo 3,000'

126°-194° byd 10 NM

195°-223° byd 10 NM blo 4,000'

219°-229° byd 25 NM blo 13,000'

345°-360° byd 10 NM

DME unusable:

200°-025° byd 30 NM blo 4,000'

NDB (MHW) 274 DLC N34°27.01' W79°22.13' at fld. 122/9W. NOTAM FILE AND.

NDB unusable:

Byd 18 NM



DONALDSON FLD (See GREENVILLE on page 397)

DORCHESTER CO N33°03.69' W80°16.63' NOTAM FILE AND.

CHARLOTTE

NDB (MHW) 365 DYB at Summerville. 49/7W.

L-24I