

YAKUTAT SPB (2Y3) 1 NW UTC-9(-8DT) N59°34.66' W139°45.00'

JUNEAU

00 NOTAM FILE JNU

WATERWAY NE-SW: 7500X2000 (WATER)**WATERWAY NW-SE:** 7500X2000 (WATER)**SEAPLANE REMARKS:** Unattended. Report presence of boats to Harbormaster 907-784-3323. Boats may be tied to SPB dock/float ramp. Prevailing winds from west May to Aug and southeast from Sep to May.**AIRPORT MANAGER:** 907-784-3323**COMMUNICATIONS:** CTAF 123.6**RADIO AIDS TO NAVIGATION:** NOTAM FILE YAK.

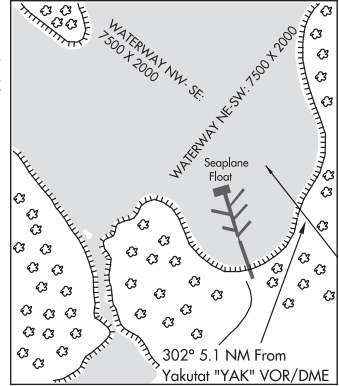
(H) (H) VOR/DME 113.3 YAK Chan 80 N59°30.65' W139°38.89' 302° 5.1 NM to fld. 41/20E.

VOR unusable:

124°-261° byd 22 NM blo 10,000'

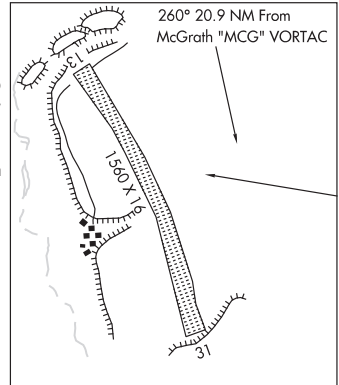
DME unusable:

124°-261° byd 22 NM blo 10,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.**YANKEE CREEK 2** (A77) 1 S UTC-9(-8DT) N63°00.11' W156°22.04'

MC GRATH

1120 NOTAM FILE ENA

RWY 13-31: 1560X16 (TURF-DIRT)**RWY 13:** Trees.**RWY 31:** Trees. Rgt tfc.**AIRPORT REMARKS:** Unattended. Sharp right turn rqr'd aft downhill dep due to mountain immediately NW of rwy. Be alert: avoid using rwys especially in windy conditions. Rwy 13-31 width narrows to 7 ft due to trees and brush encroachment. Rwy 13-31 narrow, soft spongy, rutted and not maintained. Brush up to 6 ft high growing along the full length and width of rwy. No visual sight btn rwy ends because of 10 deg dogleg. Rwy slopes downhill frn SE to NW at a 15:1 slope.**AIRPORT MANAGER:** 907-524-3640**COMMUNICATIONS:** CTAF 122.9**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.**YESS BAY LODGE SPB** (78K) 0 N UTC-9(-8DT) N55°54.98' W131°48.07'

KETCHIKAN

00 NOTAM FILE KTN

WATERWAY E-W: 5000X2000 (WATER)**SEAPLANE REMARKS:** Summer ops, boats tied at float. Stream current acft tax. CTN: Logs and debris in water; reef and islands middle of inlet.**AIRPORT MANAGER:** 907-225-7906**COMMUNICATIONS:** CTAF 122.9**COMM/NAV/WEATHER REMARKS:** For a LC to Ketchikan FSS dial 225-9481. For a LC to Juneau FSS dial 789-7380.