

**SODA SPRINGS****ALLEN H TIGERT** (U78) 1 SE UTC-7(-6DT) N42°38.91' W111°34.91'

SALT LAKE CITY

5843 B NOTAM FILE BOI

L-11D

**RWY 16-34:** H3500X50 (ASPH) S-12 LIRL(NSTD) 0.3% up S**RWY 16:** TRCV(TRIL). Road.**RWY 34:** TRCV(TRIL).**RWY 13-31:** H2500X50 (ASPH) 0.4% up SE**RWY 13:** Pole.**RWY 31:** P-line.**SERVICE: FUEL** 100LL **LGT** Rwy 16 and Rwy 34 tri color VASI OTS indefly. Rwy 16-34 NSTD LIRL first 300' Rwy 16 not lgtd. All rwy lgts OTS indefly. Rotg bcn OTS indef.**AIRPORT REMARKS:** Unattended. Call 208-547-2600 or 208-221-4494 for svc. Day VFR only. Sharply dsndg trrm near end of Rwy 31 and Rwy 34. Rwy 16 dthr 300 ft at night. Nmrs obstns on apch to Rws 13 and 16. Rwy 13-31 is very poor, full of old & untreated cracks, grass growing through them, has no markings, and many areas where the top layer of asph is flaking off. Rwy 16-34 is in rough shape: very poor marks, untreated cracks, rough & exposed aggregate asph. Rwy 16 no marks—paint is all gone. Rwy 34 rwy nrs are very dfclt to see—paint is 90% gone.**AIRPORT MANAGER:** 208-547-2600**COMMUNICATIONS: CTAF/UNICOM** 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MLD.**MALAD CITY (VH) (DH) VORW/DME** 117.4 MLD Chan 121 N42°11.99' W112°27.07' 038° 47.1 NM to fld. 7330/17E.

VOR unusable:

009°-018° byd 40 NM

019°-029° byd 40 NM blo 15,000'

019°-029° byd 68 NM

030°-035° byd 40 NM

055°-068° byd 40 NM blo 18,000'

094°-104° byd 40 NM

157°-167° byd 25 NM blo 11,000'

244°-247° byd 40 NM

257°-259° byd 40 NM

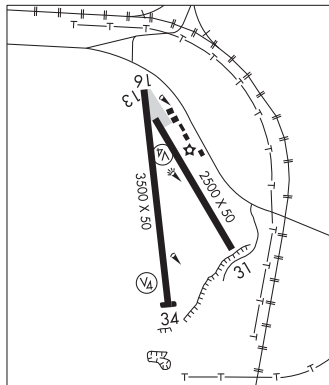
301°-305° byd 40 NM

313°-319° byd 40 NM

DME unusable:

005°-025° byd 30 NM blo 14,000'

157°-167° byd 25 NM blo 11,000'

**SOLDIER BAR USFS** (85U) 1 SW UTC-7(-6DT) N45°05.99' W114°48.06'

GREAT FALLS

4190 NOTAM FILE BOI

**RWY 07-25:** 1650X15 (DIRT)**RWY 07:** Trees.**RWY 25:** Hill.**AIRPORT REMARKS:** Unattended. No telephone avbl at arpt. Steep canyon walls in all directions. Cabin Creek arpt aprx 7 miles west up Big Creek Canyon. Arpt on bench 500' abv Big Creek on south side. West 1/3 of rwy has 4° slope down to the north. Go-arounds not recommended. Rwy 07-25 sharp dogleg on west 1/3 of rwy to the north. Land Rwy 25, tkf Rwy 07. Rwy 07-25 has two big humps armd the mid-fld & to the W of it.**AIRPORT MANAGER:** 208-634-0746**COMMUNICATIONS: CTAF** 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.**STANFORD FLD** (See ST ANTHONY on page 82)