TEXAS 407

## PORT LAVACA

**CALHOUN CO** (PKV)(KPKV) 3 NW UTC-6(-5DT) N28°39.20′ W96°40.96′

HOUSTON H-7C, L-20I, 21A, GOMW

32 B NOTAM FILE PKV

RWY 14-32: H5004X75 (ASPH) S-26 MIRL

RWY 14: PAPI(P2L)—GA 3.0° TCH 45', Road.

RWY 32: PAPI(P2L)—GA 3.0° TCH 45', Road, Rgt tfc.

RWY 05-23: 2432X60 (TURF)

RWY 05: Tree

RWY 23: Thid dsplcd 428'.

SERVICE: S4 FUEL 100LL, JET A LGT ACTVT MIRL Rwy 14–32—CTAF. AIRPORT REMARKS: Attended 1400–2300Z‡. 100LL and Jet A avbl 24 hrs self serve. Jet A also avbl by truck. RC model acft opr at Rwy 05 end. AIRPORT MANAGER: 361-552-1228


WEATHER DATA SOURCES: AWOS-3 118.275 (361) 552-3060.

COMMUNICATIONS: CTAF/UNICOM 122.8

RHOUSTON CENTER APP/DEP CON 135.05

CLEARANCE DELIVERY PHONE: For CD ctc Houston ARTCC at 281-230-5622.
RADIO AIDS TO NAVIGATION: NOTAM FILE PSX.

**PALACIOS (VH) (H) VORTACW** 117.3 PSX Chan 120 N28°45.87′ W96°18.37′ 244° 20.9 NM to fld. 16/8E.

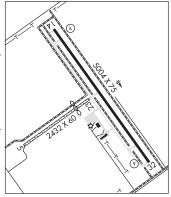

## PORT MANSFIELD

CHARLES R JOHNSON (TØ5) 1 NW UTC-6(-5DT) N26°33.61′ W97°26.36′

BROWNSVILLE

L-20H, 21A

BROWNSVILLE

RWY 12-30: H3200X50 (ASPH) S-21 MIRL

RWY 12: P-line.

RWY 30: P-line.

SERVICE: LGT MIRL Rwy 12-30 preset low intst; to increase intst ACTVT—CTAF.

AIRPORT REMARKS: Unattended. Harbor superintendent's ofc attended 1400–2250Z‡. Deer & birds on & invof arpt. Rwy 12 and Rwy 30 rwy mkgs discolored. Fee for ovnght tie down.

AIRPORT MANAGER: 956-944-2325

COMMUNICATIONS: CTAF 122.9

10 B NOTAM FILE SJT

CLEARANCE DELIVERY PHONE: For CD ctc Corpus Christi Apch at 361-299-4230.

RADIO AIDS TO NAVIGATION: NOTAM FILE HRL.

HARLINGEN (VL) (DH) VORW/DME 113.65 HRL Chan 83(Y) N26°13.75′ W97°39.14′ 025° 22.9 NM to fld. 32/5E.

## **PORTLAND**

HUNT (9R5) 2 NW UTC-6(-5DT) N27°53.20′ W97°20.98′

40 NOTAM FILE SJT

RWY 14L-32R: H2650X20 (ASPH) S-9 0.6% up NW

RWY 14L: P-line. Rgt tfc.

RWY 32R: Brush.

RWY 14R-32L: 1400X60 (TURF-GRVL)

RWY 14R: Rgt tfc.

NOISE: Noise abatement procedures in effect. Call arpt manager at 361-643-3950.

AIRPORT REMARKS: Unattended. Rwy 14R-32L CLOSED indef. Wind turbines N of arpt. Rwy 14L-32R has severe grass encroachment, pot holes, and loose gravel on rwy. Rwy 14R-32L heavy rutting along entire rwy length. Rwy 14L-32R limited line of sight between thlds; southern 600' of rwy drops off approximately 8'. Rwy 32R ground drops off approximately 10' at thld.

AIRPORT MANAGER: 361-643-3950 COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Corpus Christi Apch at 361-299-4230.

POSSUM KINGDOM (See GRAFORD on page 327)

SC, 20 FEB 2025 to 17 APR 2025