

HELENA RGNL (HLN)(KHLN) P (ARNG) 2 NE UTC-7(-6DT) N46°36.40' W111°59.00'

3877 B LRA ARFF Index—See Remarks NOTAM FILE HLN MON Airport

GREAT FALLS

H-1D, L-13C

IAP, DIAP, AD

Rwy 09-27: H9000X150 (ASPH-PFC) D-160, 2S-175, 2D-250,

2D/2D2-420 PCR 790 F/D/X/T HIRL

Rwy 09: REIL. PAPI(P4L)—GA 3.3° TCH 55'. Ground. 0.3% down.

Rwy 27: MALSR, PAPI(P4L)—GA 3.0° TCH 55'. Rgt tfc.

Rwy 05-23: H4644X75 (ASPH-PFC) S-21, D-30 PCR 300 F/D/X/T

MIRL 1.2% up SW

Rwy 05: PAPI(P2L)—GA 3.0° TCH 40'. Road.

Rwy 23: PAPI(P2L)—GA 3.0° TCH 49'. Fence. Rgt tfc.

Rwy 17-35: H2989X75 (ASPH-PFC) PCR 460 F/D/X/T MIRL

1.7% up SE

Rwy 17: REIL.

Rwy 35: REIL. Ground. Rgt tfc.

Rwy 10-28: 1584X75 (TURF) 0.3% up W

RUNWAY DECLARED DISTANCE INFORMATION

Rwy 05: TORA-4644 TODA-4644 ASDA-4644 LDA-4644

Rwy 09: TORA-9000 TODA-9000 ASDA-9000 LDA-9000

Rwy 17: TORA-2989 TODA-2989 ASDA-2989 LDA-2989

Rwy 23: TORA-4644 TODA-4644 ASDA-4644 LDA-4644

Rwy 27: TORA-9000 TODA-9000 ASDA-9000 LDA-9000

Rwy 35: TORA-2989 TODA-2989 ASDA-2989 LDA-2989

SERVICE: S4 **FUEL** 100, 100LL, JET A **OX** 1, 3 **LGT** When ATCT clsd **ACTIVATE** MALSR Rwy 27, REIL Rwy 09, Rwy 17 and Rwy 35, PAPI Rwy 09 and Rwy 27; HIRL Rwy 09-27; MIRL Rwy 05-23 and Rwy 17-35—CTAF. **MILITARY—FUEL** Svc—(406)442-2190

AIRPORT REMARKS: Attended 1200-0800Z†. Cold temperature airport. Altitude correction required at or below -17C. Rwy 05-23 and Rwy 17-35 exc btn Twy F and Rwy 09-27 not avbl to acf grt than 30 pax seats. Twy A, Twy B, and Twy C btn Twy A and Rwy 35 not avbl for acf grt than 30 pax seats. Class I, ARFF Index B. ARFF pvdd for sked Part 121 acf; otrw prior apvl rqrđ—amgr. Landing Rights Arpt (LRA): Cust—(406)-449-5506. Lndg fee grt than 10,000 lbs. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notice.

MILITARY REMARKS: ARNG Ops Mon-Fri 1400-0030Z† Mon-Fri, exc hol. Ctn durg tax; AASF ramp not stressed for large acft. Ramp advsy—126.2, D406-324-5775, C406-324-5775. Tsnt svc NA aft 2300Z† Mon-Fri, wkend and hol. Ft Harrison AAF wi Class D; Paja—MT ARNG Ops C406-324-5775/76, D324-5775/76.

AIRPORT MANAGER: 406-442-2821

WEATHER DATA SOURCES: ASOS 120.4 (406) 290-3397.

COMMUNICATIONS: CTAF 118.3 ATIS 120.4 UNICOM 122.95

RCO 122.2 (GREAT FALLS RADIO)

® **APP/DEP CON** 119.5 229.4 (1300-0500Z†)


® **SALT LAKE CENTER APP/DEP CON** 133.4 285.4 (0500-1300Z†)

TOWER 118.3 257.8 (1300-0500Z†) **GND CON** 121.9

ARNG OPS 40.65 126.2 321.45

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.

AIRSPACE: CLASS D svc 1300-0500Z†; other times CLASS E.

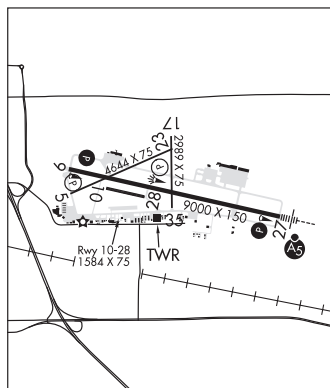

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE HLN.

(VH) (H) VORTACW 117.7 HLN Chan 124 N46°36.41' W111°57.21' 258° 1.2 NM to fld. 3826/12E.

VOR unusable:

039°-054° byd 35 NM blo 12,000'
 074°-084° byd 40 NM blo 28,000'
 086°-090° byd 40 NM
 091°-101° byd 40 NM blo 18,000'
 102°-108° byd 47 NM
 102°-108° byd 40 NM blo 10,800'
 109°-169° byd 25 NM blo 17,000'
 166°-258° byd 40 NM
 169°-189° byd 25 NM blo 13,500'
 189°-234° byd 25 NM blo 13,500'
 207°-217° byd 22 NM blo 13,000'
 234°-274° byd 25 NM blo 12,500'
 259°-263° byd 40 NM blo 13,000'
 259°-279° byd 60 NM blo 18,000'
 259°-279° byd 65 NM blo 28,000'
 280°-293° byd 40 NM
 294°-304° byd 87 NM
 298°-308° byd 40 NM blo 15,500'
 309°-334° byd 40 NM
 335°-345° byd 40 NM blo 9,500'
 335°-345° byd 56 NM

TACAN AZIMUTH unusable:

039°-074° byd 35 NM blo 13,000'
 109°-154° byd 15 NM
 154°-169° byd 15 NM blo 17,000'
 169°-189° byd 25 NM blo 13,500'
 189°-214° byd 15 NM
 204°-354° byd 25 blo 14,000'
 214°-254° byd 15 NM blo 17,500'
 324°-039° byd 25 NM blo 13,000'

DME unusable:

035°-070° byd 35 NM blo 13,000'
 105°-210° byd 25 NM
 109°-154° byd 25 NM
 109°-214° byd 15 NM blo 11,000'
 109°-214° byd 20 NM blo 12,000'
 154°-169° byd 25 NM blo 17,000'
 165°-185° byd 25 NM blo 13,500'
 189°-214° byd 25 NM
 207°-217° 22 NM blo 13,000'
 214°-254° byd 15 NM blo 12,000'
 214°-254° byd 25 NM blo 17,000'
 250°-300° byd 25 NM blo 14,000'
 320°-035° byd 25 NM blo 13,000'

VOR unusable:

360°-069° byd 40 NM
 342°-359° byd 40 NM

HAUSER NDB (MHW) 386 HAU N46°34.13' W111°45.48' 272° 9.6 NM to fld. 4026/12E. NDB unmonitored when HLN ATCT clsd.

ILS 110.1 I-HLN Rwy 27. Class IE. Unmonitored when ATCT closed. Localizer backcourse unusable byd 22° rgt of course, unusable within 2.7 DME.

HELLER FARM (See WINIFRED on page 151)

HINSDALE (6U5) 0 SE UTC-7(-6DT) N48°23.28' W107°05.00'**BILLINGS**

2220 NOTAM FILE GTF

RWY 07-25: 2200X75 (TURF) 0.7% up W

RWY 07: Road.

RWY 10-28: 2160X200 (TURF) 0.3% up W

RWY 10: Road.

RWY 16-34: 1960X75 (TURF) 1.5% up S

RWY 16: Pole.

RWY 34: Pole.

AIRPORT REMARKS: Unattended. Hay bales and farm equipment adjacent to rwy. Rws soft when wet. Rwy 07-25, Rwy 10-28 and Rwy 16-34 marked with white cones full length of rwy.

AIRPORT MANAGER: 406-228-2719

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.
