

DURANGO—LA PLATA CO (DRO)(KDRO) 10 SE UTC-7(-6DT) N37°09.09' W107°45.23'

6689 B Class I, ARFF Index B NOTAM FILE DRO

DENVER
H-4K, L-8I, 9E
IAP

RWY 03-21: H9201X150 (ASPH-GRVD) S-95, D-150, 2S-175,

2D-210 PCR 880 F/D/X/T HIRL

RWY 03: MALSR. PAPI(P4L)—GA 3.0° TCH 55'. 0.8% up.

RWY 21: REIL. PAPI(P4L)—GA 3.0° TCH 51'. 0.7% down.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 03: TORA-9201 TODA-9201 ASDA-9201 LDA-9201

RWY 21: TORA-9201 TODA-9201 ASDA-9201 LDA-9201

SERVICE: S4 FUEL 100LL, JET A OX 4 LGT MALSR Rwy 03; REIL Rwy 21; HIRL Rwy 03-21 oper on photocell; incr/decr instst—CTAF. PAPI Rwy 03 and Rwy 21 on consly; incr/decr instst—CTAF.

AIRPORT REMARKS: Attended 1100-0700Z†. Aft hr—970-259-7400.

ARFF coverage prvd durg acf tfc ops; otr times 24 hr PPR—arpt ops 970-759-4342. PPR for unskd acf ops with more than 30 pax seats—arpt ops 970-759-4342. HOP on and invof arpt. Cond unmon at ngt aft last acf arr until 1100Z†; see NOTAMS. Lndg fee applicable.

AIRPORT MANAGER: (970) 382-6051

WEATHER DATA SOURCES: ASOS 120.625 (970) 259-3579.

COMMUNICATIONS: CTAF/UNICOM 122.8

RCO 122.2 (DENVER RADIO)

RCO 122.6 (DENVER RADIO)

® **DENVER CENTER APP/DEP CON** 118.575

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC on freq. If una, ctc FSS on freq via rco. If una, ctc Denver ARTCC at 303-651-4257.

AIRSPACE: CLASS E svc 1300-0300Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DRO.

(VL) (DH) VORW/DME 116.55 DRO Chan 112(Y) N37°09.20' W107°44.98' at fld. 6662/14E.

VOR unusable:

004°-014° byd 40 NM blo 16,500'

004°-014° byd 50 NM

015°-070° byd 40 NM

131°-190° byd 40 NM

220°-225° byd 40 NM

250°-003° byd 40 NM

290°-310° byd 15 NM blo 17,000'


DME unusable:

070°-090° byd 30 NM blo 12,500'

140°-185° byd 25 NM blo 13,000'

290°-310° byd 15 NM blo 17,000'

ILS 109.1 I-DRO Rwy 03. Class I E.

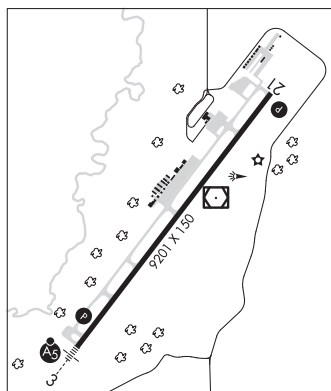

EADS MUNI (9V7) 1 W UTC-7(-6DT) N38°28.51' W102°48.65'

4245 NOTAM FILE DEN

WICHITA
L-10G

RWY 17-35: H3860X60 (ASPH) MIRL

RWY 17: Road.

RWY 35: Road.

AIRPORT REMARKS: Unattended. Be alert; intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 17 +25 ft bldgs 300 ft right of centerline 108 ft from rwy end. Rwy 17 has +25 ft railroad 530 ft from thld centerline. Apron area is asph. Twy and rwy have no mrkgs. Rwy 17-35 cntrln has a lrg crack full len of rwy. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-931-3761

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (VH) (DH) VORW/DME 116.9 LAA Chan 116 N38°11.83'

W102°41.25' 329° 17.7 NM to fld. 3944/12E.

