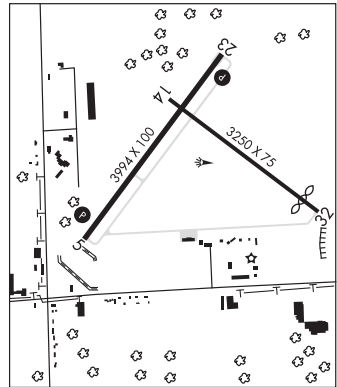


MALONE-DUFORT (MAL)(KMAL) 2 W UTC-5(-4DT) N44°51.22' W74°19.74'**MONTREAL**

790 B NOTAM FILE BTV

L-32G**RWY 05-23:** H3994X100 (ASPH) S-20 MIRL 0.4% up SW**RWY 05:** REIL. PAPI(P2L)—GA 3.15° TCH 42'. Trees.**RWY 23:** REIL. PAPI(P2L)—GA 3.0° TCH 43'. Trees.**RWY 14-32:** H3250X75 (ASPH) S-12.5 MIRL 0.9% up SE**RWY 14:** Trees.**RWY 32:** Thld dspclcd 348'. Tree.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-3994 TODA-3994 ASDA-3994 LDA-3994**RWY 14:** TORA-3250 TODA-3250 ASDA-3250 LDA-3250**RWY 23:** TORA-3994 TODA-3994 ASDA-3994 LDA-3994**RWY 32:** TORA-3250 TODA-3250 ASDA-3250 LDA-2902**SERVICE:** FUEL 100LL LGT ACTIVATE PAPI Rwy 05 and Rwy 23, MIRL

Rwy 05-23, Rwy 14-32 and twy lgts—CTAF.

AIRPORT REMARKS: Airport not attended. Rwy 14-32 has snow removal but visual inspection and NOTAM check must be done as town roads are plowed before arpt. Haying activity and equipment present Jun-Sept.**AIRPORT MANAGER:** (518) 483-4740**WEATHER DATA SOURCES:** AWOS-AV 122.8 (518) 651-2601.**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **BOSTON CENTER APP/DEP CON** 135.25**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MSS.**MASSENA (H) TACAN** Chan 88 MSS (114.1) N44°54.87' W74°43.36' 116° 17.2 NM to fld. 198/14W.**MARCY FLD** (See KEENE on page 214)**MASSENA INTL-RICHARDS FLD** (MSS)(KMSS) 2 E UTC-5(-4DT) N44°56.17' W74°50.71'**MONTREAL**

222 B AOE ARFF Index—See Remarks NOTAM FILE MSS

H-11C, 12K, L-32G**RWY 05-23:** H5601X100 (ASPH-GRVD) S-30, D-50, 2D-76**IAP**

PCR 360 F/D/X/T HIRL 0.3% up NE

RWY 05: REIL. PAPI(P4L)—GA 3.0° TCH 55'. Pole.**RWY 23:** PAPI(P4L)—GA 3.0° TCH 43'.**RWY 09-27:** H4000X100 (ASPH-GRVD) S-30, D-50, 2D-76

PCR 343 F/D/X/T MIRL

RWY 09: REIL. Trees.**RWY 27:** REIL. PAPI(P4L)—GA 3.0° TCH 35'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-5601 TODA-5601 ASDA-5601 LDA-5601**RWY 09:** TORA-4000 TODA-4000 ASDA-4000 LDA-4000**RWY 23:** TORA-5601 TODA-5601 ASDA-5601 LDA-5601**RWY 27:** TORA-4000 TODA-4000 ASDA-4000 LDA-4000**SERVICE:** S1 FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 05, Rwy

09 and Rwy 27, PAPI Rwy 23 and Rwy 27, HIRL Rwy 05-23, MIRL

Rwy 09-27 and twy lgts—CTAF. PAPI Rwy 05 opr consly.

AIRPORT REMARKS: Attended Mon-Fri 0900-2200Z†. Sat-Sun

1200-1300Z†. Birds and deer on and infov arpt. Frequent

concentration of seagulls and Canada geese on and infov arpt

particularly during poor wx periods. Class II, ARFF Index A. Index A

coverage avbl durg atndc hrs. For emergs outside of atndc hrs, call St Lawrence emerg svc at 911. PPR 24 hrs for air

carrier ops with more than 30 passenger seats, call arpt manager 315-769-7605. 421' lgtd/marked twr 6000' south


of arpt. Rwy conditions reported during normal hrs of ops. Caution NVD ops conducted periodically in arpt tfc pattern area.

Mil hel training on and infov arpt. Rwy 05 first 50 ft not grvd. Rwy 09 first 50 ft not grvd. Rwy 27 first 50 ft not grvd.

Overnight acft parking avbl at terminal apron. After attendance hrs vehicle and pedestrian access to FBO apron and hangar

only avbl with key card for automatic gate. Commuter acft secure area clsd to general aviation acft clearing customs.

Parking avbl to right of terminal bldg. Flight Notification Service (ADCUS) avbl. Ldg fee.

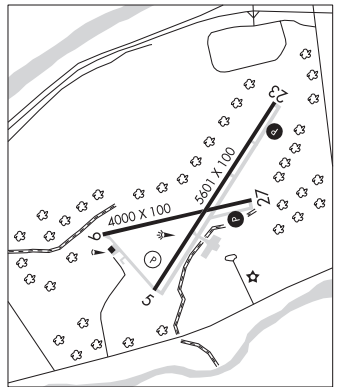

CONTINUED ON NEXT PAGE

NEW YORK

CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: 315-769-7605

WEATHER DATA SOURCES: ASOS 128.075 (315) 764-0481.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.2 (BURLINGTON RADIO)

® **BOSTON CENTER APP/DEP CON** 135.25

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Boston ARTCC at 603-879-6859 .

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE MSS.

(H) TACAN Chan 88 MSS (114.1) N44°54.87' W74°43.36' 298° 5.4 NM to fld. 198/14W.

MISSE NDB (LOWW) 278 MS N44°51.25' W74°54.95' 045° 5.8 NM to fld. 245/14W.

ILS 108.7 I-MSS Rwy 05. Class IE. LOM MISSE NDB. LOM unmonitored.

MATTITUCK (21N) 1 SE UTC-5(-4DT) N40°59.22' W72°31.15'

**NEW YORK
COPTER**

30 NOTAM FILE ISP

RWY 01-19: H2200X60 (ASPH)

RWY 01: Trees.

RWY 19: Trees.

AIRPORT REMARKS: Unattended. Call amgr for pmsn to Ind. Deer on and invof arpt. All training ops, tkf and ldg practice and ngt ops are prohibited. Rwy 19, extensive pavement rutting at centerline, 240'-350' from thld. Segmented circle has no tfc pat indicator.

AIRPORT MANAGER: 631-445-4348

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc New York Apch at 516-683-2449.

MAYVILLE

DART (D79) 2 E UTC-5(-4DT) N42°16.09' W79°28.90'

DETROIT

1330 TPA-2130(800) NOTAM FILE BUF

RWY 10-28: 3800X60 (TURF)

RWY 10: Trees.

RWY 28: Hangar.

RWY 13-31: 2750X60 (TURF)

RWY 13: P-line.

RWY 31: Pole.

RWY 06-24: 1840X80 (TURF)

RWY 06: Trees.

RWY 24: Tree.

AIRPORT REMARKS: Attended dalgt hours. Extensive glider ops on and invof arpt. Ultralight activity on and invof arpt.

AIRPORT MANAGER: 716-753-6711

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Buffalo Apch at 716-626-6920, when Apch clsd ctc Cleveland ARTCC at 440-774-0232.

MIDDLESEX VALLEY (4N2) 1 NW UTC-5(-4DT) N42°42.84' W77°16.32'

DETROIT

770 NOTAM FILE BUF

RWY 03-21: 2130X175 (TURF) 2.1% up NE

RWY 03: Brush.

RWY 21: Tree.

SERVICE: S2

AIRPORT REMARKS: Attended SR-SS. Rwy 03-21 not plowed in winter. Call arpt manager for fld condition 585-465-3926.

AIRPORT MANAGER: (585) 465-3926

COMMUNICATIONS: CTAF/UNICOM 122.7

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.