

**TALIHINA MUNI** (6F1) 3 SW UTC-6(-5DT) N34°42.47' W95°04.43'

DALLAS-FT WORTH

687 B NOTAM FILE MLC

L-17D

RWY 01-19: H3300X60 (ASPH) S-12 MIRL

RWY 01: Trees.

SERVICE: LGT ACTVT MIRL Rwy 01-19-CTAF. ACTVT WDI lights-CTAF.

AIRPORT REMARKS: Unattended.

AIRPORT MANAGER: (918) 413-2088

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLC.

RICH MOUNTAIN (VL) (L) VORTACW 113.5 PGO Chan 82

N34°40.83' W94°36.54' 270° 23.1 NM to fld. 2700/4E.

VOR unusable:

016°-021° byd 40 NM

028°-029° byd 40 NM

030°-040°

050°-075° blo 4,000'

090°-145°

167°-169° byd 40 NM

170°-200°

235°-245° byd 30 NM blo 5,000'

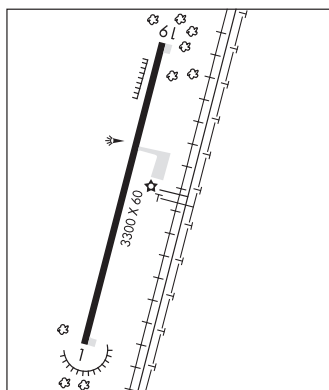
250°-271°

260°-280° byd 35 NM blo 5,000'

329°-335° byd 40 NM

340°-345° blo 5,000'

358°-002° byd 40 NM

**TENKILLER LAKE AIRPARK** (See COOKSON on page 210)**TEXOMA MUNI** (K49) 1 W UTC-6(-5DT) N36°30.34' W101°48.82'

WICHITA

3468 NOTAM FILE MLC

L-15B

RWY 03-21: H3564X48 (ASPH)

RWY 03: Thld dsplcd 590'. Road.

RWY 21: Thld dsplcd 340'. Fence.

RWY 17-35: 2340X75 (TURF)

RWY 17: Fence.

RWY 35: Road.

AIRPORT REMARKS: Unattended. Ultralight act on &amp; invof arpt. Wind turbines 350 ft AGL lctd 2 mi south of arpt. Rwy 17-35 fairly smooth, few rodent mounds, several patches of cactus.

AIRPORT MANAGER: 806-753-6567

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE DHT.

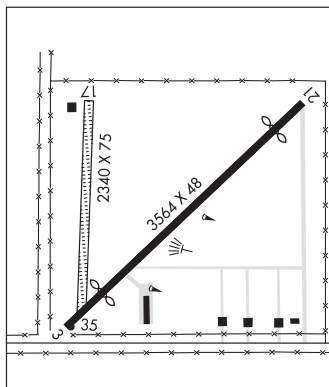
DALHART (L) (L) VORTACW 112.0 DHT Chan 57 N36°05.49'

W102°32.68' 043° 43.3 NM to fld. 4020/12E.

TAC AZM unusable:

240°-255° byd 15 NM

320°-350° byd 15 NM

**TEXOMA** N33°56.65' W96°23.51' NOTAM FILE DUA.

DALLAS-FT. WORTH

(L) DME 114.3 URH Chan 90 at Durant Rgnl/Eaker Fld. 682.

H-6H, L-17D

DME unusable:

207°-240° byd 35 NM blo 2,500'

335°-350° byd 35 NM blo 2,500'