

LAMAR

SOUTHEAST COLORADO RGNL (LAA)(KLA) 3 SW UTC-7(-6DT) N38°04.18' W102°41.31'

WICHITA
H-5A, L-10G
IAP

3705 B NOTAM FILE LAA MON Airport
RWY 18-36: H6304X100 (CONC-GRVD) S-45, D-55, 2D-100
PCN 12 R/B/W/U MIRL 0.4% up S

RWY 18: REIL. VASI(V4L)—GA 3.0° TCH 45'. Road.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 44'. Hill.

RWY 08-26: H5001X60 (ASPH-AFSC) S-35, D-50, 2D-95 MIRL

RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 29'. Road.

RWY 26: REIL. PAPI(P2L)—GA 3.0° TCH 30'.

SERVICE: S4 FUEL 100LL, JET A OX 2, 4 LGT ACTVT and incr intst
REIL Rwy 08 and 26, Rwy 18 and 36; PAPI Rwy 08 and 26, Rwy 36;
VASI Rwy 18; MIRL Rwy 08-26, 18-36; twy lgts—CTAF. All lgts
preset med intst.

AIRPORT REMARKS: Attended 1500-0000Z. For svc after hrs phone
719-336-7701. 100LL avbl H24 self svc. Be alert; intensive USAF
student training in vicinity Colorado Springs and Pueblo Colorado.
Tower 500' AGL 4.5 mile SE unlighted. NOTE: See Special
Notices—Aerobatic Operations in Colorado. USAF 306 FTG Flight
Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-336-2002

WEATHER DATA SOURCES: ASOS 135.625 (719) 931-8759.


COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ DENVER CENTER APP/DEP CON 133.4

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (VH) (DH) VORW/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 168° 7.6 NM to fld. 3944/12E.

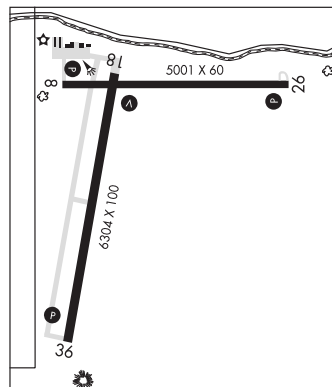

LAS ANIMAS

CITY OF LAS ANIMAS – BENT CO (7V9) 1 S UTC-7(-6DT) N38°03.24' W103°14.31'

WICHITA
L-10F

3915 NOTAM FILE DEN

RWY 08-26: H3870X40 (ASPH) S-5 HIRL 0.4% up W

RWY 08: REIL. Tree.

RWY 26: REIL. Road.

SERVICE: LGT ACTVT HIRL Rwy 08-26—CTAF. Med intst 5 clicks, high intst 7 clicks. Rwy 08 and 26 REILS OTS.

AIRPORT REMARKS: Unattended. Be alert; intensive USAF student training in vicinity Colorado Springs and Pueblo Colorado. Rwy
26 has +30' poles 105' from thld 210' left of extd rwy centerline. Rwy 08-26 has trees growing 50+ ft fm either side
of rwy cntrn. Thld lgts NSTD; three lgts each end. Thld lgts OTS indef. Rwy 08 thld lgts 23' from thld. Rwy 26 thld lgts
12' from thld. Rwy 08 has +4' fence 275' from thld obstruction, has -3' ditch 35' from rwy end on both sides. Rwy
08-26 numbers smaller than standard. Rwy 08 thld markings worn and unrdbl. See Special Notices—USAF 306 FTG
Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-662-1225

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (VH) (DH) VORW/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 240° 27.5 NM to fld. 3944/12E.

LEACH (See CENTER on page 333)