
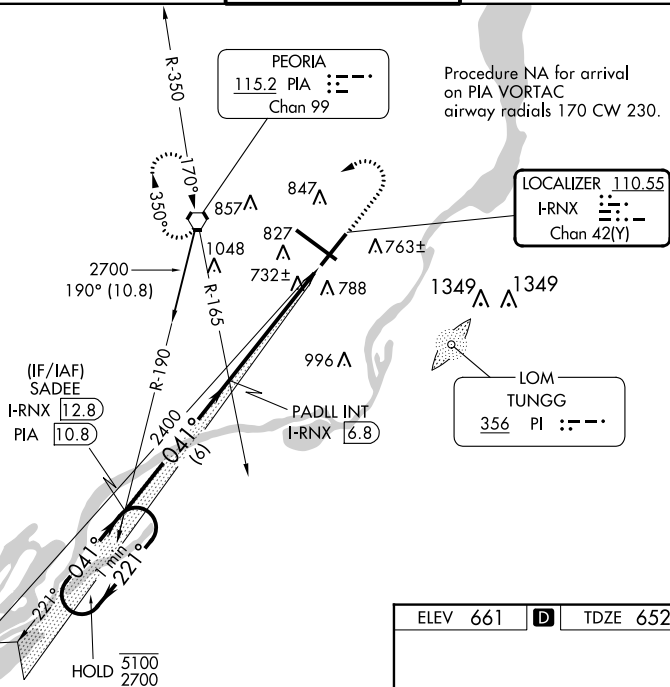


23334


ILS RWY 4 (SA CAT I & II)
GENERAL DOWNING-PEORIA INTL(PIA)

MISSED APPROACH: Climb to 1500 then climbing left turn to 2700 direct PIA VORTAC and hold, continue climb-in-hold to 2700.

Diagram illustrating the Peoria VORTAC procedure. The diagram shows the approach path, including the alternate missed approach fix (TUNGG PI 356) and the final approach fix (PEORIA 115.2 PIA Chan 99). The procedure is for arrival on PIA VORTAC airway radials 170 CW 230.

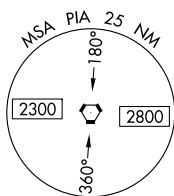


ELEV 661	D	TDZE 652
----------	----------	----------

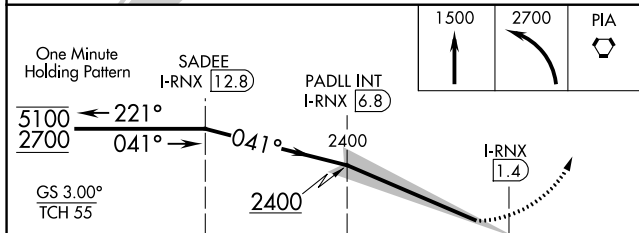

		6 NM	5.4 NM	1027
CATEGORY	A	B	C	D
S-ILS 4	SA CAT I	RA 171/14	150 DA 802	
S-ILS 4	SA CAT II	RA 115/12	100 DA 752	

SA CATEGORY I & II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

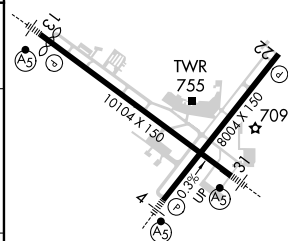

HIRL Rwy 4-22 and 13-31

40°40'N-89°42'W

GENERAL DOWNING-PEORIA INTL (PIA)
ILS RWY 4 (SA CAT I & II)

EC-3, 21 MAR 2024 to 18 APR 2024