

LOC I-HSV <u>109.3</u>	APP CRS 185°	Rwy Idg 12600 TDZE 629 Apt Elev 629
----------------------------------	------------------------	--

ILS or LOC RWY 18R
HUNTSVILLE INTL-CARL T JONES FLD (HSV)


DME required. RADAR required for procedure entry.

T Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized. For inop ALS, increase S-ILS 18R Cat E visibility to RVR 4000 and S-LOC 18R Cat E visibility to 1 1/4 SM. DME from RQZ VORTAC. DME use requires simultaneous reception of I-HSV and RQZ DME.

ALSF-2

MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 on heading 270° and RQZ R-230 to JUVLO/RQZ 28.7 DME and hold.

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 0 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
----------------	-------------------------------------	---	--------------------------	--------------------	------------------

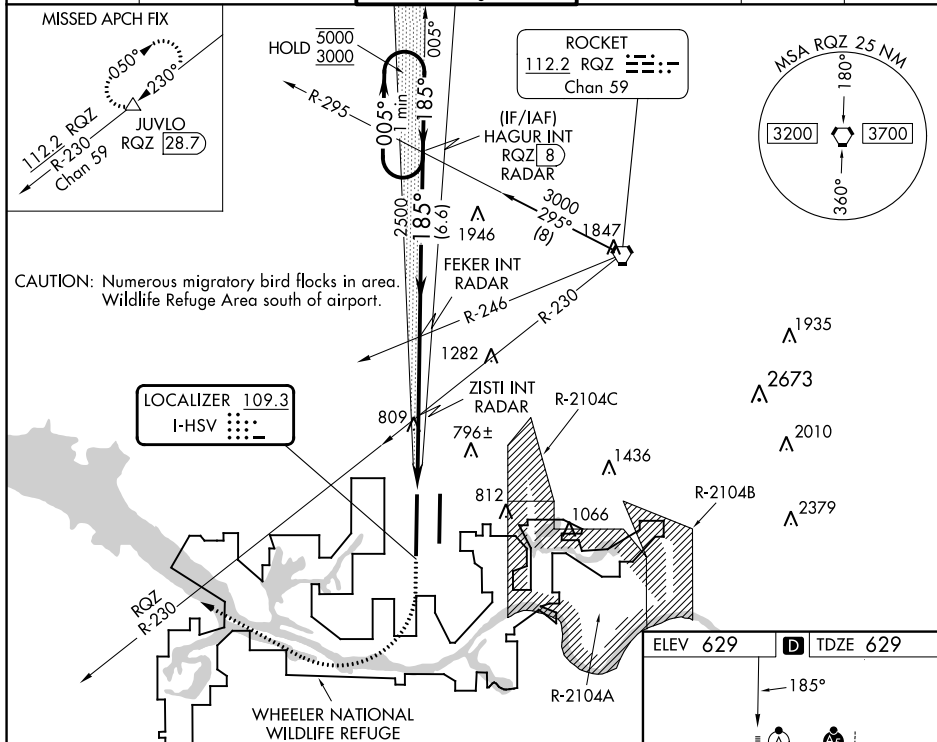

CATEGORY	A	B	C	D	E
S-ILS 18R	829/18 200 (200-½)				
S-LOC 18R	1060/24 431 (500-½)		1060/40 431 (500-¾)		
C CIRCLING	1160-1 531 (600-1)		1160-1½ 531 (600-1½)	1240-2 611 (700-2)	1260-2¼ 631 (700-2¼)

FAF to MAP 5.7 NM

Min:Sec 5:42 3:48 2:51 2:17 1:54