


APP CRS	Rwy Idg	8000
101°	TDZE	815
	Apt Elev	815


RNAV (RNP) Z RWY 10L
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct APE VORTAC and hold.
Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.30 all Cnts visibility to RVR 6000.		

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

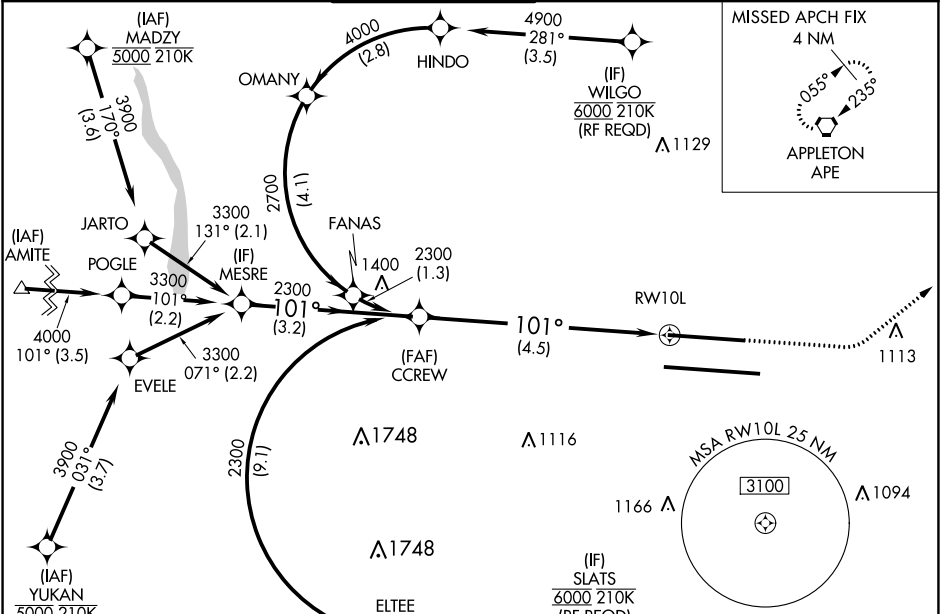


ELEV	815	TDZE	815
------	-----	------	-----

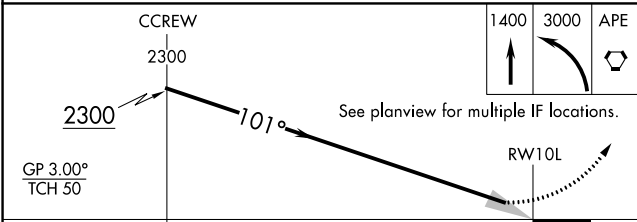

CATEGORY	A	B	C	D
RNP 0.13 DA	1148/26	333 (400- $\frac{3}{4}$)		
RNP 0.26 DA	1198/35	383 (400- $\frac{3}{4}$)		
RNP 0.30 DA	1216/40	401 (500- $\frac{3}{4}$)		

AUTHORIZATION REQUIRED

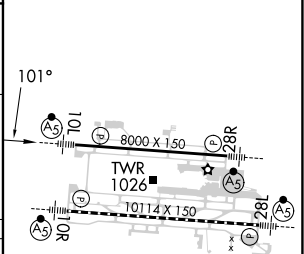

TDZ/CL Rwy 10R-28L	
HIRL Rwys 10R-28L and 10L-28R	