


WAAS CH 90505 W04A	APP CRS 037°	Rwy Idg 5500 TDZE 904 Apt Elev 904
--	------------------------	---

RNAV (GPS) RWY 4
BOLTON FLD (TZR)

RNP APCH. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and LNAV Cats C/D visibility to 1½ SM.	MALSRL AS	MISSED APPROACH: Climb to 3000 direct OYILU and left turn on track 294° to MECAN and hold.
---	---	---

AWOS-3PT 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
----------------------------	--	---	-------------------------

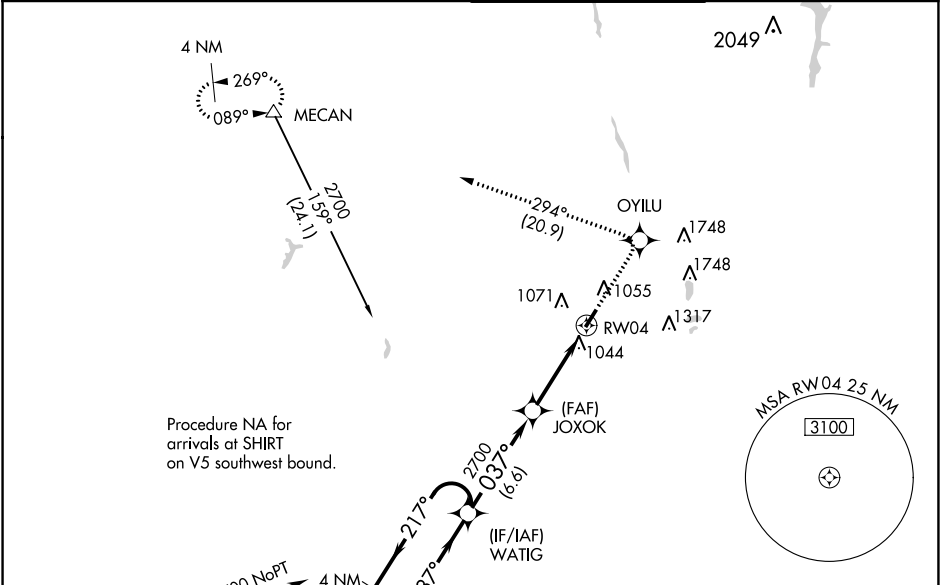

4 NM Holding Pattern				
VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).				
WATIG JOXOK 6000 2700 217° 037° 037° 2700 6.6 NM 4 NM 1.4 NM 3000 OYILU tr 294° MECAN *LNAV only.				
GP 3.00° TCH 39				
CATEGORY	A	B	C	D
LPV DA	1163-½ 259 (300-½)			
LNAV/VNAV DA	1325-1 421 (500-1)			
LNAV MDA	1360-½ 456 (500-½)	1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)	
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

